




# PROBLEM SUMMARY


Sample Rating Trend

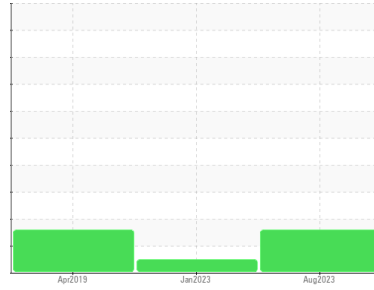

Machine Id  
**KAESER AS 25T 4434292 (S/N 1056)**  
 Component  
**Compressor**  
 Fluid  
**KAESER SIGMA (OEM) M-460 (--- GAL)**

## COMPONENT CONDITION SUMMARY

▲ Particle Trend

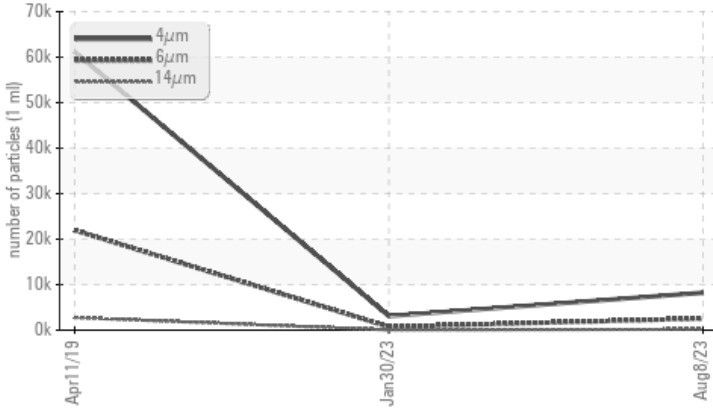

## RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

## PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	NORMAL	ABNORMAL
Particles >6µm	ASTM D7647	>1300	▲ 2550	737	▲ 21947
Particles >14µm	ASTM D7647	>80	▲ 184	49	▲ 2755
Particles >21µm	ASTM D7647	>20	▲ 49	13	▲ 813
Oil Cleanliness	ISO 4406 (c)	>--/17/13	▲ 20/19/15	19/17/13	▲ 22/19

Customer Id: CARSTVA  
 Sample No.: KCPA005128  
 Lab Number: 05924342  
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:  
 Don Baldrige +1  
[don.b505@comcast.net](mailto:don.b505@comcast.net)

To change component or sample information:  
 Customer Service +1 1-800-237-1369  
[customerservice@wearcheck.com](mailto:customerservice@wearcheck.com)

## RECOMMENDED ACTIONS

*There are no recommended actions for this sample.*

## HISTORICAL DIAGNOSIS

### 30 Jan 2023 Diag: Doug Bogart

NORMAL



Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



### 11 Apr 2019 Diag: Don Baldrige

ISO



No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





# OIL ANALYSIS REPORT

Sample Rating Trend

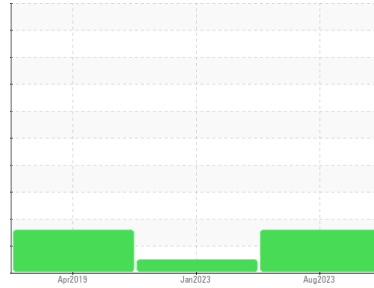

ISO



Machine Id  
**KAESER AS 25T 4434292 (S/N 1056)**

Component  
**Compressor**  
Fluid  
**KAESER SIGMA (OEM) M-460 (--- GAL)**

## DIAGNOSIS

### Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is a high amount of particulates present in the oil.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>KCPA005128</b>	KCP54499	KCP19387
Sample Date	Client Info		<b>08 Aug 2023</b>	30 Jan 2023	11 Apr 2019
Machine Age	hrs	Client Info	<b>61120</b>	58778	34495
Oil Age	hrs	Client Info	<b>0</b>	0	0
Oil Changed	Client Info		<b>N/A</b>	Changed	Changed
Sample Status			<b>ABNORMAL</b>	NORMAL	ABNORMAL

## WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >50	<b>0</b>	0	1
Chromium	ppm	ASTM D5185m >10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185m >3	<b>0</b>	0	0
Titanium	ppm	ASTM D5185m >3	<b>0</b>	0	0
Silver	ppm	ASTM D5185m >2	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m >10	<b>&lt;1</b>	0	<1
Lead	ppm	ASTM D5185m >10	<b>0</b>	0	0
Copper	ppm	ASTM D5185m >50	<b>&lt;1</b>	4	4
Tin	ppm	ASTM D5185m >10	<b>0</b>	0	0
Antimony	ppm	ASTM D5185m	<b>---</b>	---	0
Vanadium	ppm	ASTM D5185m	<b>0</b>	0	0
Cadmium	ppm	ASTM D5185m	<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 0	<b>0</b>	0	<1
Barium	ppm	ASTM D5185m 90	<b>0</b>	0	<1
Molybdenum	ppm	ASTM D5185m 0	<b>0</b>	0	0
Manganese	ppm	ASTM D5185m	<b>0</b>	0	0
Magnesium	ppm	ASTM D5185m 100	<b>53</b>	40	42
Calcium	ppm	ASTM D5185m 0	<b>0</b>	0	<1
Phosphorus	ppm	ASTM D5185m 0	<b>3</b>	8	<1
Zinc	ppm	ASTM D5185m 0	<b>5</b>	18	30
Sulfur	ppm	ASTM D5185m 23500	<b>17742</b>	18106	24434

## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	<b>0</b>	<1	<1
Sodium	ppm	ASTM D5185m	<b>13</b>	11	16
Potassium	ppm	ASTM D5185m >20	<b>2</b>	3	3
Water	%	ASTM D6304 >0.05	<b>0.028</b>	0.022	0.017
ppm Water	ppm	ASTM D6304 >500	<b>288.7</b>	225.7	170






## FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647		<b>8224</b>	3097	61148
Particles >6µm	ASTM D7647 >1300		<b>▲ 2550</b>	737	▲ 21947
Particles >14µm	ASTM D7647 >80		<b>▲ 184</b>	49	▲ 2755
Particles >21µm	ASTM D7647 >20		<b>▲ 49</b>	13	▲ 813
Particles >38µm	ASTM D7647 >4		<b>1</b>	1	▲ 29
Particles >71µm	ASTM D7647 >3		<b>0</b>	0	0
Oil Cleanliness	ISO 4406 (c) >--/17/13		<b>▲ 20/19/15</b>	19/17/13	▲ 22/19

## FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045 1.0	<b>0.39</b>	0.35	0.390


# OIL ANALYSIS REPORT

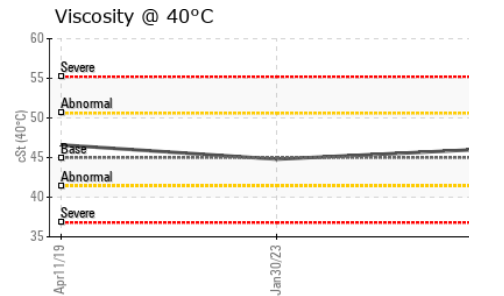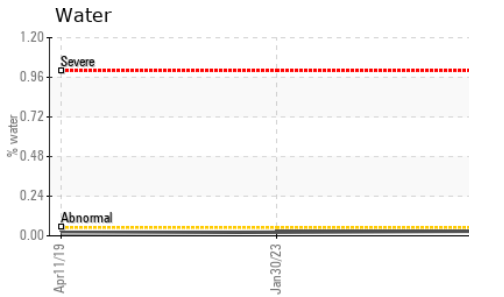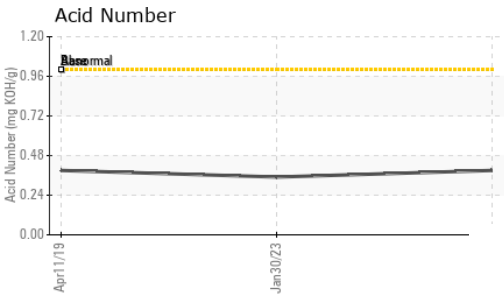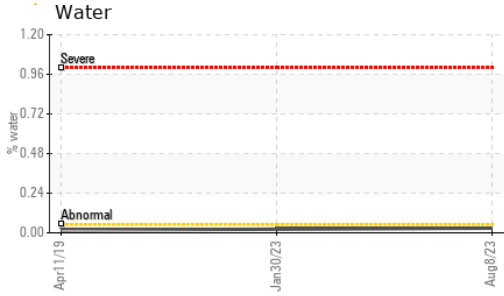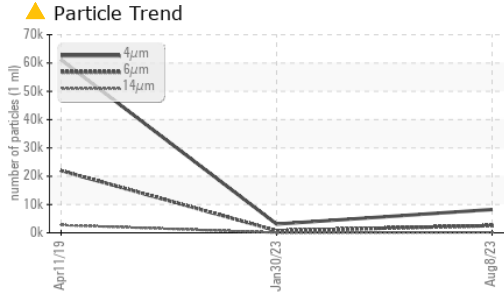





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	LIGHT
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	LIGHT	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	45	46.1	44.8

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

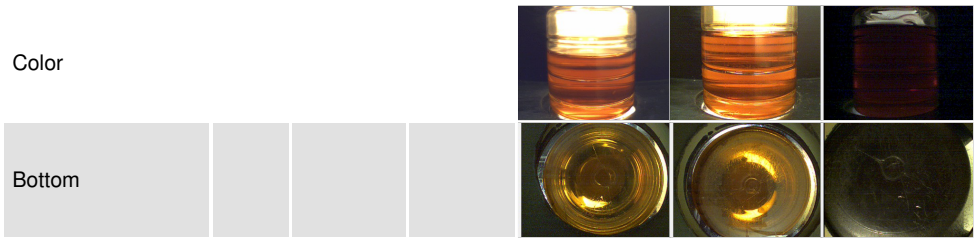

## GRAPHS

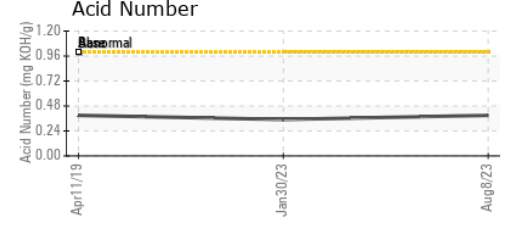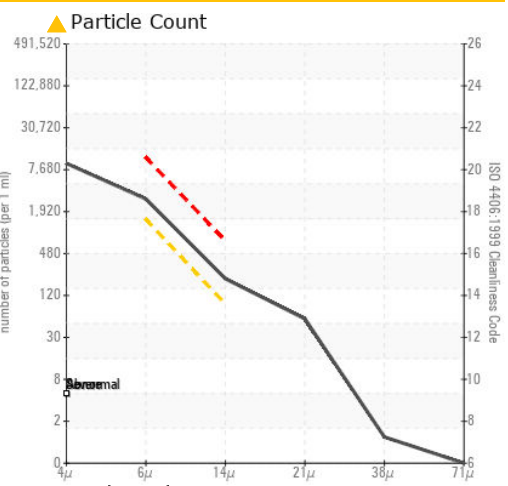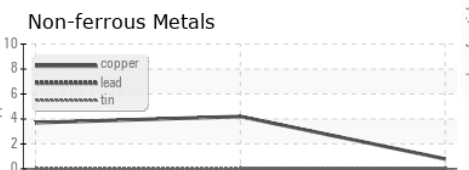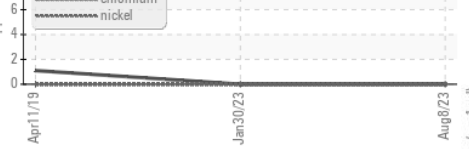

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : KCPA005128 **Received** : 14 Aug 2023  
**Lab Number** : 05924342 **Diagnosed** : 16 Aug 2023  
**Unique Number** : 10604289 **Diagnostician** : Don Baldrige  
**Test Package** : IND 2 ( Additional Tests: KF, PrtCount )

**CARMAX 7132-DULLES**  
 45210 TOWLERN PL  
 STERLING, VA  
 US 20166  
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
F: