

# **PROBLEM SUMMARY**

Sample Rating Trend



KAESER 8763640

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

### **COMPONENT CONDITION SUMMARY**



### RECOMMENDATION

The filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS								
Sample Status		ABNORMAL						
Water	%	ASTM D6304	>0.05	<b>△</b> 0.130				
ppm Water	ppm	ASTM D6304	>500	<b>1300</b>				
Debris	scalar	*Visual	NONE	▲ MODER				
Appearance	scalar	*Visual	NORML	▲ HAZY				
Emulsified Water	scalar	*Visual	>0.05	<b>0.2%</b>				

Customer Id: PARSTAKC Sample No.: KCPA005612 Lab Number: 05924346 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net


To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.		

# HISTORICAL DIAGNOSIS



# **OIL ANALYSIS REPORT**

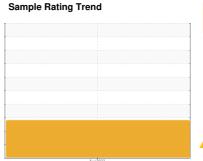

WATER



Machine Id

# **KAESER 8763640**

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

### DIAGNOSIS

#### Recommendation

The filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

#### Wear

All component wear rates are normal.

### Contamination

Moderate concentration of visible dirt/debris present in the oil. There is a light concentration of water present in the oil.

### **Fluid Condition**

The AN level is acceptable for this fluid.

SAMPLE INFORMA	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA005612		
Sample Date		Client Info		08 Aug 2023		
Machine Age	hrs	Client Info		3527		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	4		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	100	28		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	5		
Zinc	ppm	ASTM D5185m	0	4		
Sulfur	ppm	ASTM D5185m	23500	16806		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		5		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.05	<b>△</b> 0.130		
ppm Water	ppm	ASTM D6304	>500	<b>1300</b>		
FLUID DEGRADAT	TON	method	limit/base	current	history1	history2


0.31

Acid Number (AN)

mg KOH/g ASTM D8045 1.0



### **OIL ANALYSIS REPORT**

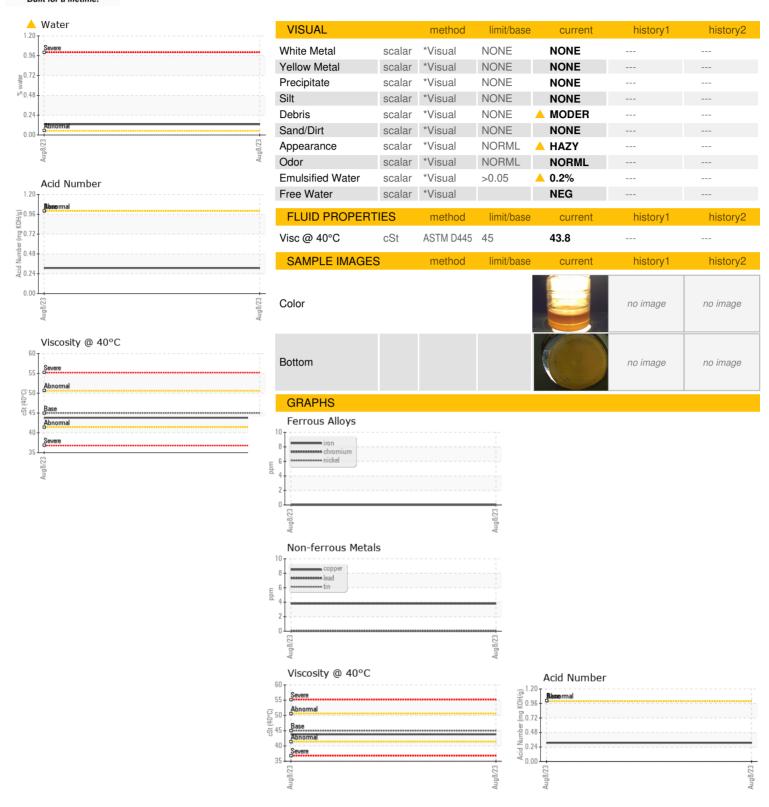





Laboratory Sample No. Lab Number Unique Number

: 05924346

: 10604293

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : KCPA005612 Received

Diagnosed Diagnostician : Don Baldridge

: 14 Aug 2023

: 16 Aug 2023

Test Package : IND 2 ( Additional Tests: KF, PrtCount ) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**PARKER HANNIFIN CORP** 

149 CRAWFORD RD STATESVILLE, NC

US 28625

Contact: Service Manager

T:

F: