




PROBLEM SUMMARY

Sample Rating Trend

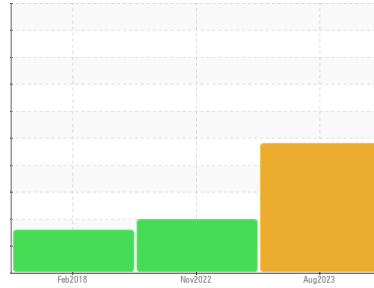

WATER




Machine Id
KAESER SK 15 4870098 (S/N 1026)

Component
Compressor

Fluid
KAESER SIGMA (OEM) S-460 (--- GAL)

COMPONENT CONDITION SUMMARY

▲ Water

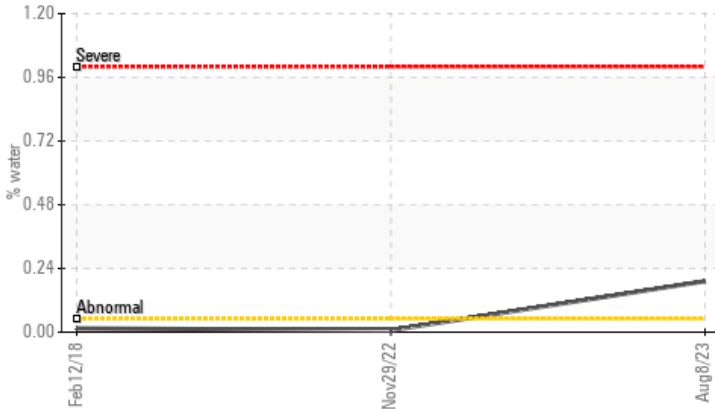

RECOMMENDATION

We recommend you service the filters on this component. We were unable to perform a particle count due to a high concentration of particles present in this sample. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
Water	%	ASTM D6304	>0.05	▲ 0.192	0.007	0.014
ppm Water	ppm	ASTM D6304	>500	▲ 1920	74.1	140
Silt	scalar	*Visual	NONE	▲ MODER	NONE	NONE
Appearance	scalar	*Visual	NORML	▲ HAZY	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	▲ 0.2%	NEG	NEG
Free Water	scalar	*Visual		▲ 1.0	NEG	NEG

Customer Id: URBSTL
 Sample No.: KCPA005946
 Lab Number: 05924350
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

29 Nov 2022 Diag: Don Baldrige

ISO



No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



12 Feb 2018 Diag: Angela Borella

ISO




The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



Machine Id
KAESER SK 15 4870098 (S/N 1026)

Component
Compressor
Fluid
KAESER SIGMA (OEM) S-460 (--- GAL)

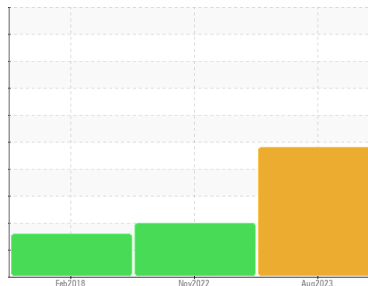

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. We were unable to perform a particle count due to a high concentration of particles present in this sample. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of visible silt present in the sample. There is a light concentration of water present in the oil. Free water present.

Fluid Condition

The AN level is acceptable for this fluid.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			KCPA005946	KCP49887	KCP03607
Sample Date	Client Info			08 Aug 2023	29 Nov 2022	12 Feb 2018
Machine Age	hrs	Client Info		20790	13192	8724
Oil Age	hrs	Client Info		0	4000	3096
Oil Changed	Client Info			N/A	Changed	Not Chngd
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	<1
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m	>3	0	0	0
Titanium	ppm	ASTM D5185m	>3	0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>10	<1	0	<1
Lead	ppm	ASTM D5185m	>10	0	0	<1
Copper	ppm	ASTM D5185m	>50	9	31	5
Tin	ppm	ASTM D5185m	>10	0	0	0
Antimony	ppm	ASTM D5185m		---	---	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0




ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m	90	0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	<1
Manganese	ppm	ASTM D5185m		<1	0	<1
Magnesium	ppm	ASTM D5185m	90	18	<1	38
Calcium	ppm	ASTM D5185m	2	0	0	0
Phosphorus	ppm	ASTM D5185m		3	30	34
Zinc	ppm	ASTM D5185m		32	56	19
Sulfur	ppm	ASTM D5185m		16743	20254	17294

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	<1	<1
Sodium	ppm	ASTM D5185m		2	<1	16
Potassium	ppm	ASTM D5185m	>20	<1	0	2
Water	%	ASTM D6304	>0.05	▲ 0.192	0.007	0.014
ppm Water	ppm	ASTM D6304	>500	▲ 1920	74.1	140

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		---	23648	9364
Particles >6µm		ASTM D7647	>1300	---	▲ 9420	▲ 2237
Particles >14µm		ASTM D7647	>80	---	▲ 920	▲ 320
Particles >21µm		ASTM D7647	>20	---	▲ 259	▲ 97
Particles >38µm		ASTM D7647	>4	---	▲ 12	▲ 7
Particles >71µm		ASTM D7647	>3	---	1	1
Oil Cleanliness		ISO 4406 (c)	>--/17/13	---	▲ 22/20/17	▲ 18/15

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.32	0.36	0.327


OIL ANALYSIS REPORT

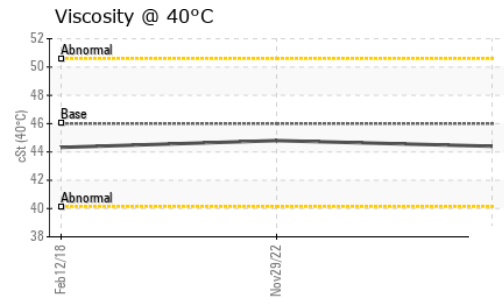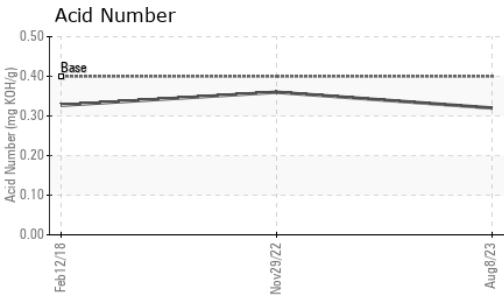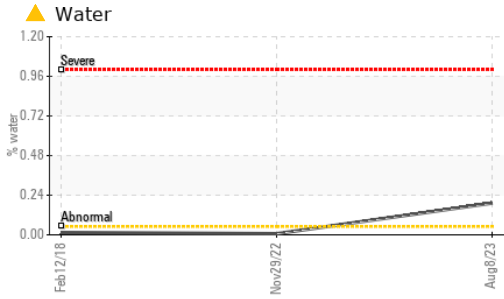





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	▲ MODER	NONE
Debris	scalar	*Visual	NONE	LIGHT	LIGHT
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	▲ HAZY	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	▲ 0.2%	NEG
Free Water	scalar	*Visual		▲ 1.0	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 46	44.4	44.8	44.32

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

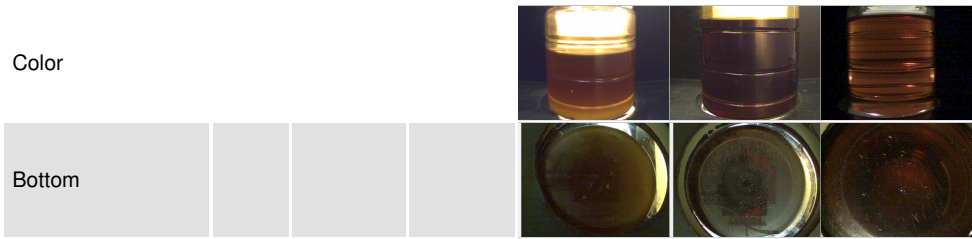

GRAPHS

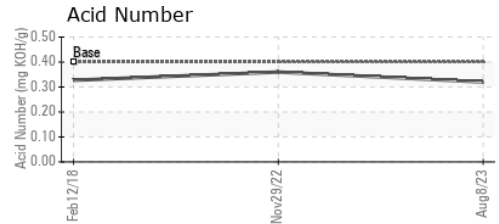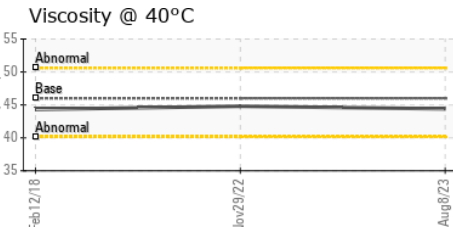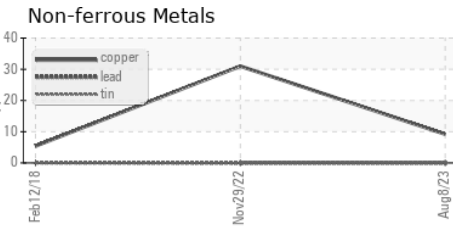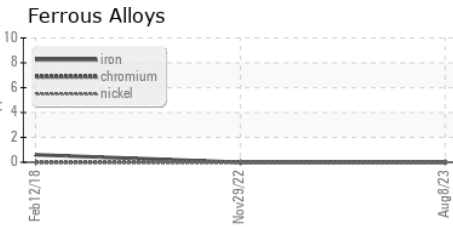

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : KCPA005946 **Received** : 14 Aug 2023
Lab Number : 05924350 **Diagnosed** : 16 Aug 2023
Unique Number : 10604297 **Diagnostician** : Don Baldrige
Test Package : IND 2 (Additional Tests: KF, PrtCount)

URBAN CHESTNUT
 3229 WASHINGTON AVE
 ST LOUIS, MO
 US 63103
 Contact:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: