




PROBLEM SUMMARY

Sample Rating Trend

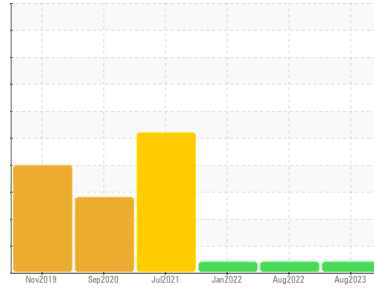


VISCOSITY



Machine Id
HPDL_U2220 HPDL_U2220_P2220
 Component
Non-Drive End Pump
 Fluid
ROYAL PURPLE SYNFILM GT 32 (3 QTS)

COMPONENT CONDITION SUMMARY

▲ Viscosity @ 40°C

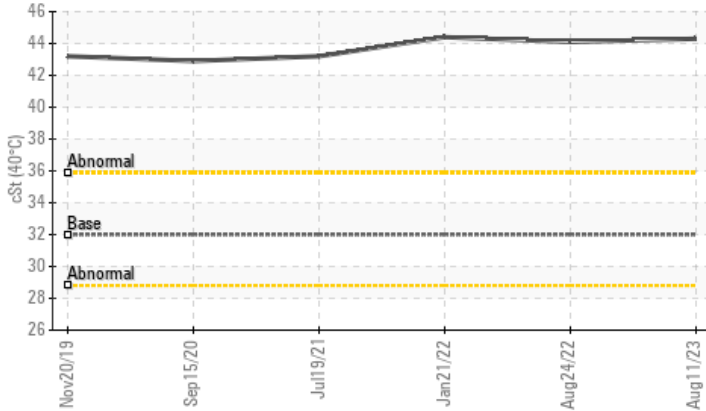

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status				ATTENTION	ATTENTION	ATTENTION
Visc @ 40°C	cSt	ASTM D445	32	▲ 44.3	▲ 44.1	▲ 44.4

Customer Id: ENEJEW
 Sample No.: RP0021538
 Lab Number: 05924383
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

24 Aug 2022 Diag: Doug Bogart

VISCOSITY



Resample at the next service interval to monitor. All component wear rates are normal. The water content is negligible. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 46 range, advise investigate. Confirm oil type. The AN level is acceptable for this fluid.

view report



21 Jan 2022 Diag: Jonathan Hester

VISCOSITY



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. The water content is negligible. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 46 range, advise investigate. Confirm oil type. The AN level is acceptable for this fluid.

view report



19 Jul 2021 Diag: Jonathan Hester

DIRT



No corrective action is recommended at this time. We recommend an early resample to monitor this condition. The iron level is abnormal. The copper level is abnormal. Moderate concentration of visible metal present. Elemental level of silicon (Si) above normal indicating ingress of seal material. Moderate concentration of visible dirt/debris present in the oil. The water content is negligible. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

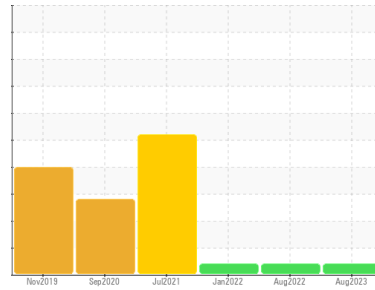

VISCOSITY



Machine Id
HPDL_U2220 HPDL_U2220_P2220
 Component
Non-Drive End Pump
 Fluid
ROYAL PURPLE SYNFILM GT 32 (3 QTS)

DIAGNOSIS

▲ Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.

▲ Fluid Condition

Viscosity of sample indicates oil is within ISO 46 range, advise investigate. Confirm oil type. The AN level is acceptable for this fluid.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		RP0021538	RP0017622	RP0017727
Sample Date	Client Info		11 Aug 2023	24 Aug 2022	21 Jan 2022
Machine Age	hrs	Client Info	22379	13865	13865
Oil Age	hrs	Client Info	22379	13865	11412
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			ATTENTION	ATTENTION	ATTENTION

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >75	18	9	12
Chromium	ppm	ASTM D5185m >5	0	0	<1
Nickel	ppm	ASTM D5185m	0	0	0
Titanium	ppm	ASTM D5185m	0	0	0
Silver	ppm	ASTM D5185m	0	0	<1
Aluminum	ppm	ASTM D5185m >5	<1	<1	<1
Lead	ppm	ASTM D5185m >10	0	<1	0
Copper	ppm	ASTM D5185m >15	3	9	4
Tin	ppm	ASTM D5185m	<1	1	1
Antimony	ppm	ASTM D5185m	---	---	0
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	22
Barium	ppm	ASTM D5185m	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0
Manganese	ppm	ASTM D5185m	<1	<1	<1
Magnesium	ppm	ASTM D5185m	94	59	80
Calcium	ppm	ASTM D5185m	0	0	2
Phosphorus	ppm	ASTM D5185m	3	5	3
Zinc	ppm	ASTM D5185m	0	1	0




CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >20	5	2	1
Sodium	ppm	ASTM D5185m	<1	0	0
Potassium	ppm	ASTM D5185m >20	2	0	<1
Water	%	ASTM D6304	0.015	0.013	0.006
ppm Water	ppm	ASTM D6304 >.1	156.2	137.1	62.0

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.39	0.32	0.38

OIL ANALYSIS REPORT

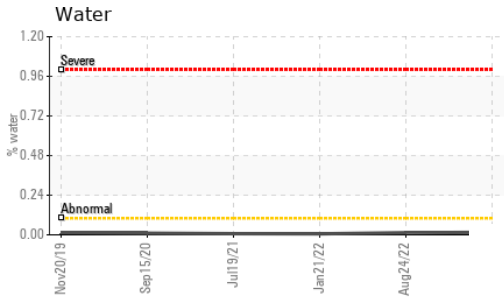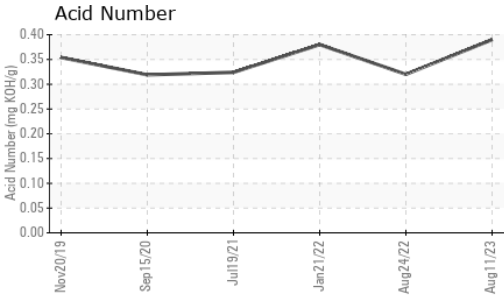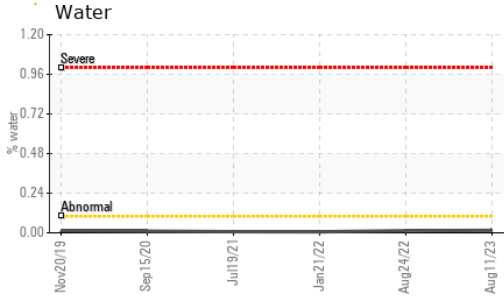





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	NEG	NEG	NEG
Free Water	scalar	*Visual	NEG	NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 32	▲ 44.3	▲ 44.1	▲ 44.4

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------



GRAPHS

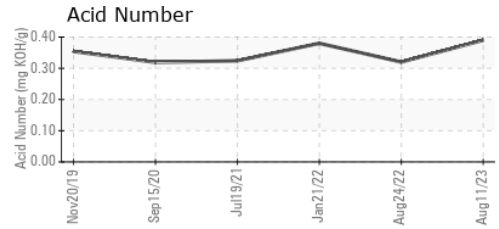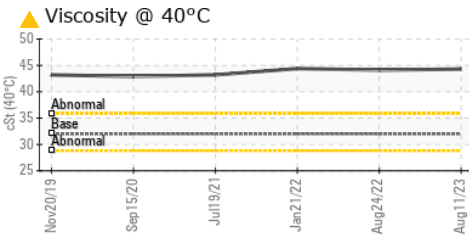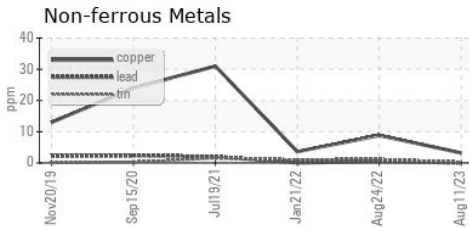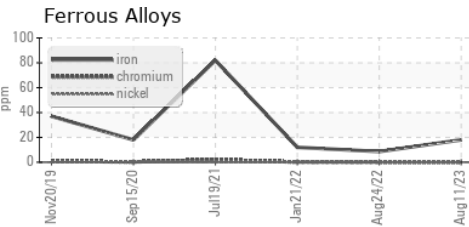

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : RP0021538 **Received** : 14 Aug 2023
Lab Number : 05924383 **Diagnosed** : 16 Aug 2023
Unique Number : 10604330 **Diagnostician** : Don Baldrige
Test Package : IND 2

ENERGY TRANSFER - HOPEDALE
 46725 GIACOBBI ROAD
 JEWETT, OH
 US 43986
 Contact: KEN VOLL

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (330)414-2573

F: