




Area
[9456]
 Machine Id
VOLVO L70H 622306
 Component
Diesel Fuel
 Fluid
NOT GIVEN (--- GAL)

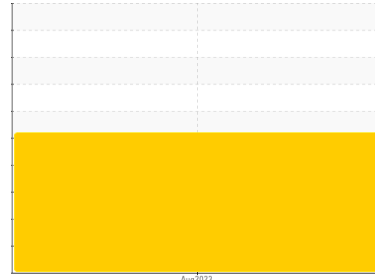

DIAGNOSIS

Recommendation

We advise that you follow the water drain-off procedure for this component. We recommend you service and check the fuel filters for mucous-like deposits. Check with fuel supplier for biocides available to destroy the microorganisms in the fuel system.

Corrosion

All metal levels are normal indicating no corrosion in the system.

Contaminants

Excessive free water present. Light concentration of visible dirt/debris present in the fuel. Possible bacteria or fungus (yeast and/or mold) present in the sample.

Fuel Condition

The fuel is no longer serviceable due to the presence of contaminants.

SAMPLE INFORMATION method limit/base current history1 history2

Sample Number	Client Info	VCP413946	---	---
Sample Date	Client Info	10 Aug 2023	---	---
Machine Age hrs	Client Info	10937	---	---
Sample Status		SEVERE	---	---

PHYSICAL PROPERTIES method limit/base current history1 history2

Visc @ 40°C	cSt	ASTM D445	2.46	---	---
-------------	-----	-----------	-------------	-----	-----

SULFUR CONTENT method limit/base current history1 history2

Sulfur	ppm	ASTM D5185m	0	---	---
--------	-----	-------------	----------	-----	-----

CONTAMINANTS method limit/base current history1 history2

Silicon	ppm	ASTM D5185m	<1.0	0	---	---
Sodium	ppm	ASTM D5185m	<0.1	2	---	---
Potassium	ppm	ASTM D5185m	<0.1	0	---	---
Water	%	ASTM D6304	<0.05	0.014	---	---
ppm Water	ppm	ASTM D6304	<500	145.3	---	---

HEAVY METALS method limit/base current history1 history2





Aluminum	ppm	ASTM D5185m	<0.1	0	---	---
Nickel	ppm	ASTM D5185m	<0.1	0	---	---
Lead	ppm	ASTM D5185m	<0.1	0	---	---
Vanadium	ppm	ASTM D5185m	<0.1	<1	---	---
Iron	ppm	ASTM D5185m	<0.1	0	---	---
Calcium	ppm	ASTM D5185m	<0.1	0	---	---
Magnesium	ppm	ASTM D5185m	<0.1	0	---	---
Phosphorus	ppm	ASTM D5185m	<0.1	0	---	---
Zinc	ppm	ASTM D5185m	<0.1	0	---	---

SAMPLE IMAGES method limit/base current history1 history2

Color					no image	no image
Bottom					no image	no image

FUEL REPORT

GRAPHS

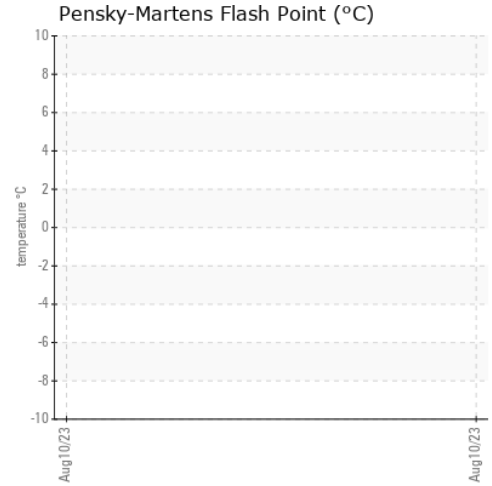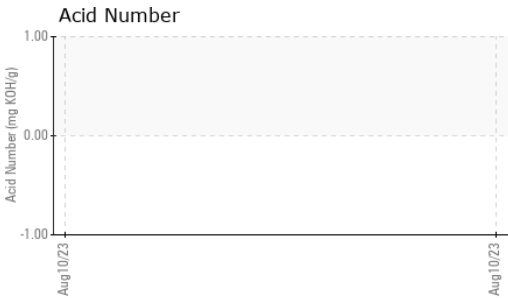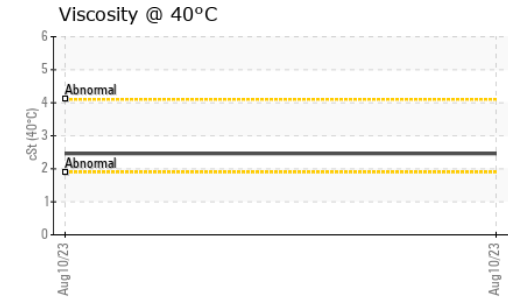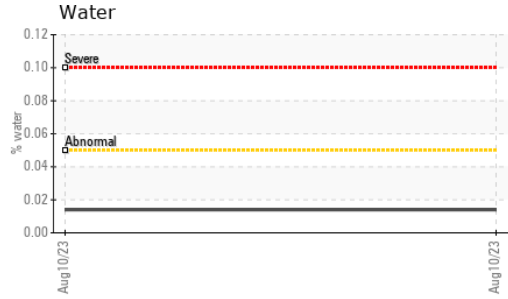

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP413946 **Received** : 14 Aug 2023
Lab Number : **05924612** **Diagnosed** : 25 Aug 2023
Unique Number : 10604559 **Diagnostician** : Doug Bogart
Test Package : MOB 1 (Additional Tests: Bacteria, KF)

MCCLUNG-LOGAN EQUIPMENT CO INC MAIN
 4601 WASHINGTON BOULEVARD
 BALTIMORE, MD
 US 21227
 Contact: MARK CIULLA
 mciulla@mcclung-logan.com
 T: (410)242-6500
 F: (410)242-7835

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)