

# **PROBLEM SUMMARY**

### Sample Rating Trend


ISO

# North Plant-Crystallization Machine Id PU-2512B

Component Hydraulic System

**ROYAL PURPLE SYNDRAULIC 46 (20 GAL)** 

### **COMPONENT CONDITION SUMMARY**

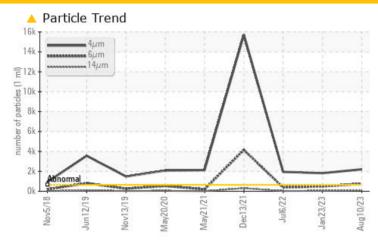

### RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status		ABNO	DRMAL ABNORMAL	ABNORMAL					
Particles >4µm	ASTM D7647	>640 🛕 220	<b>△</b> 1816	<u>▲</u> 1945					
Particles >6µm	ASTM D7647	>160 ^ 744	495	<b>△</b> 377					
Particles >14µm	ASTM D7647	>40 🛕 108	<b>△</b> 45	28					
Particles >21μm	ASTM D7647	>10 <b>^ 27</b>	<b>▲</b> 11	7					
Oil Cleanliness	ISO 4406 (c)	>16/14/12 🔺 <b>18</b> /	<b>17/14 \( \text{\Lambda} \)</b> 18/16/13	▲ 18/16/12					

Customer Id: AJIEDD Sample No.: WC0786790 Lab Number: 05926103 Test Package: PLANT



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

### **RECOMMENDED ACTIONS**

Action	Status	Date	Done By	Description
Change Filter			?	We recommend you service the filters on this component.

### HISTORICAL DIAGNOSIS

### 23 Jan 2023 Diag: Don Baldridge





We recommend you service the filters on this component. Resample at the next service interval to monitor.All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



### 06 Jul 2022 Diag: Don Baldridge





We recommend you service the filters on this component. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

# view report

### 13 Dec 2021 Diag: Angela Borella

ISO




We recommend you service the filters on this component. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





# **OIL ANALYSIS REPORT**

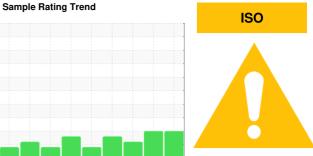

# North Plant-Crystallization PU-2512B

Component

**Hydraulic System** 

**ROYAL PURPLE SYNDRAULIC 46 (20 GAL)** 

## **DIAGNOSIS**

### Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is a high amount of particulates present in the oil.

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

)		Nov2018 Jur	2019 Nov2019 May2020	May2021 Dec2021 Jul2022 Jan20	23 Aug <sup>2</sup> 023	
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0786790	WC0723606	WC0686382
Sample Date		Client Info		10 Aug 2023	23 Jan 2023	06 Jul 2022
Machine Age	mths	Client Info		0	0	0
Oil Age	mths	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	<1	<1	1
Chromium	ppm	ASTM D5185m	>10	4	4	4
Nickel	ppm	ASTM D5185m	>10	2	0	2
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	2
Aluminum	ppm	ASTM D5185m		0	0	0
Lead	ppm	ASTM D5185m	>10	<1	0	0
Copper	ppm	ASTM D5185m		6	6	6
Tin	ppm	ASTM D5185m	>10	<1	<1	<1
Antimony	ppm	ASTM D5185m				
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	<1
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	<1
Barium	ppm	ASTM D5185m		1	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m		3	2	2
Calcium	ppm	ASTM D5185m	150	113	118	130
Phosphorus	ppm	ASTM D5185m	670	522	533	534
Zinc	ppm	ASTM D5185m	800	644	674	698
Sulfur	ppm	ASTM D5185m		16022	15898	17421
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	<1	<1	1
Sodium	ppm	ASTM D5185m		0	0	1
Potassium	ppm	ASTM D5185m	>20	1	<1	0
Water	%	ASTM D6304	>0.1	0.008	0.004	0.010
ppm Water	ppm	ASTM D6304	>1000	81.1	48.8	106.2
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>640	<b>2206</b>	<u>▲</u> 1816	<b>△</b> 1945
Particles >6μm		ASTM D7647	>160	<u>^</u> 744	<b>495</b>	<b>▲</b> 377
Particles >14µm		ASTM D7647	>40	<u>^</u> 108	<u>45</u>	28
Particles >21µm		ASTM D7647	>10	<u> </u>	<u> 11</u>	7
Particles >38μm		ASTM D7647	>3	0	0	0
Particles >71μm		ASTM D7647		0	0	0
Oil Cleanliness		ISO 4406 (c)	>16/14/12	<u> </u>	<u> </u>	▲ 18/16/12
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2

mg KOH/g ASTM D8045 1.0

Acid Number (AN)

0.69

0.63



### **OIL ANALYSIS REPORT**



Certificate L2367

**Unique Number** 

Test Package

: 10606050

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

: PLANT

Diagnostician

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

: Doug Bogart

Contact: Alan Brittain

brittaina@ajiusa.com

T: (641)295-0086

US 52553

F: