


OIL ANALYSIS REPORT



NORMAL

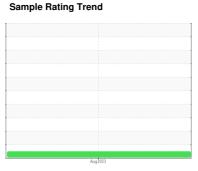

JC CROSS BLOWER 1

Component

Gearbox

ROYAL PURPLE SYNFILM GT 220 (--- GAL)

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

.)				Aug 2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0020989		
Sample Date		Client Info		02 Aug 2023		
Machine Age	hrs	Client Info		24637		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	23		
Chromium	ppm	ASTM D5185m	>15	0		
Nickel	ppm	ASTM D5185m	>15	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>100	0		
Copper	ppm	ASTM D5185m	>200	<1		
Tin	ppm	ASTM D5185m	>25	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		2		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		6		
Zinc	ppm	ASTM D5185m		0		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	<1		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.2	0.005		
ppm Water	ppm	ASTM D6304	>2000	57.7		
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.39		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	LIGHT		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		


NEG

scalar *Visual

n: LEESA ELSEMAN -- VISIOW



OIL ANALYSIS REPORT

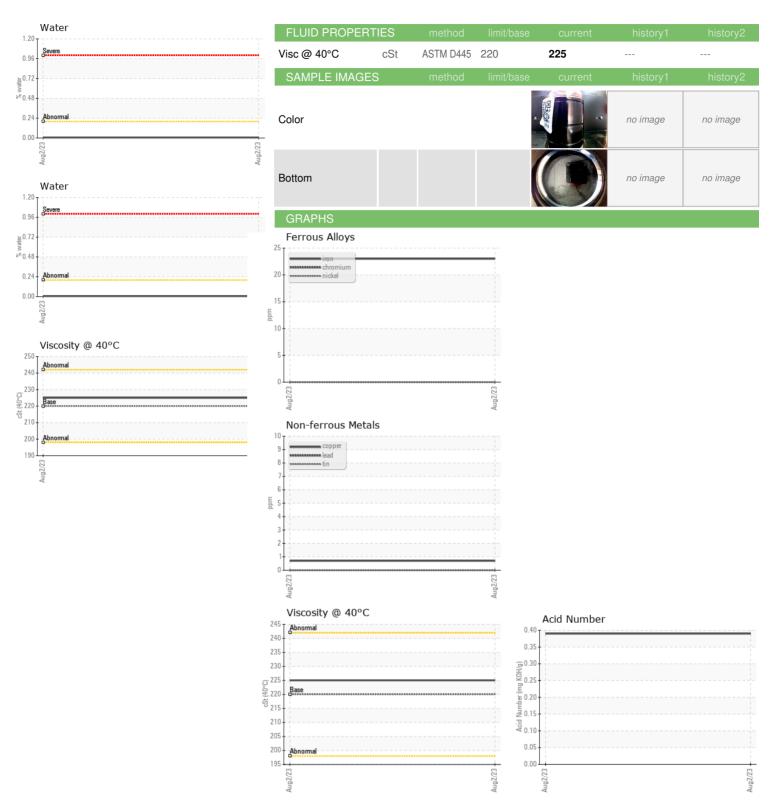





Certificate L2367

Laboratory

Sample No. Lab Number **Unique Number**

: RP0020989 : 05926179 : 10606126 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 16 Aug 2023 : 17 Aug 2023 Diagnostician : Don Baldridge

VISION INDUSTRIAL SALES 132 SOUTH MOUNT VERNON DR IOWA CITY, IA

US 52245

Contact: LEESA ELSEMAN vision@mchsi.com;jon.fazenbaker@wearcheck.com

T: (319)341-5823 F: (319)341-7867

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)