




# PROBLEM SUMMARY

Sample Rating Trend

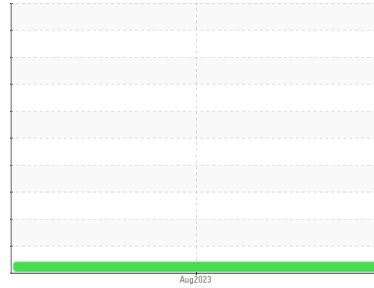

## VIS DEBRIS



Machine Id  
**KAESER 6667478**

Component  
**Compressor**

Fluid  
**KAESER SIGMA (OEM) M-460 (--- GAL)**

### COMPONENT CONDITION SUMMARY

No relevant graphs to display

### RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

### PROBLEMATIC TEST RESULTS

Sample Status				<b>ABNORMAL</b>	---	---
Debris	scalar	*Visual	NONE	<b>▲ MODER</b>	---	---

**Customer Id:** AMARIA  
**Sample No.:** KCPA004734  
**Lab Number:** 05926727  
**Test Package:** IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:  
Don Baldrige +1  
[don.b505@comcast.net](mailto:don.b505@comcast.net)

To change component or sample information:  
Customer Service +1 1-800-237-1369  
[customerservice@wearcheck.com](mailto:customerservice@wearcheck.com)

## RECOMMENDED ACTIONS


Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

## HISTORICAL DIAGNOSIS



# OIL ANALYSIS REPORT

Sample Rating Trend

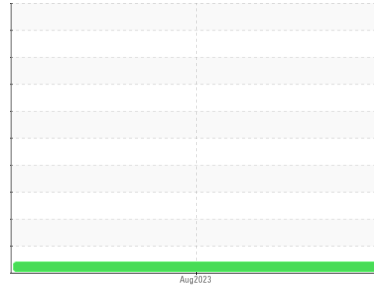

VIS DEBRIS



Machine Id  
**KAESER 6667478**

Component  
**Compressor**  
Fluid  
**KAESER SIGMA (OEM) M-460 (--- GAL)**

## DIAGNOSIS

### ▲ Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

### Wear

All component wear rates are normal.

### ▲ Contamination

Moderate concentration of visible dirt/debris present in the oil.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>KCPA004734</b>	---	---
Sample Date	Client Info		<b>08 Aug 2023</b>	---	---
Machine Age	hrs	Client Info	<b>20215</b>	---	---
Oil Age	hrs	Client Info	<b>15848</b>	---	---
Oil Changed	Client Info		<b>N/A</b>	---	---
Sample Status			<b>ABNORMAL</b>	---	---

## WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >50	<b>0</b>	---	---
Chromium	ppm	ASTM D5185m >10	<b>0</b>	---	---
Nickel	ppm	ASTM D5185m >3	<b>&lt;1</b>	---	---
Titanium	ppm	ASTM D5185m >3	<b>&lt;1</b>	---	---
Silver	ppm	ASTM D5185m >2	<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m >10	<b>0</b>	---	---
Lead	ppm	ASTM D5185m >10	<b>0</b>	---	---
Copper	ppm	ASTM D5185m >50	<b>5</b>	---	---
Tin	ppm	ASTM D5185m >10	<b>&lt;1</b>	---	---
Vanadium	ppm	ASTM D5185m	<b>&lt;1</b>	---	---
Cadmium	ppm	ASTM D5185m	<b>&lt;1</b>	---	---

## ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 0	<b>0</b>	---	---
Barium	ppm	ASTM D5185m 90	<b>48</b>	---	---
Molybdenum	ppm	ASTM D5185m 0	<b>0</b>	---	---
Manganese	ppm	ASTM D5185m	<b>&lt;1</b>	---	---
Magnesium	ppm	ASTM D5185m 100	<b>67</b>	---	---
Calcium	ppm	ASTM D5185m 0	<b>3</b>	---	---
Phosphorus	ppm	ASTM D5185m 0	<b>4</b>	---	---
Zinc	ppm	ASTM D5185m 0	<b>4</b>	---	---
Sulfur	ppm	ASTM D5185m 23500	<b>23603</b>	---	---




## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	<b>1</b>	---	---
Sodium	ppm	ASTM D5185m	<b>32</b>	---	---
Potassium	ppm	ASTM D5185m >20	<b>11</b>	---	---
Water	%	ASTM D6304 >0.05	<b>0.033</b>	---	---
ppm Water	ppm	ASTM D6304 >500	<b>339.1</b>	---	---

## FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045 1.0	<b>0.36</b>	---	---

# OIL ANALYSIS REPORT

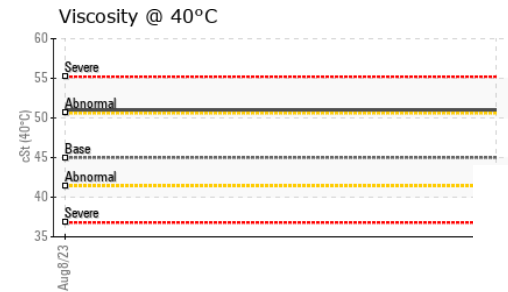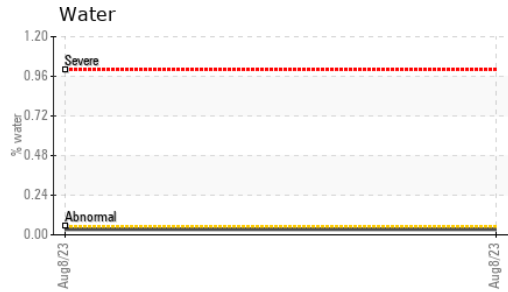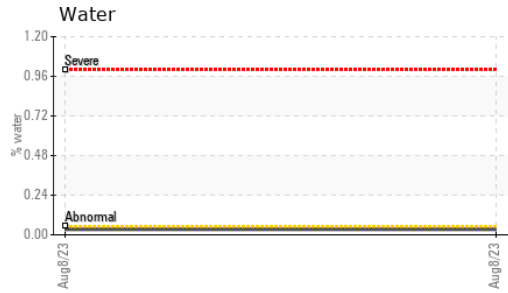





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---
Precipitate	scalar	*Visual	NONE	<b>NONE</b>	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---
Debris	scalar	*Visual	NONE	<b>▲ MODER</b>	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---
Emulsified Water	scalar	*Visual	>0.05	<b>NEG</b>	---
Free Water	scalar	*Visual		<b>NEG</b>	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	45	<b>51.0</b>	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color				no image	no image
Bottom				no image	no image

## GRAPHS

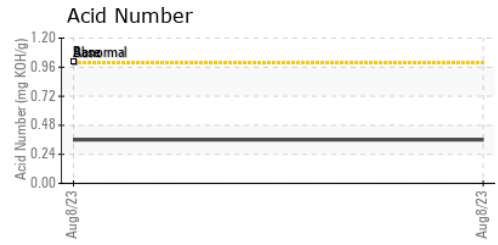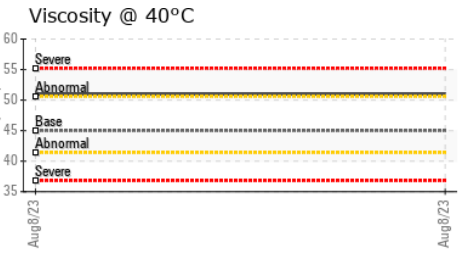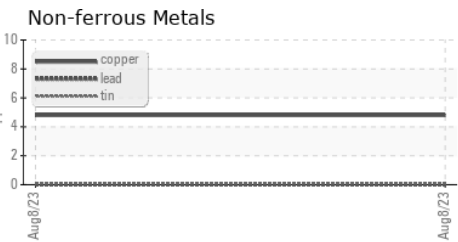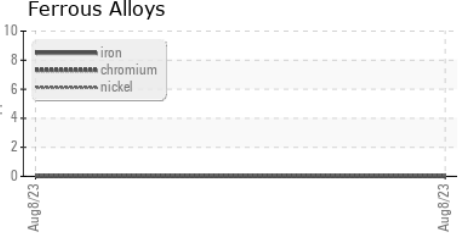

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : KCPA004734 **Received** : 16 Aug 2023  
**Lab Number** : 05926727 **Diagnosed** : 18 Aug 2023  
**Unique Number** : 10606674 **Diagnostician** : Don Baldrige  
**Test Package** : IND 2 ( Additional Tests: KF, PrtCount )

**AMAZON LGB 7**  
 1660 N LINDEN AVE  
 RIALTO, CA  
 US 92376  
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
F: