

Area [SR2970863]

### **FUEL REPORT**

Sample Rating Trend

# \_\_\_\_\_





GENERAC SD300 3009704662 Component Diesel Fuel

Fluid {not provided} (--- GAL)

#### DIAGNOSIS

#### Recommendation

All laboratory tests indicate that this sample meets specifications for No.2 ultra-low-sulfur diesel fuel.

#### Corrosion

All metal levels are normal indicating no corrosion in the system.

#### Contaminants

The water content is negligible. There is no Bacteria, Yeast and/or Fungus indicated in the sample. There is no indication of any contamination in the fuel.


#### **Fuel Condition**


Sulfur value derived by ASTM D4294 method for ULSD validation. Sulfur level is acceptable for ULSD specification.


SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		DC0030145		
Sample Date		Client Info		11 Aug 2023		
Machine Age	hrs	Client Info		27		
Sample Status				NORMAL		
PHYSICAL PROP	ERTIES	method	limit/base	current	history1	history2
ASTM Color	scalar	*ASTM D1500		L4.0		
Visc @ 40°C	cSt	ASTM D445		2.49		
SULFUR CONTER	NT	method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m		0		
Sulfur (UVF)	ppm	ASTM D5453		10		
IGNITION QUALIT	ΓY	method	limit/base	current	history1	history2
API Gravity		ASTM D7777		36.7		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	0		
Sodium	ppm	ASTM D5185m	<0.1	0		
Potassium	ppm	ASTM D5185m	<0.1	<1		
Water	%	ASTM D6304	<0.05	0.002		
ppm Water	ppm	ASTM D6304	<500	24.0		
% Gasoline	%	*In-House	<0.50	0.0		
% Biodiesel	%	*In-House	<20.0	0.0		
HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	0		
Nickel	ppm	ASTM D5185m	<0.1	0		
Lead	ppm	ASTM D5185m	<0.1	0		
Vanadium	ppm	ASTM D5185m	<0.1	0		
Iron	ppm	ASTM D5185m	<0.1	0		
Calcium	ppm	ASTM D5185m	<0.1	0		
Magnesium	ppm	ASTM D5185m	<0.1	0		
Phosphorus	ppm	ASTM D5185m	<0.1	<1		
Zinc	ppm	ASTM D5185m	<0.1	0		
SAMPLE IMAGES	\$	method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image



## **FUEL REPORT**

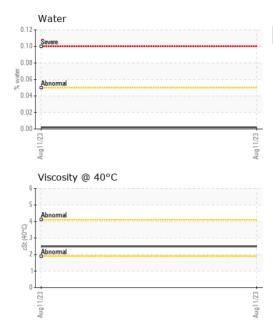

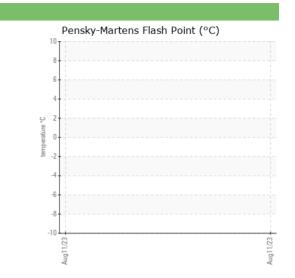

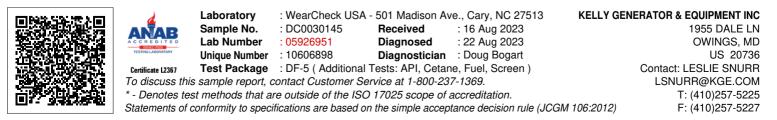

Contact/Location: LESLIE SNURR - KELOWI