




PROBLEM SUMMARY

Sample Rating Trend

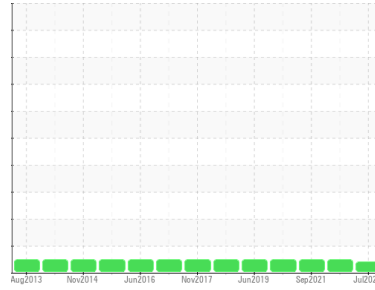

VIS DEBRIS



Area
HINO [600380362]
 Machine Id
29WEA81872
 Component
Hydraulic System
 Fluid
SHELL TELLUS ARTIC 32 (--- LTR)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	NORMAL	NORMAL
Debris	scalar	*Visual	NONE	▲ MODER	NONE	NONE

Customer Id: NORHIG
 Sample No.: NX05928144
 Lab Number: 05928144
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

12 May 2022 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

[view report](#)



07 Sep 2021 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the component. The amount and size of particulates present in the system is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

[view report](#)



15 Jul 2020 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the component. The amount and size of particulates present in the system is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

[view report](#)






OIL ANALYSIS REPORT

Sample Rating Trend

VIS DEBRIS

Area
HINO [600380362]
Machine Id
29WEA81872

Component
Hydraulic System
Fluid
SHELL TELLUS ARTIC 32 (--- LTR)

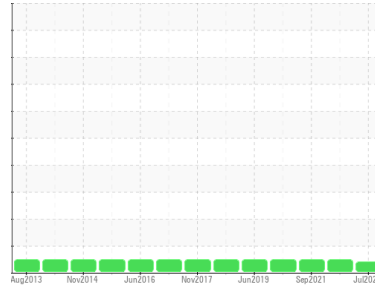

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		NX05928144	NX05602815	NX05387348
Sample Date	Client Info		11 Jul 2023	12 May 2022	07 Sep 2021
Machine Age	mths	Client Info	0	0	0
Oil Age	mths	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			ABNORMAL	NORMAL	NORMAL

WEAR METALS

	method	limit/base	current	history1	history2
PQ	ASTM D8184		16	15	19
Iron	ppm	ASTM D5185m >20	9	8	7
Chromium	ppm	ASTM D5185m >20	0	<1	<1
Nickel	ppm	ASTM D5185m >20	0	<1	0
Titanium	ppm	ASTM D5185m	0	0	0
Silver	ppm	ASTM D5185m	<1	<1	0
Aluminum	ppm	ASTM D5185m >20	0	0	<1
Lead	ppm	ASTM D5185m >20	1	<1	<1
Copper	ppm	ASTM D5185m >20	<1	0	0
Tin	ppm	ASTM D5185m >20	2	1	1
Antimony	ppm	ASTM D5185m	---	---	0
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 5	0	0	<1
Barium	ppm	ASTM D5185m 0	0	0	0
Molybdenum	ppm	ASTM D5185m 0	0	0	<1
Manganese	ppm	ASTM D5185m 0	0	0	<1
Magnesium	ppm	ASTM D5185m 0	<1	0	1
Calcium	ppm	ASTM D5185m 5	0	0	0
Phosphorus	ppm	ASTM D5185m 600	590	530	526
Zinc	ppm	ASTM D5185m 50	189	155	126
Sulfur	ppm	ASTM D5185m 900	841	799	658

CONTAMINANTS





	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >15	2	2	2
Sodium	ppm	ASTM D5185m	0	0	<1
Potassium	ppm	ASTM D5185m >20	<1	0	<1
Water	%	ASTM D6304 >0.05	0.012	0.017	0.013
ppm Water	ppm	ASTM D6304 >500	122.6	179.3	132.9

FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>20000	---	2835	938
Particles >6µm	ASTM D7647	>2500	---	496	156
Particles >14µm	ASTM D7647	>320	---	36	9
Particles >21µm	ASTM D7647	>80	---	10	1
Particles >38µm	ASTM D7647	>20	---	0	0
Particles >71µm	ASTM D7647	>4	---	0	0
Oil Cleanliness	ISO 4406 (c)	>21/18/15	---	19/16/12	17/14/10



OIL ANALYSIS REPORT

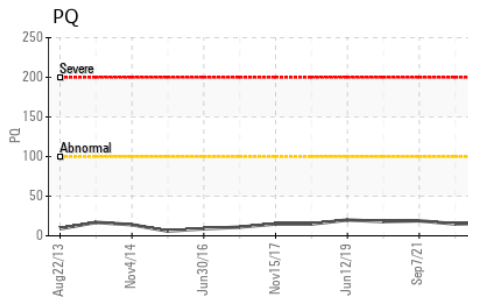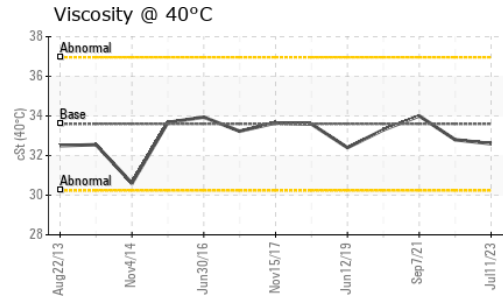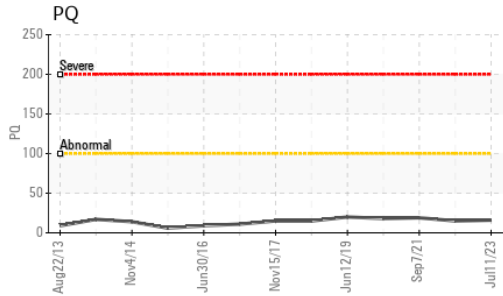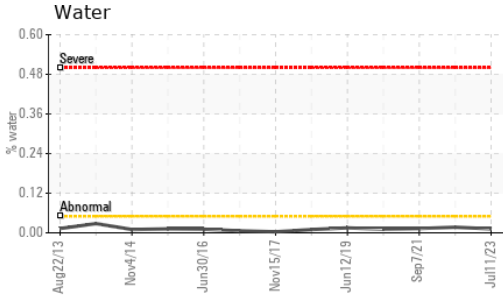


FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.20	0.20	0.23	0.226





VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	▲ MODER	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	33.6	32.6	32.8	34.0

SAMPLE IMAGES

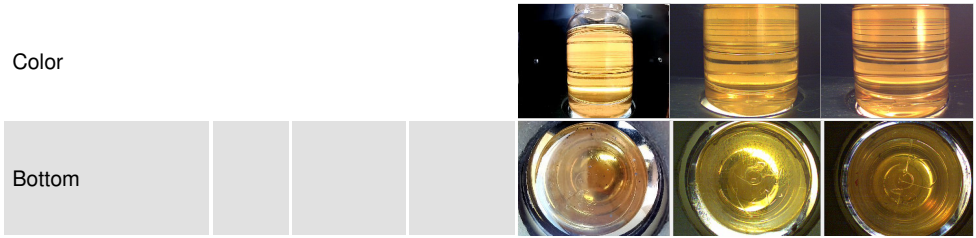

GRAPHS

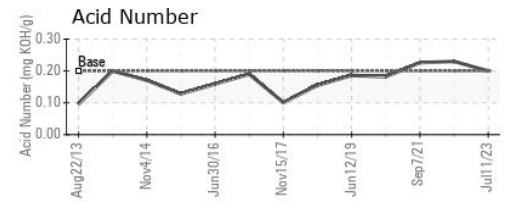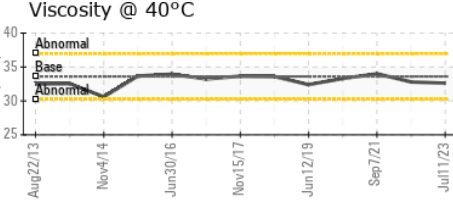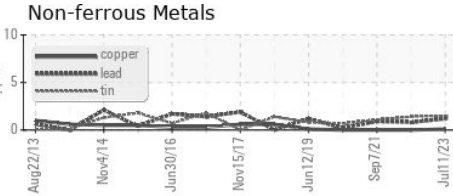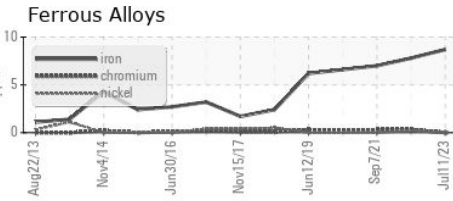

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : NX05928144 **Received** : 18 Aug 2023
Lab Number : **05928144** **Diagnosed** : 21 Aug 2023
Unique Number : 10608091 **Diagnostician** : Don Baldrige
Test Package : IND 2 (Additional Tests: KF, PQ)

NORDEX USA - HIGHLAND & HIGHLAND NORTH
 300 SOUTH WACKER DRIVE, SUITE 1500
 CHICAGO, IL
 US 60606
 Contact: Robert Warner
 rwarner@everpower.com

Certificate L2367
 To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: x:
 F: x: