




PROBLEM SUMMARY

Sample Rating Trend

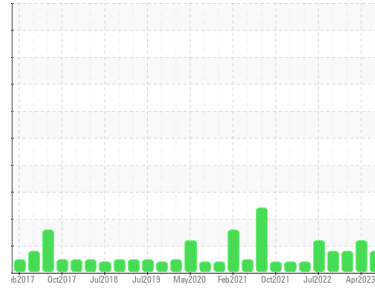

ISO




Area
PLATE FREEZER
 Machine Id
PLATE FRZR 2-2

Component
Hydraulic System
 Fluid
LUBRIPLATE L0867-062 (--- GAL)

COMPONENT CONDITION SUMMARY

▲ Particle Trend

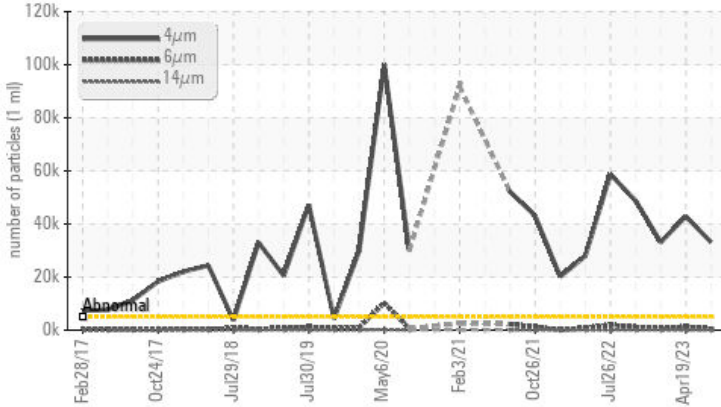

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status		ABNORMAL	ABNORMAL	ABNORMAL
Particles >4µm	ASTM D7647 >5000	▲ 33158	▲ 42821	▲ 33154
Oil Cleanliness	ISO 4406 (c) >19/17/14	▲ 22/16/10	▲ 23/18/12	▲ 22/16/10

Customer Id: CONRUS
 Sample No.: USP0000570
 Lab Number: 05928344
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Doug Bogart +1 (800)237-1369 x4016
dougb@wearcheckusa.com

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

19 Apr 2023 Diag: Doug Bogart

ISO



Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



25 Jan 2023 Diag: Jonathan Hester

ISO



Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



06 Nov 2022 Diag: Angela Borella

ISO



We recommend you service the filters on this component. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

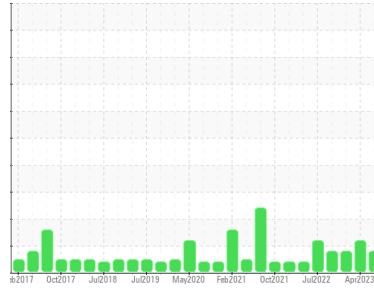

ISO



Area
PLATE FREEZER
Machine Id
PLATE FRZR 2-2

Component
Hydraulic System
Fluid
LUBRIPLATE L0867-062 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 6 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		USP0000570	USP248828	USP05751443
Sample Date	Client Info		19 Aug 2023	19 Apr 2023	25 Jan 2023
Machine Age	hrs	Client Info	0	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			ABNORMAL	ABNORMAL	ABNORMAL

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >20	7	6	6
Chromium	ppm	ASTM D5185m >20	<1	<1	<1
Nickel	ppm	ASTM D5185m >20	0	0	0
Titanium	ppm	ASTM D5185m	<1	<1	<1
Silver	ppm	ASTM D5185m	0	0	0
Aluminum	ppm	ASTM D5185m >20	<1	2	2
Lead	ppm	ASTM D5185m >20	0	0	0
Copper	ppm	ASTM D5185m >20	<1	2	2
Tin	ppm	ASTM D5185m >20	0	0	0
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	56	56	58
Barium	ppm	ASTM D5185m	2	2	<1
Molybdenum	ppm	ASTM D5185m	0	<1	<1
Manganese	ppm	ASTM D5185m	0	<1	0
Magnesium	ppm	ASTM D5185m	3	3	2
Calcium	ppm	ASTM D5185m	76	73	76
Phosphorus	ppm	ASTM D5185m	195	189	199
Zinc	ppm	ASTM D5185m	26	22	22
Sulfur	ppm	ASTM D5185m	1019	1037	1085

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >15	2	1	1
Sodium	ppm	ASTM D5185m	2	2	2
Potassium	ppm	ASTM D5185m >20	6	6	7
Water	%	ASTM D6304 >0.05	0.031	0.020	0.020
ppm Water	ppm	ASTM D6304 >500	311.4	208.6	208.1






FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	▲ 33158	▲ 42821	▲ 33154
Particles >6µm	ASTM D7647	>1300	431	▲ 1346	595
Particles >14µm	ASTM D7647	>160	9	35	8
Particles >21µm	ASTM D7647	>40	3	7	1
Particles >38µm	ASTM D7647	>10	0	0	0
Particles >71µm	ASTM D7647	>3	0	0	0
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 22/16/10	▲ 23/18/12	▲ 22/16/10

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.80	0.79	0.77


OIL ANALYSIS REPORT

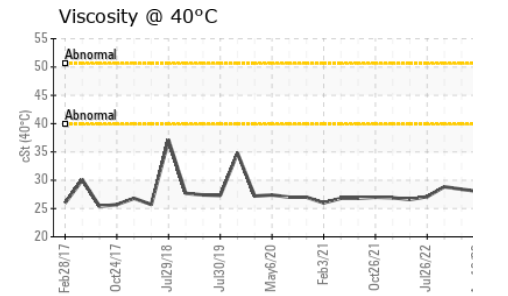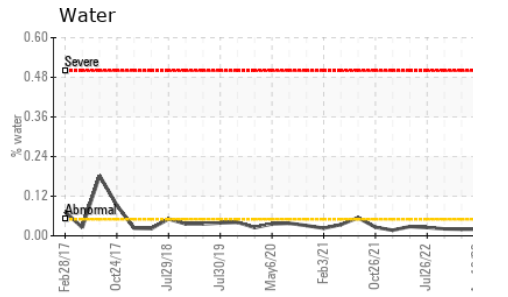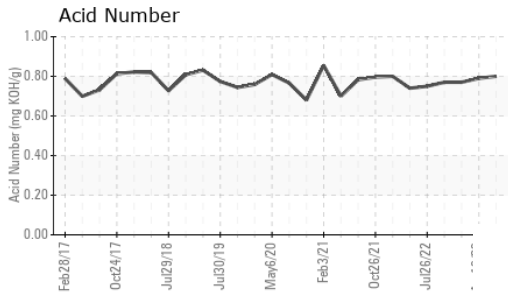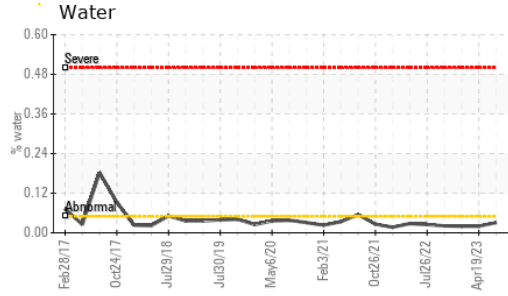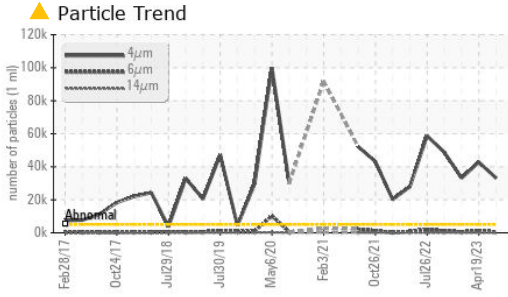






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	28.4	28.0	28.4

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

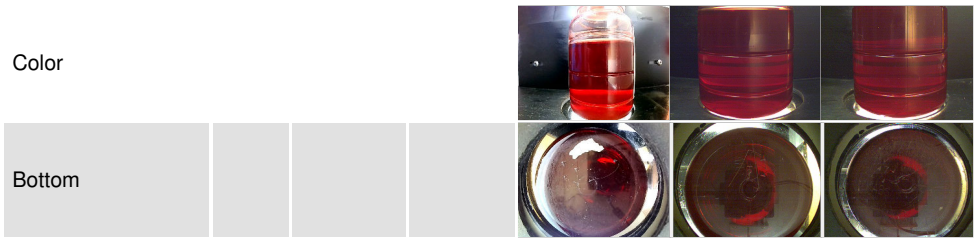

GRAPHS

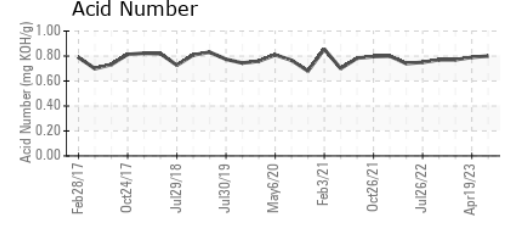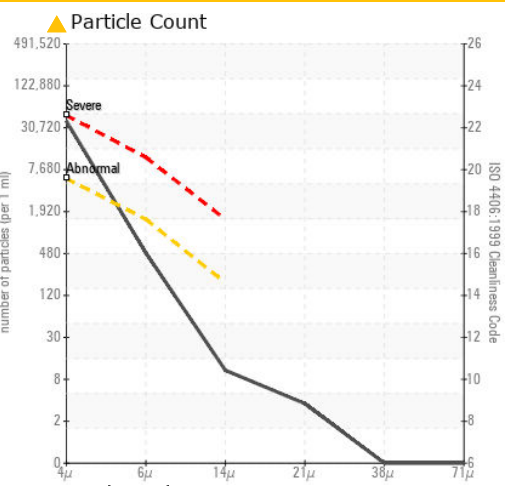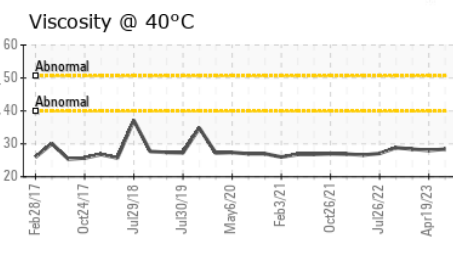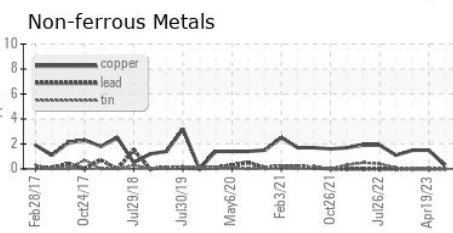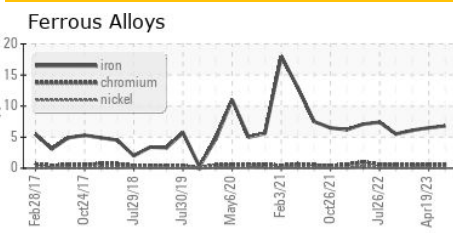

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : USP0000570 **Received** : 18 Aug 2023
Lab Number : 05928344 **Diagnosed** : 22 Aug 2023
Unique Number : 10608291 **Diagnostician** : Doug Bogart
Test Package : IND 2

CONAGRA FROZEN FOODS CO
 RUSSELLVILLE, AR
 US
 Contact: SERVICE MANAGER

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: