

# **PROBLEM SUMMARY**

# Not GIVEN KC05929599 (S/N NO INFO ON SIF/BOTTLE)

Compressor



# KAESER SIGMA (OEM) S-460 (--- GAL)

# COMPONENT CONDITION SUMMARY



#### RECOMMENDATION

We recommend you service the filters on this component. There is too much water present in this sample to perform a particle count. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS								
Sample Status				ABNORMAL				
Water	%	ASTM D6304	>0.1	<u> </u>				
ppm Water	ppm	ASTM D6304	>1000	<b>1500</b>				
Appearance	scalar	*Visual	NORML	🔺 HAZY				

Customer Id: CINYON Sample No.: KC05929599 Lab Number: 05929599 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Filter			?	We recommend you service the filters on this component.			

HISTORICAL DIAGNOSIS



# **OIL ANALYSIS REPORT**

scalar \*Visual

#### Machine Ic NOT GIVEN KC05929599 (S/N NO INFO Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

# DIAGNOSIS

#### Recommendation

We recommend you service the filters on this component. There is too much water present in this sample to perform a particle count. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

#### Wear

All component wear rates are normal.

## Contamination

Appearance is hazy. There is a light concentration of water present in the oil.

### Fluid Condition

The AN level is acceptable for this fluid.

FO ON SIF/BO	TTLE)					
				Aug2023		
SAMPLE INFORM	<b>MATION</b>	method	limit/base	current	history1	history2
Sample Number		Client Info		KC05929599		
Sample Date		Client Info		11 Aug 2023		
Machine Age	hrs	Client Info		13914		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	34 0		
Chromium Nickel	ppm	ASTM D5185m ASTM D5185m	>10	0		
Titanium	ppm ppm	ASTM D5185m		0 <1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	3		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m		9		
Tin	ppm	ASTM D5185m		0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
	1- 1-	and the set	Use 16 /b and a	-	In the tax work	history O
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	90	3		
Calcium	ppm	ASTM D5185m	2	0		
Phosphorus	ppm	ASTM D5185m		<1		
Zinc	ppm	ASTM D5185m		105		
CONTAMINANTS	\$	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		3		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.1	<b>A</b> 0.150		
ppm Water	ppm	ASTM D6304	>1000	<u> </u>		
FLUID DEGRADA		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.37		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	MODER		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	🔺 HAZY		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	0.2%		
					0 1 14	

Sample Rating Trend


WATER

on: Service Manager-= CINYON

NEG



**OIL ANALYSIS REPORT** 

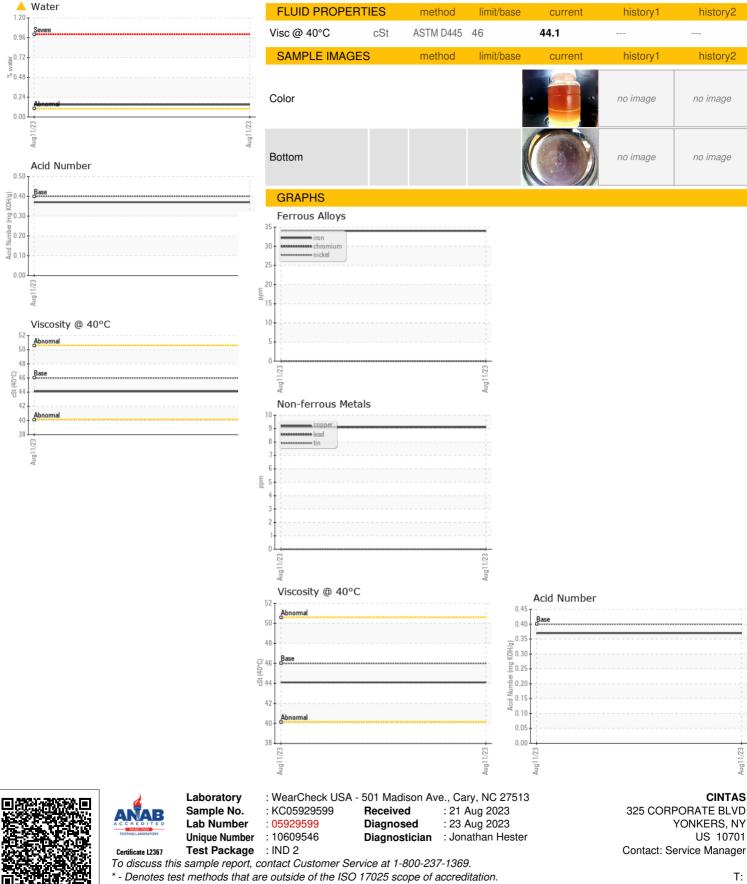

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: Service Manager - CINYON

1/23

Aug1

T:

F: