

# **PROBLEM SUMMARY**

Sample Rating Trend

WATER


8324945 (S/N 1595)

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- QTS)

## **COMPONENT CONDITION SUMMARY**

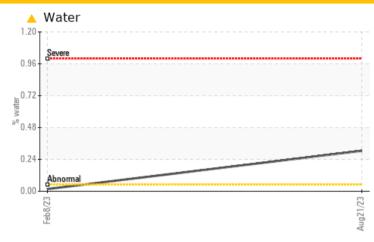

### RECOMMENDATION

The filter change at the time of sampling has been noted. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS										
Sample Status				ABNORMAL	ATTENTION					
Water	%	ASTM D6304	>0.05	<b>△</b> 0.305	0.017					
ppm Water	ppm	ASTM D6304	>500	A 3050	174.8					

Customer Id: TECMUN Sample No.: KC05930901 Lab Number: 05930901 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

## **RECOMMENDED ACTIONS**

There are no recommended actions for this sample.

## HISTORICAL DIAGNOSIS

08 Feb 2023 Diag: Don Baldridge

ISO



Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





# **OIL ANALYSIS REPORT**

Sample Rating Trend **WATER** 

8324945 (S/N 1595)

Compressor

KAESER SIGMA (OEM) S-460 (--- QTS)

## **DIAGNOSIS**

#### Recommendation

The filter change at the time of sampling has been noted. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

#### Wear

All component wear rates are normal.

#### Contamination

There is a high amount of particulates present in the oil. There is a light concentration of water present in the oil.

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

			Feb 2023	Aug2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC05930901	KC97244	
Sample Date		Client Info		21 Aug 2023	08 Feb 2023	
Machine Age	hrs	Client Info		0	1126	
Oil Age	hrs	Client Info		0	1126	
Oil Changed		Client Info		N/A	Changed	
Sample Status				ABNORMAL	ATTENTION	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	3	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m	>3	0	0	
Titanium	ppm	ASTM D5185m	>3	<1	0	
Silver	ppm	ASTM D5185m	>2	0	0	
Aluminum	ppm	ASTM D5185m	>10	<1	0	
Lead	ppm	ASTM D5185m	>10	0	0	
Copper	ppm	ASTM D5185m	>50	1	2	
Tin	ppm	ASTM D5185m	>10	<1	0	
Vanadium	ppm	ASTM D5185m		<1	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	
Barium	ppm	ASTM D5185m	90	4	10	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		<1	0	
Magnesium	ppm	ASTM D5185m	90	42	54	
Calcium	ppm	ASTM D5185m	2	1	2	
Phosphorus	ppm	ASTM D5185m		4	14	
Zinc	ppm	ASTM D5185m		1	11	
CONTAMINANTS	6	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	2	
Sodium	ppm	ASTM D5185m		4	8	
Potassium	ppm	ASTM D5185m	>20	1	8	
Water	%	ASTM D6304	>0.05	<b>0.305</b>	0.017	
ppm Water	ppm	ASTM D6304	>500	▲ 3050	174.8	
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		548	6559	
Particles >6μm		ASTM D7647	>1300	299	<u>▲</u> 1575	
Particles >14μm		ASTM D7647	>80	51	40	
Particles >21µm		ASTM D7647	>20	17	5	
Particles >38µm		ASTM D7647	>4	3	0	
Particles >71µm		ASTM D7647	>3	0	0	
Oil Cleanliness		ISO 4406 (c)	>/17/13	16/15/13	<u>\$\text{\Delta}\$ 20/18/12</u>	
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2

Acid Number (AN)


mg KOH/g ASTM D8045 0.4

0.35

0.35



## **OIL ANALYSIS REPORT**

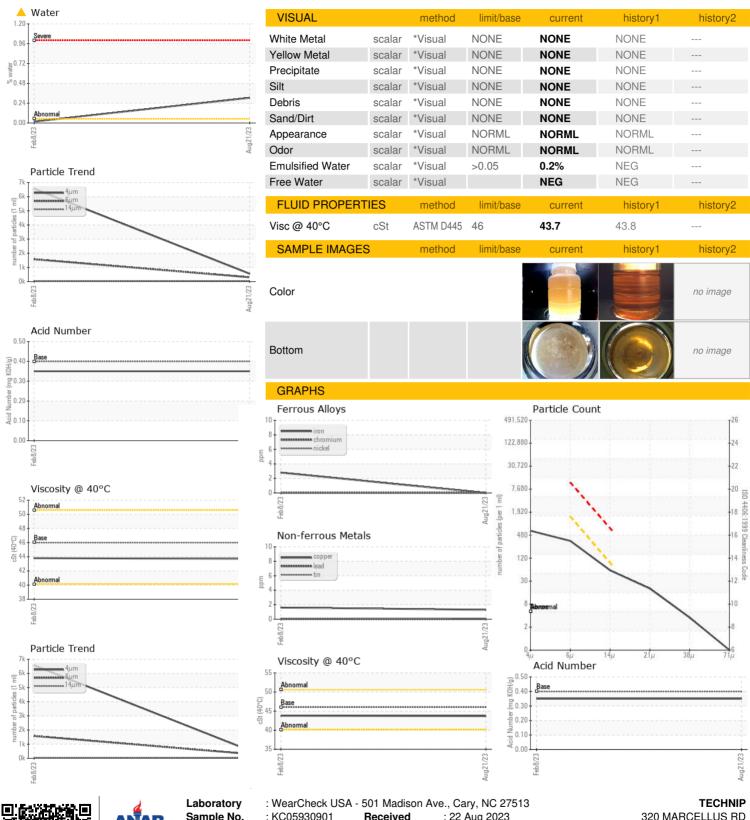





Certificate L2367

Sample No. Lab Number **Unique Number** Test Package

: KC05930901 : 05930901

: 10616172 : IND 2

Received : 22 Aug 2023 Diagnosed : 25 Aug 2023

: Jonathan Hester Diagnostician

320 MARCELLUS RD MUNCY, PA US 17756

Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F: