
Sullivan Palatek

OIL ANALYSIS REPORT

MAXAIR 46
Machine Id
PALATEK 19EE000083 - SUPERIOR INDUSTRIES

Component

Compressor

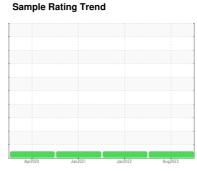



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

| | | Apr202 | 0 Jan2021 | Jan2022 A | lug2023 | |
|-------------------------|----------|-------------|------------|-------------|-----------------|-------------|
| SAMPLE INFORM | MATION | method | limit/base | current | history1 | history2 |
| Sample Number | | Client Info | | UCS05930921 | UCS05452602 | UCS05168459 |
| Sample Date | | Client Info | | 09 Aug 2023 | 17 Jan 2022 | 12 Jan 2021 |
| Machine Age | hrs | Client Info | | 6455 | 2865 | 2737 |
| Oil Age | hrs | Client Info | | 1000 | 2865 | 3000 |
| Oil Changed | | Client Info | | Changed | Changed | Changed |
| Sample Status | | | | NORMAL | NORMAL | NORMAL |
| WEAR METALS | | method | limit/base | current | history1 | history2 |
| Iron | ppm | ASTM D5185m | >50 | 0 | 0 | <1 |
| Chromium | ppm | ASTM D5185m | >10 | 0 | 0 | 0 |
| Nickel | ppm | ASTM D5185m | | 0 | 0 | <1 |
| Titanium | ppm | ASTM D5185m | | <1 | 0 | 0 |
| Silver | ppm | ASTM D5185m | | 0 | <1 | 0 |
| Aluminum | ppm | ASTM D5185m | >25 | 0 | 0 | 0 |
| Lead | ppm | ASTM D5185m | >25 | 0 | 0 | 0 |
| Copper | ppm | ASTM D5185m | >50 | <1 | <1 | <1 |
| Tin | ppm | ASTM D5185m | >15 | 0 | 0 | 0 |
| Antimony | ppm | ASTM D5185m | | | 0 | 5 |
| Vanadium | ppm | ASTM D5185m | | <1 | 0 | 0 |
| Cadmium | ppm | ASTM D5185m | | 0 | 0 | 0 |
| ADDITIVES | 1-1- | method | limit/base | ourrent | history1 | history2 |
| | | | IIIIIVbase | current | | • |
| Boron | ppm | ASTM D5185m | | 0 | <1 | 0 |
| Barium | ppm | ASTM D5185m | | 0 | 0 | 3 |
| Molybdenum | ppm | ASTM D5185m | | 0 | 0 | 0 |
| Manganese | ppm | ASTM D5185m | | <1 | 0 | <1 |
| Magnesium | ppm | ASTM D5185m | | 2 | 0 | 0 |
| Calcium | ppm | ASTM D5185m | | 0 | 0 | <1 |
| Phosphorus | ppm | ASTM D5185m | | 541 | 648 | 629 |
| Zinc | ppm | ASTM D5185m | | 0 | 2 | 4 |
| Sulfur | ppm | ASTM D5185m | | 1010 | 317 | 236 |
| CONTAMINANTS | 8 | method | limit/base | current | history1 | history2 |
| Silicon | ppm | ASTM D5185m | >25 | 2 | <1 | 8 |
| Sodium | ppm | ASTM D5185m | | <1 | <1 | 2 |
| Potassium | ppm | ASTM D5185m | >20 | 0 | 0 | 0 |
| FLUID DEGRADA | NOITA | method | limit/base | current | history1 | history2 |
| Acid Number (AN) | mg KOH/g | ASTM D8045 | | 0.19 | 0.139 | 0.341 |
| VISUAL | | method | limit/base | current | history1 | history2 |
| White Metal | scalar | *Visual | NONE | NONE | NONE | NONE |
| Yellow Metal | scalar | *Visual | NONE | NONE | NONE | NONE |
| Precipitate | scalar | *Visual | NONE | NONE | NONE | NONE |
| Silt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Debris | scalar | *Visual | NONE | NONE | VLITE | NONE |
| Sand/Dirt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Appearance | scalar | *Visual | NORML | NORML | NORML | NORML |
| Odor | scalar | *Visual | NORML | NORML | NORML | NORML |
| Emulsified Water | scalar | *Visual | >0.1 | NEG | NEG | NEG |
| Free Water | scalar | *Visual | | NEG | ocation GDALE k | - UNDERMWES |
| | | | | | | |

Sullivan

OIL ANALYSIS REPORT

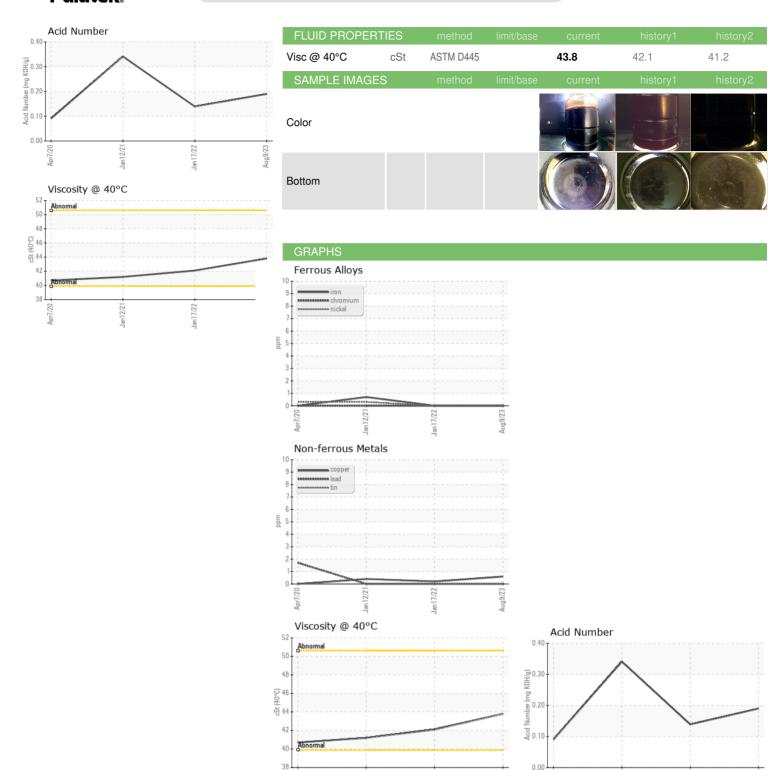





Certificate L2367

Laboratory Sample No. Lab Number

Unique Number : 10616192

: UCS05930921 : 05930921 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 22 Aug 2023 Diagnosed : 23 Aug 2023

Diagnostician : Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Jan 12/21

JEMCO-MAXAIR

WEST FARGO, ND US 58078 Contact: DALE K

dalek@jemco-maxair.com T: (701)281-0362

F: x:

Contact/Location: DALE K - UCJEMWES