


OIL ANALYSIS REPORT

NOT GIVEN [1656530] L3-IREC-SILO-DSCH-1 - PFNONWOVENS

Component Gearbox



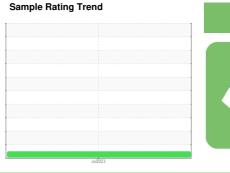

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Jul2023		
OAMBLE INCOR	4471011		11 1.0			
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH05932909		
Sample Date		Client Info		31 Jul 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	2		
Chromium	ppm	ASTM D5185m	>15	0		
Nickel	ppm	ASTM D5185m	>15	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>100	0		
Copper	ppm	ASTM D5185m	>200	0		
Tin	ppm	ASTM D5185m	>25	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		20		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		2		
Calcium	ppm	ASTM D5185m		93		
Phosphorus	ppm	ASTM D5185m		380		
Zinc	ppm	ASTM D5185m		7		
Sulfur	ppm	ASTM D5185m		20311		
CONTAMINANTS		method	limit/base		history1	history2
)			current	HISTORY	HISTOLYZ
Silicon	ppm	710 1111 20 100111	>50	2		
Sodium	ppm	ASTM D5185m		1		
Potassium	ppm	ASTM D5185m	>20	<1		
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.69		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		



OIL ANALYSIS REPORT

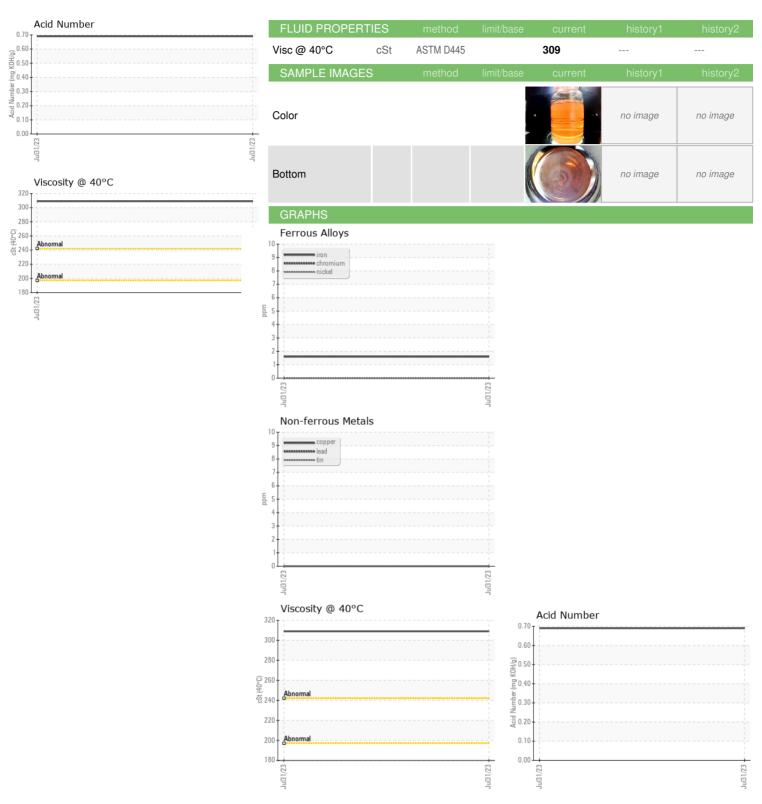





Certificate L2367

Laboratory Sample No. Lab Number

Unique Number : 10618180 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH05932909 Received : 23 Aug 2023 : 05932909 : 25 Aug 2023 Diagnosed

Diagnostician : Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

CORROSION PRODUCTS & EQUIPMENT

940 POINTVIEW AVE EPHRATA, PA

US 17522 Contact: RYAN HUNGARTER

rhungarter@corrosion-products.com T: (717)961-1998

F: