


OIL ANALYSIS REPORT

CHEMLUBE 629 [1656558] L2-WIN-AXL-HLP - PFNONWOVENS

Component

Gearbox

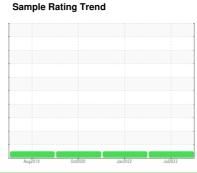



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Aug201	9 Oct2020	Jan 2022	Jui2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH05932911	UCH05453712	UCH05088278
Sample Date		Client Info		25 Jul 2023	14 Jan 2022	08 Oct 2020
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	12	9	10
Chromium	ppm	ASTM D5185m	>15	0	0	<1
Nickel	ppm	ASTM D5185m	>15	0	0	0
Titanium	ppm	ASTM D5185m		3	3	4
Silver	ppm	ASTM D5185m		0	0	1
Aluminum	ppm	ASTM D5185m	>25	0	<1	0
Lead	ppm	ASTM D5185m	>100	0	0	<1
Copper	ppm	ASTM D5185m	>200	0	0	<1
Tin	ppm	ASTM D5185m	>25	0	0	0
Antimony	ppm	ASTM D5185m	>5		0	0
Vanadium	ppm	ASTM D5185m	70	0	0	0
				0	0	<1
Cadmium	ppm	ASTM D5185m				
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	3.1	23	25	28
Barium	ppm	ASTM D5185m	0.1	0	<1	0
Molybdenum	ppm	ASTM D5185m	0	0	<1	<1
Manganese	ppm	ASTM D5185m	0.7	<1	<1	<1
Magnesium	ppm	ASTM D5185m	0	2	0	2
Calcium	ppm	ASTM D5185m	0	12	9	13
Phosphorus	ppm	ASTM D5185m	1642	359	314	320
Zinc	ppm	ASTM D5185m	0	2	5	0
Sulfur	ppm	ASTM D5185m	377	19534	14205	14317
CONTAMINANTS	5	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	<1	<1	<1
Sodium	ppm	ASTM D5185m		<1	0	0
Potassium	ppm	ASTM D5185m	>20	<1	0	<1
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.154	0.72	0.76	0.763
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	LIGHT
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	N HWIGARTER	
	Julian	1.00001			0	



OIL ANALYSIS REPORT

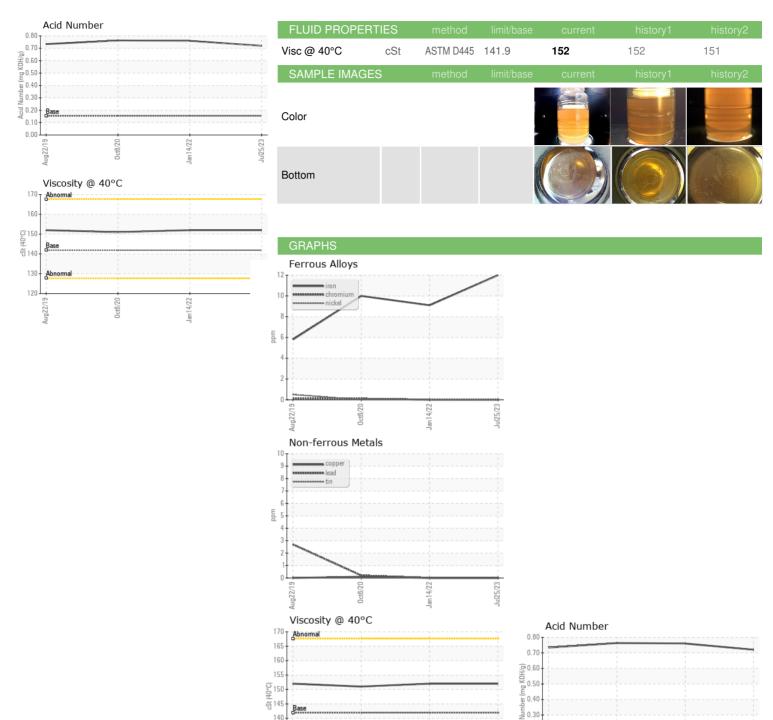





Laboratory Sample No. Lab Number

: 05932911 Unique Number : 10618182

135

130 125

> : WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH05932911 Received

Diagnosed

: 23 Aug 2023 : 25 Aug 2023 Diagnostician : Don Baldridge

Jan 14/22 -

용 0.20

0.10

0.00

Test Package : IND 2 (Additional Tests: PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

CORROSION PRODUCTS & EQUIPMENT

940 POINTVIEW AVE EPHRATA, PA

US 17522 Contact: RYAN HUNGARTER

rhungarter@corrosion-products.com T: (717)961-1998

F: