

FUEL REPORT

HITACHI 300LC 1FFDDR70TKF840603 Component

Diesel Fuel NOT GIVEN (--- GAL)

Recommendation

This is a baseline read-out on the submitted sample. No corrective action is recommended at this time.

Corrosion

All metal levels are normal indicating no corrosion in the system.

Contaminants

The water content is negligible. There is no indication of any contamination in the fuel.

Fuel Condition

The condition of the fuel is acceptable for the time in service.


Sample Rating Trend NORMAL





SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		JR0167115		
Sample Date		Client Info		22 Aug 2023		
Machine Age	hrs	Client Info		3541		
Sample Status				NORMAL		
PHYSICAL PROP	ERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		2.42		
SULFUR CONTE	NT	method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m		38		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	0		
Sodium	ppm	ASTM D5185m	<0.1	0		
Potassium	ppm	ASTM D5185m	<0.1	0		
Water	%	ASTM D6304	<0.05	0.003		
ppm Water	ppm	ASTM D6304	<500	25.1		
HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	<1		
Nickel	ppm	ASTM D5185m	<0.1	0		
Lead	ppm	ASTM D5185m	<0.1	0		
Vanadium	ppm	ASTM D5185m	<0.1	0		
Iron	ppm	ASTM D5185m	<0.1	0		
Calcium	ppm	ASTM D5185m	<0.1	0		
Magnesium	ppm	ASTM D5185m	<0.1	0		
Phosphorus	ppm	ASTM D5185m	<0.1	0		
Zinc	ppm	ASTM D5185m	<0.1	0		
SAMPLE IMAGES	\$	method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image



FUEL REPORT

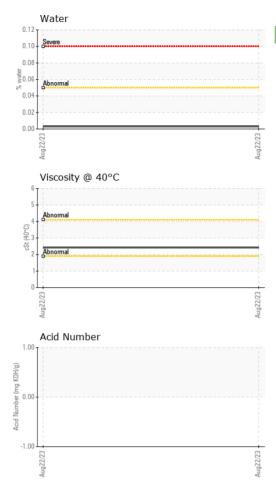

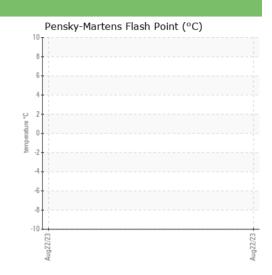

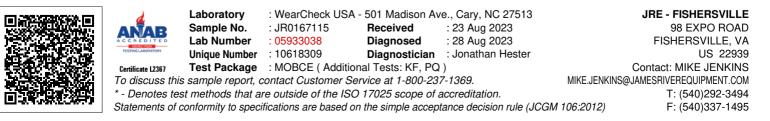

Contact/Location: MIKE JENKINS - JAMFIS