




PROBLEM SUMMARY

Sample Rating Trend

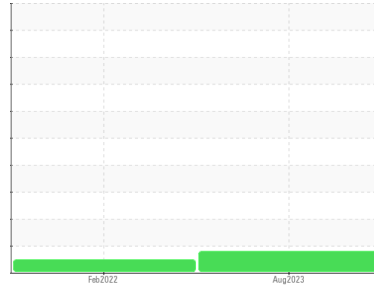


ISO



Area
IRON STAR [200006142]
 Machine Id
56WEA88316
 Component
Wind Turbine Gearbox
 Fluid
GEAR OIL (PAO) ISO 320 (--- LTR)

COMPONENT CONDITION SUMMARY

▲ Particle Trend

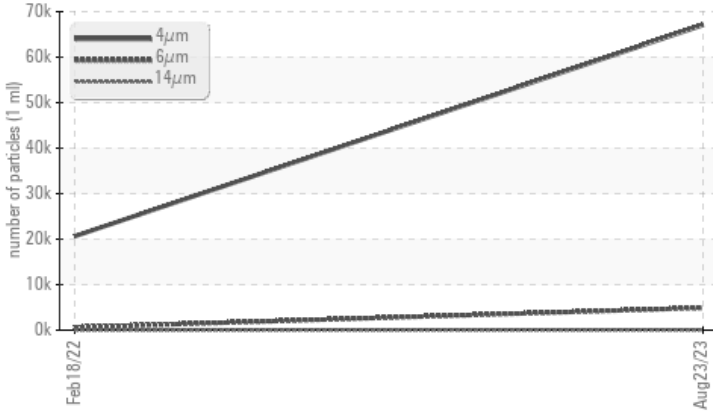

RECOMMENDATION

No corrective action is recommended at this time.
 Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	NORMAL	---
Particles >6µm	ASTM D7647	>1300	▲ 4887	625	---
Oil Cleanliness	ISO 4406 (c)	>17/14	▲ 19/12	22/16/11	---

Customer Id: NORDEX
 Sample No.: NX05933540
 Lab Number: 05933540
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

18 Feb 2022 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

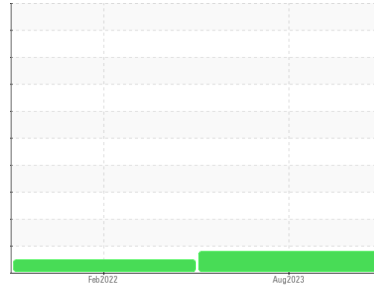

ISO



Area
IRON STAR [200006142]
 Machine Id
56WEA88316
 Component
Wind Turbine Gearbox
 Fluid
GEAR OIL (PAO) ISO 320 (--- LTR)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		NX05933540	NX05491180	---
Sample Date	Client Info		23 Aug 2023	18 Feb 2022	---
Machine Age	hrs	Client Info	0	0	---
Oil Age	hrs	Client Info	0	0	---
Oil Changed	Client Info		N/A	N/A	---
Sample Status			ABNORMAL	NORMAL	---

WEAR METALS

	method	limit/base	current	history1	history2
PQ	ASTM D8184	>50	12	16	---
Iron	ppm	ASTM D5185m	>30	15	7
Chromium	ppm	ASTM D5185m	>3	0	0
Nickel	ppm	ASTM D5185m	>3	0	0
Titanium	ppm	ASTM D5185m	>10	0	0
Silver	ppm	ASTM D5185m		0	0
Aluminum	ppm	ASTM D5185m	>30	0	<1
Lead	ppm	ASTM D5185m	>15	<1	<1
Copper	ppm	ASTM D5185m	>10	<1	<1
Tin	ppm	ASTM D5185m	>10	0	1
Vanadium	ppm	ASTM D5185m		0	0
Cadmium	ppm	ASTM D5185m		0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	25	10	10
Barium	ppm	ASTM D5185m	12	2	0
Molybdenum	ppm	ASTM D5185m	5	0	0
Manganese	ppm	ASTM D5185m		<1	<1
Magnesium	ppm	ASTM D5185m	25	<1	0
Calcium	ppm	ASTM D5185m	25	26	20
Phosphorus	ppm	ASTM D5185m	375	274	245
Zinc	ppm	ASTM D5185m	25	5	0
Sulfur	ppm	ASTM D5185m	4900	7700	4374

CONTAMINANTS






	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>+15	11	7
Sodium	ppm	ASTM D5185m		2	<1
Potassium	ppm	ASTM D5185m	>20	2	0
Water	%	ASTM D6304	>0.02	0.003	0.001
ppm Water	ppm	ASTM D6304	>200	38.4	5.6

FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647		67066	20637	---
Particles >6µm	ASTM D7647	>1300	4887	625	---
Particles >14µm	ASTM D7647	>160	39	20	---
Particles >21µm	ASTM D7647	>40	10	5	---
Particles >38µm	ASTM D7647	>10	1	0	---
Particles >71µm	ASTM D7647	>3	0	0	---
Oil Cleanliness	ISO 4406 (c)	>17/14	19/12	22/16/11	---

FLUID DEGRADATION


	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.10	0.35	0.36

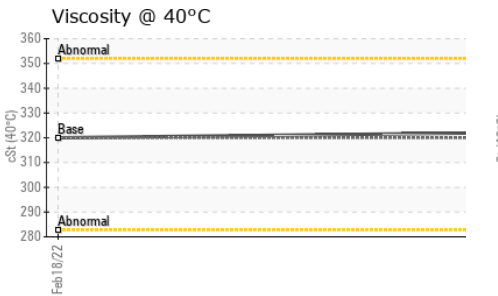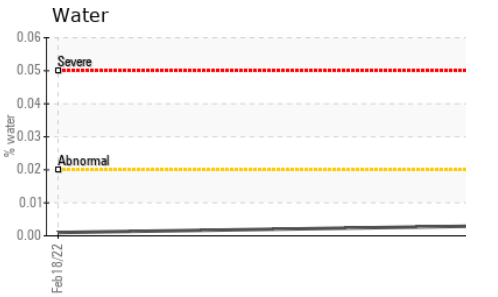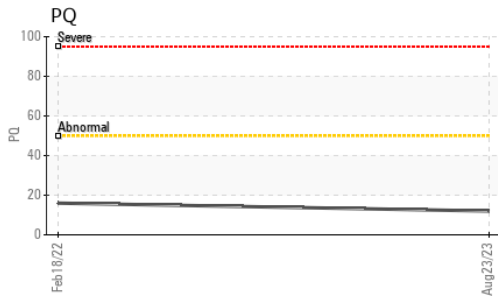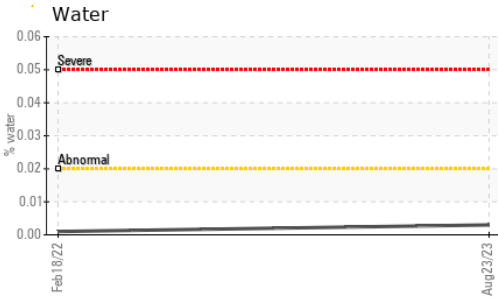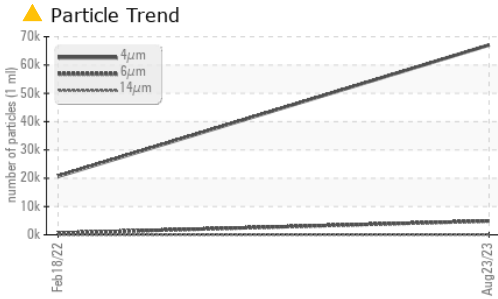






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.02	NEG	---
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 320	322	320	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

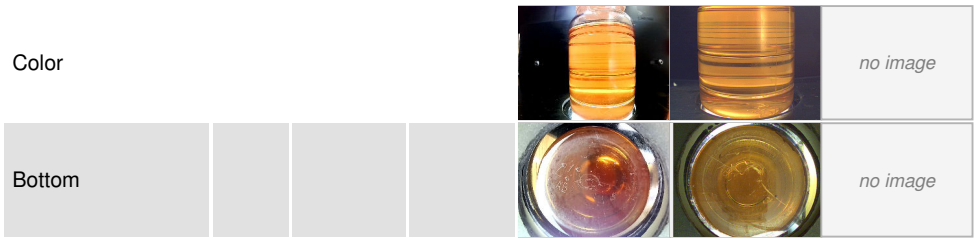

GRAPHS

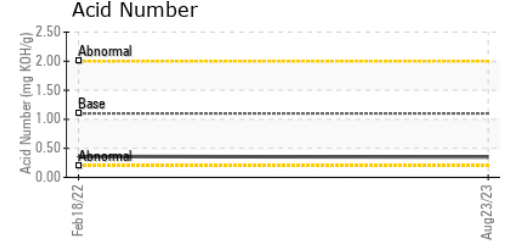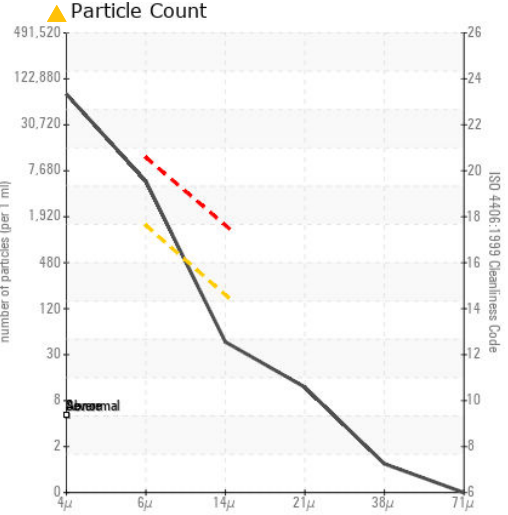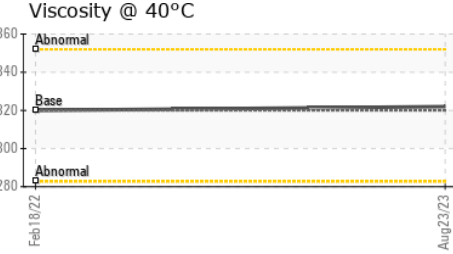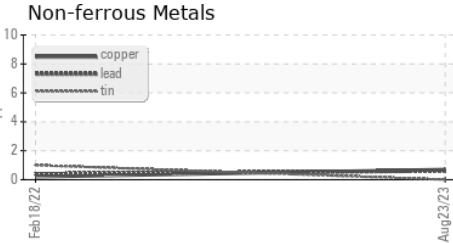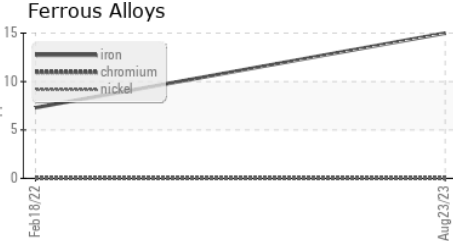

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : NX05933540 **Received** : 24 Aug 2023
Lab Number : 05933540 **Diagnosed** : 25 Aug 2023
Unique Number : 10618811 **Diagnostician** : Don Baldrige
Test Package : IND 2 (Additional Tests: KF, PQ, PrtCount)

NORDEX USA - Chicago
 300 SOUTH WACKER DRIVE, SUITE 1500
 CHICAGO, IL
 US 60606
 Contact: DEVIN LINEHAN
 DLinehan@nordex-online.com
 T: (312)386-4124
 F: (312)386-7102

Certificate L2367
 To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)