

### **FUEL REPORT**

#### Sample Rating Trend

#### NORMAL

# Not GIVEN JR0164993 - 8816 HRS (S/N NO INFO ON SIF/BOTTLE)

Tank Diesel Fuel

NOT GIVEN (--- GAL)

#### DIAGNOSIS

#### Recommendation

No corrective action is recommended at this time.

#### Corrosion

All metal levels are normal indicating no corrosion in the system.

#### Contaminants

The water content is negligible. There is no indication of any contamination in the fuel.

#### **Fuel Condition**

The condition of the fuel is acceptable for the time in service.


																			11
																			11
																			1
																			11
																			1
-																			




SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		JR0164993		
Sample Date		Client Info		24 Aug 2023		
Machine Age	hrs	Client Info		8816		
Sample Status				NORMAL		
PHYSICAL PROP	ERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		2.39		
SULFUR CONTE	NT	method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m		0		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	0		
Sodium	ppm	ASTM D5185m	<0.1	0		
Potassium	ppm	ASTM D5185m	<0.1	<1		
Water	%	ASTM D6304	<0.05	0.003		
ppm Water	ppm	ASTM D6304	<500	31.0		
HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	0		
Nickel	ppm	ASTM D5185m	<0.1	0		
Lead	ppm	ASTM D5185m	<0.1	0		
Vanadium	ppm	ASTM D5185m	<0.1	0		
Iron	ppm	ASTM D5185m	<0.1	0		
Calcium	ppm			0		
Magnesium	ppm	ASTM D5185m	<0.1	0		
Phosphorus	ppm	ASTM D5185m	<0.1	<1		
Zinc	ppm	ASTM D5185m	<0.1	0		
SAMPLE IMAGES	\$	method	limit/base	current	history1	history2
Color					no image	no image
Bottom				$(\bigcirc)$	no image	no image



## **FUEL REPORT**

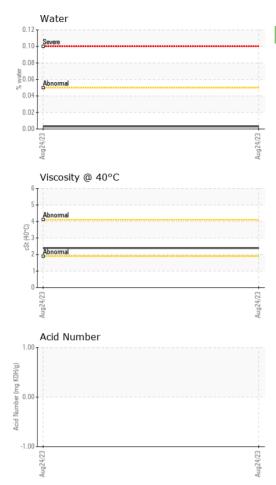

Pensky-Martens Flash Point (°C)

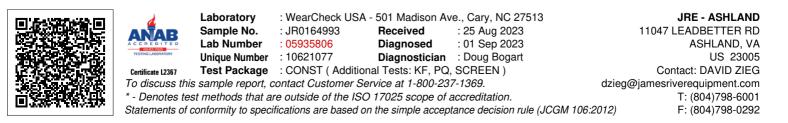

Contact/Location: DAVID ZIEG - JAMASH