

OIL ANALYSIS REPORT

T T






Closter Machine Id FREIGHTLINER 2464

Component

Diesel Engine

Fluid

GIBRALTAR 15W/40 SUPER S-3 LX (11)

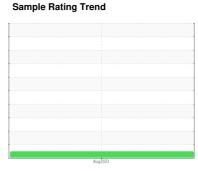



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

or en 3-3 ex (,			Aug2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0831041		
Sample Date		Client Info		10 Aug 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		150		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Glycol		WC Method		NEG		
WEAR METALS		method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>80	6		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m	>2	0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>30	<1		
Lead	ppm	ASTM D5185m	>30	0		
Copper	ppm	ASTM D5185m	>150	0		
Tin	ppm	ASTM D5185m	>5	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		12		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m	66	65		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	1000	896		
Calcium	ppm	ASTM D5185m	1050	1296		
Phosphorus	ppm	ASTM D5185m	1150	1072		
Zinc	ppm	ASTM D5185m	1270	1260		
Sulfur	ppm	ASTM D5185m		3995		
CONTAMINANT	S	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	4		
Sodium	ppm	ASTM D5185m		1		
Potassium	ppm	ASTM D5185m	>20	0		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.1		
Nitration	Abs/cm	*ASTM D7624	>20	5.7		
Sulfation	Abs/.1mm	*ASTM D7415	>30	17.3		
FLUID DEGRAD	ATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	13.0		



OIL ANALYSIS REPORT

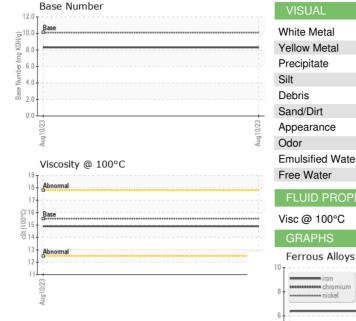


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	TES	method				history2


14.9




cSt

ASTM D445 15.5

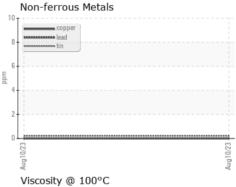

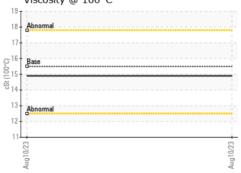

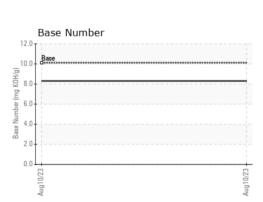



Certificate L2367

Laboratory Sample No. Lab Number Test Package : FLEET

: WC0831041 : 05935891 Unique Number : 10621162

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 28 Aug 2023 : 28 Aug 2023 Diagnostician : Wes Davis

INTERSTATE WASTE-CLOSTER 77 RAILROAD AVENUE CLOSTER, NJ US 07624

Contact: Tony Gagliano tgagliano@interstatewaste.com T:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: