


# OIL ANALYSIS REPORT

Sample Rating Trend



**NORMAL**

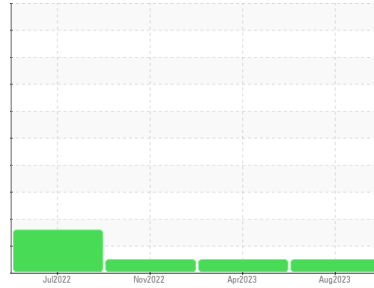

Area  
**COMPRESSOR STATIONS/RED HILLS WEST AREA**  
Machine Id  
**BANDIT (S/N F1901035440)**

Component  
**Compressor**  
Fluid  
**TULCO LUBSOIL LPG WS 150 (--- GAL)**

**DIAGNOSIS**

**Recommendation**  
Resample at the next service interval to monitor.

**Wear**  
All component wear rates are normal.

**Contamination**  
The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil.

**Fluid Condition**  
The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>TO60001213</b>	TO60000810	TO70000187
Sample Date	Client Info			<b>11 Aug 2023</b>	14 Apr 2023	16 Nov 2022
Machine Age	hrs Client Info			<b>22026</b>	19255	15783
Oil Age	hrs Client Info			<b>0</b>	0	12655
Oil Changed	Client Info			<b>Not Changed</b>	N/A	Oil Added
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<b>&lt;1</b>	0	<1
Chromium	ppm	ASTM D5185m	>10	<b>0</b>	<1	<1
Nickel	ppm	ASTM D5185m		<b>&lt;1</b>	<1	<1
Titanium	ppm	ASTM D5185m		<b>0</b>	0	0
Silver	ppm	ASTM D5185m		<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185m	>25	<b>&lt;1</b>	0	<1
Lead	ppm	ASTM D5185m	>25	<b>&lt;1</b>	0	1
Copper	ppm	ASTM D5185m	>50	<b>&lt;1</b>	0	<1
Tin	ppm	ASTM D5185m	>15	<b>&lt;1</b>	<1	2
Vanadium	ppm	ASTM D5185m		<b>0</b>	<1	<1
Cadmium	ppm	ASTM D5185m		<b>0</b>	0	<1






ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	<b>0</b>	0	1
Barium	ppm	ASTM D5185m	0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	0	<b>0</b>	0	<1
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
Magnesium	ppm	ASTM D5185m	0	<b>1</b>	<1	3
Calcium	ppm	ASTM D5185m	0	<b>0</b>	0	0
Phosphorus	ppm	ASTM D5185m	0	<b>4</b>	5	27
Zinc	ppm	ASTM D5185m	0	<b>0</b>	0	<1
Sulfur	ppm	ASTM D5185m	0	<b>117</b>	122	48

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<b>&lt;1</b>	1	<1
Sodium	ppm	ASTM D5185m		<b>&lt;1</b>	4	0
Potassium	ppm	ASTM D5185m	>20	<b>1</b>	<1	4
Water	%	ASTM D6304	>2.26	<b>0.630</b>	1.38	0.324
ppm Water	ppm	ASTM D6304	>22600	<b>6300.2</b>	13800	3248.5

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>10000	<b>4363</b>	4133	4303
Particles >6µm		ASTM D7647	>1300	<b>570</b>	953	1194
Particles >14µm		ASTM D7647	>320	<b>43</b>	46	59
Particles >21µm		ASTM D7647	>80	<b>9</b>	11	8
Particles >38µm		ASTM D7647	>20	<b>0</b>	0	1
Particles >71µm		ASTM D7647	>4	<b>0</b>	0	0
Oil Cleanliness		ISO 4406 (c)	>20/17/15	<b>19/16/13</b>	19/17/13	19/17/13

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		<b>0.33</b>	0.21	0.30


# OIL ANALYSIS REPORT

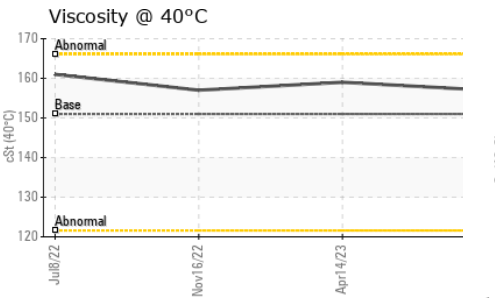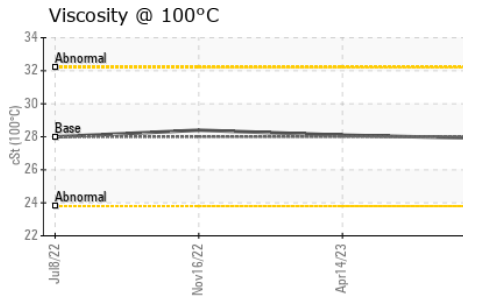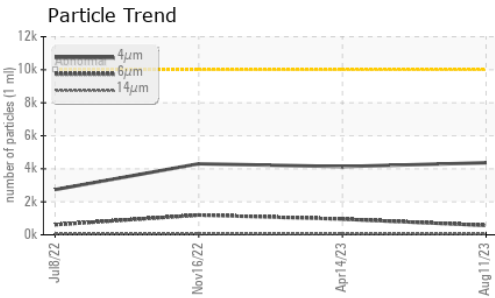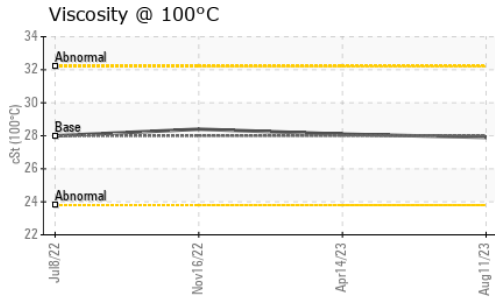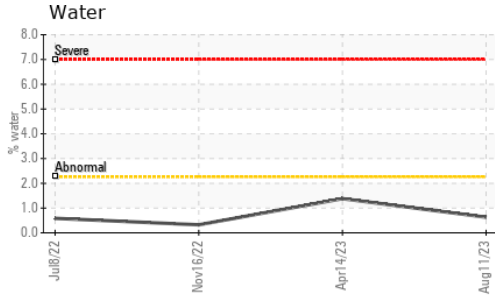






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>2.26	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	151	159	157
Visc @ 100°C	cSt	ASTM D445	28	28.1	28.4
Viscosity Index (VI)	Scale	ASTM D2270	224	216	221

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

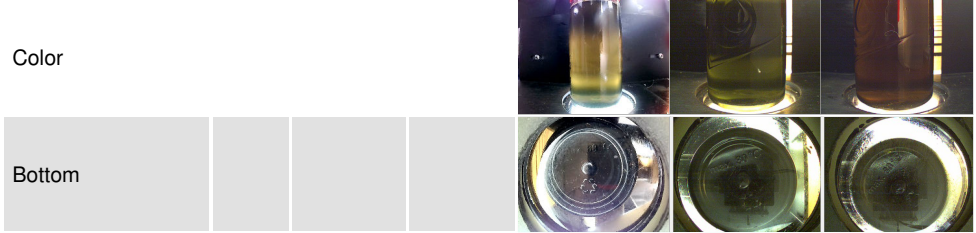

## GRAPHS

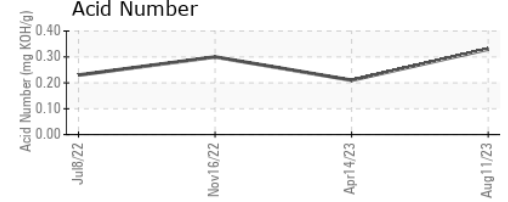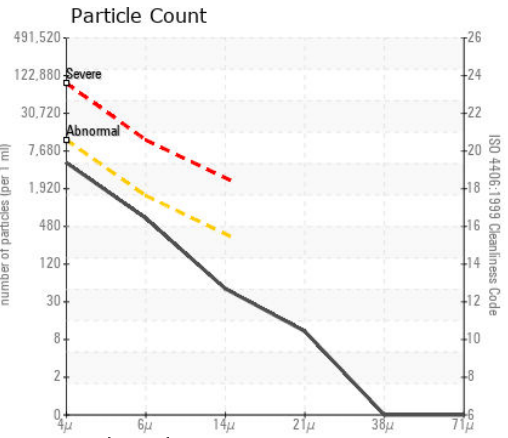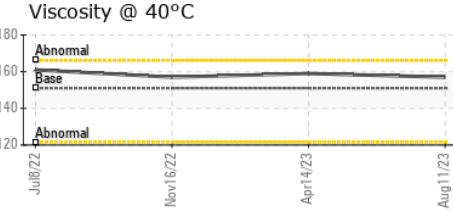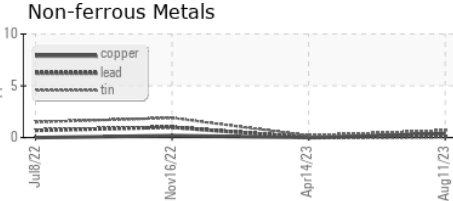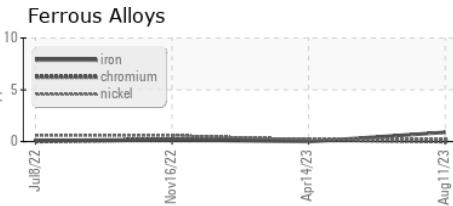

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : TO60001213 **Received** : 28 Aug 2023  
**Lab Number** : 05936646 **Diagnosed** : 29 Aug 2023  
**Unique Number** : 10621917 **Diagnostician** : Don Baldrige  
**Test Package** : IND 2 ( Additional Tests: KF, KV100, PrtCount, VI )

**MIDLAND - EOG RESOURCES INC.**  
 5509 CHAMPIONS DRIVE  
 MIDLAND, TX  
 US 79706  
 Contact: HERMAN GARZA  
 herman\_garza@eogresources.com  
 T: (432)686-3600  
 F:

Certificate L2367  
 To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)