


OIL ANALYSIS REPORT

COMPRESSOR ROOM **COMPRESSOR 2 (S/N S461797)**

Component

Compressor

GARDNER DENVER AEON 9000 SP (--- GAL)

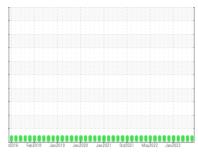

Sample Rating Trend



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		t2016 Feb20	18 Jan2019 Jan2020	Jan2021 Oct2021 May2022 J	an2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC05936786	WC05861997	WC05823372
Sample Date		Client Info		24 Aug 2023	24 May 2023	13 Apr 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	<1
Chromium		ASTM D5185m	>10	0	0	0
	ppm		>10	0	0	0
Nickel	ppm	ASTM D5185m				
Titanium	ppm	ASTM D5185m		0	<1	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	0	<1	<1
Lead	ppm	ASTM D5185m	>25	0	0	0
Copper	ppm	ASTM D5185m	>50	0	<1	<1
Tin	ppm	ASTM D5185m	>15	0	<1	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	<1	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0	0
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0	0
Manganese	ppm	ASTM D5185m		0	<1	<1
Magnesium	ppm	ASTM D5185m	0	<1	0	<1
Calcium	ppm	ASTM D5185m	0	<1	0	<1
Phosphorus	ppm	ASTM D5185m	800	875	705	737
Zinc	ppm	ASTM D5185m	0	0	0	1
Sulfur	ppm	ASTM D5185m	0	0	0	93
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	<1	0
Sodium	ppm	ASTM D5185m		0	4	5
Potassium	ppm	ASTM D5185m	>20	0	<1	<1
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	.170	0.49	1.14	1.18
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	LIGHT	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water		*Visual		NEG	NEG	NEG
	scalar		>0.1			
Free Water	scalar	*Visual		NEG	NEG	NEG




OIL ANALYSIS REPORT

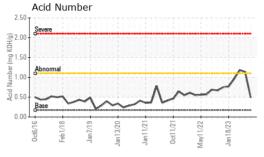


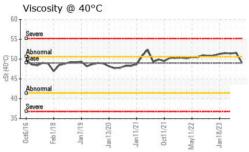




GRAPHS Ferrous Alloys

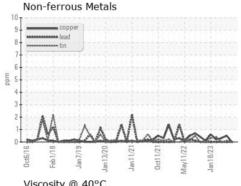

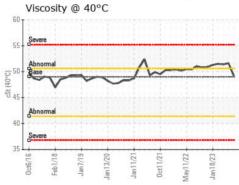

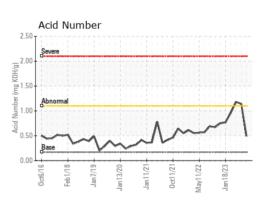





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: 10622057

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC05936786 : 05936786

Received Diagnosed

: 28 Aug 2023 : 29 Aug 2023

Diagnostician : Don Baldridge

Test Package : IND 2 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) J.M. Huber Corporation PO BOX 38

CRYSTAL HILL, VA US 24539

Contact: Ted Hudson ted.hudson@huber.com

T: (434)476-3550 F: (434)476-8133