

OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



ROTAIR PLUS

CHICAGO PNEUMATIC QRS15 CAI365004 - QUALITY AUTO BODY

Component

Compressor

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCZ05937339		
Sample Date		Client Info		21 Aug 2023		
Machine Age	hrs	Client Info		22255		
Oil Age	hrs	Client Info		1923		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	2		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m		<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	0		
Lead	ppm	ASTM D5185m	>65	2		
Copper	ppm	ASTM D5185m	>65	2		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		4		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		7		
Calcium	ppm	ASTM D5185m		3		
Phosphorus	ppm	ASTM D5185m		425		
Zinc	ppm	ASTM D5185m		158		
Sulfur	ppm	ASTM D5185m		980		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	<1		
Sodium	ppm	ASTM D5185m		10		
Potassium	ppm	ASTM D5185m	>20	<1		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.27		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		

NEG

NEG

Contact/Location: BILL MESTELLE - UCZOREAU

Emulsified Water

Free Water

scalar


*Visual

scalar *Visual

>0.1



OIL ANALYSIS REPORT

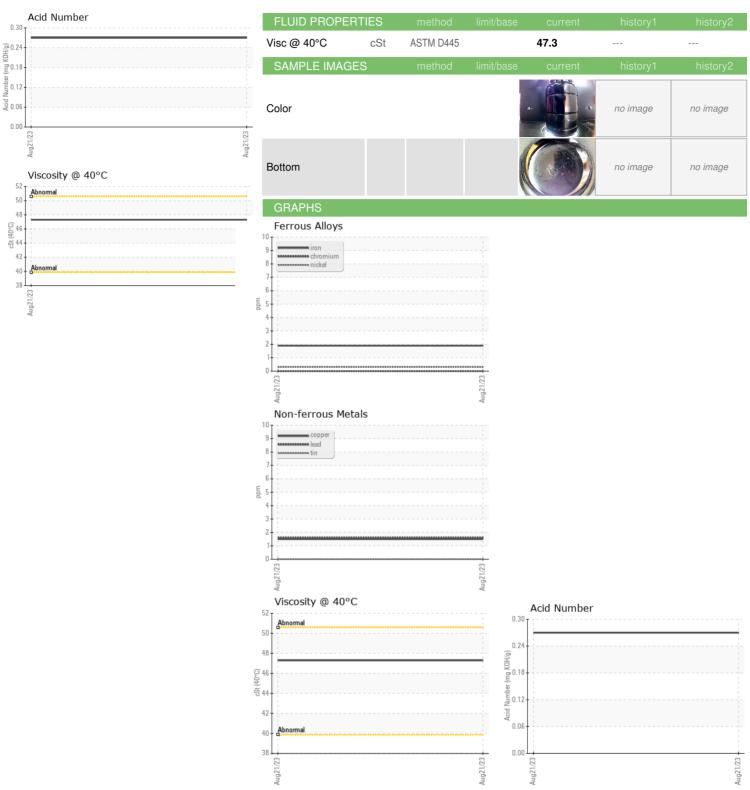





Laboratory Sample No. Lab Number

Unique Number : 10622610 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCZ05937339 : 05937339

Received : 29 Aug 2023 Diagnosed : 30 Aug 2023 Diagnostician : Don Baldridge **ZORN COMP & EQUIPMENT INC - EAU CLAIRE** 2218-D TRUAX BLVD EAU CLAIRE, WI

US 54703 Contact: BILL MESTELLE bill.mestelle@zornair.com T: (715)830-5292

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)