


#### Area LFC-1030-CM-01-CM008 Machine Id CM08VT08-1030 SLAVE - SLAVE Component

Gearbox Fluid LE 4660 (3 GAL)

NEAD

# COMPONENT CONDITION SUMMARY

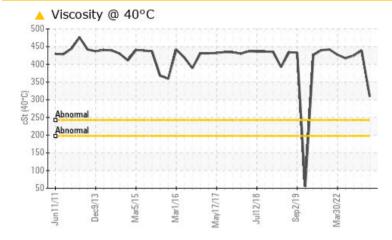

RECON	MEND	

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS						
Sample Status				ATTENTION	ABNORMAL	ABNORMAL
Visc @ 40°C	cSt	ASTM D445		<u> </u>	439	425

Customer Id: LEPALL Sample No.: WC0847420 Lab Number: 05937424 Test Package: IND 2



To manage this report scan the QR code

*To discuss the diagnosis or test data:* Don Baldridge +1 <u>don.b505@comcast.net</u>

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

#### **RECOMMENDED ACTIONS**

There are no recommended actions for this sample.

#### HISTORICAL DIAGNOSIS

### 23 May 2023 Diag: Don Baldridge



No corrective action is recommended at this time. Resample at the next service interval to monitor.All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



view report

#### 04 Mar 2023 Diag: Don Baldridge



N W

No corrective action is recommended at this time. Resample at the next service interval to monitor.All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

11 Dec 2022 Diag: Wes Davis


#### NORMAL



Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





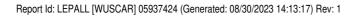



# **OIL ANALYSIS REPORT**

#### Area LFC-1030-CM-01-CM008 Machine Id CM08VT08-1030 SLAVE - SLAVE Component

Gearbox

# LE 4660 (3 GAL)

## DIAGNOSIS

#### Recommendation

Resample at the next service interval to monitor.

#### Wear


All component wear rates are normal.

#### Contamination

There is no indication of any contamination in the oil.

## Fluid Condition

Viscosity of sample indicates oil is within ISO 320 range, advise investigate. Confirm oil type. The AN level is acceptable for this fluid.

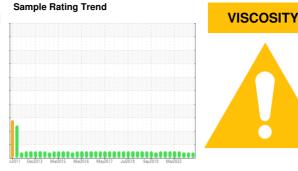

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0847420	WC0819646	WC0771831
Sample Date		Client Info		24 Aug 2023	23 May 2023	04 Mar 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ATTENTION	ABNORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	23	18	17
Chromium	ppm	ASTM D5185m	>15	0	<1	0
Nickel	ppm	ASTM D5185m	>15	<1	<1	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	<1	0	1
Lead	ppm	ASTM D5185m	>100	<1	0	0
Copper	ppm	ASTM D5185m	>200	9	<1	2
Tin	ppm	ASTM D5185m	>25	1	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		2	0	0
Molybdenum	ppm	ASTM D5185m		0	0	<1
Manganese	ppm	ASTM D5185m		0	<1	<1
Magnesium	ppm	ASTM D5185m		<1	<1	<1
Calcium	ppm	ASTM D5185m		12	9	12
Phosphorus	ppm	ASTM D5185m		302	497	413
Zinc	ppm	ASTM D5185m		3	0	3
Sulfur	ppm	ASTM D5185m		1425	790	576
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	6	8	8
Sodium	ppm	ASTM D5185m		0	<1	0
Potassium	ppm	ASTM D5185m	>20	<1	<1	<1
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.33	0.26	0.31
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	LIGHT
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	LIGHT	A MODER	🔺 MODER
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
10.10 5 1						

Contact/Location: BILL FERRIER - LEPALL



# **OIL ANALYSIS REPORT**

