



FUEL REPORT


Sample Rating Trend

NORMAL



Machine Id
KATOLIGHT MTN-485 - 161974

Component
Diesel Fuel
Fluid
NOT GIVEN (--- GAL)

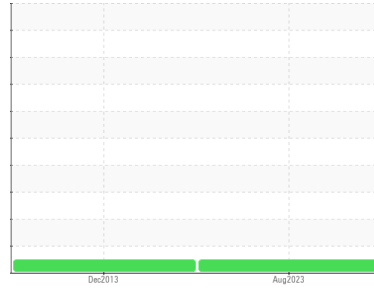

DIAGNOSIS

Recommendation

No corrective action is recommended at this time.

Corrosion

All metal levels are normal indicating no corrosion in the system.

Contaminants

The water content is negligible. There is no indication of any contamination in the fuel.

Fuel Condition

The condition of the fuel is acceptable for the time in service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			WC0715841	WC03426428	---
Sample Date	Client Info			28 Aug 2023	30 Dec 2013	---
Machine Age	hrs	Client Info		0	0	---
Sample Status				NORMAL	NORMAL	---

PHYSICAL PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		2.57	---	---

SULFUR CONTENT		method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m		49	100	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	0	0	---
Sodium	ppm	ASTM D5185m	<0.1	0	0	---
Potassium	ppm	ASTM D5185m	<0.1	0	4	---
Water	%	ASTM D6304	<0.05	0.013	---	---
ppm Water	ppm	ASTM D6304	<500	135.3	---	---

HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	1	<1	---
Nickel	ppm	ASTM D5185m	<0.1	0	0	---
Lead	ppm	ASTM D5185m	<0.1	0	0	---
Vanadium	ppm	ASTM D5185m	<0.1	0	0	---
Iron	ppm	ASTM D5185m	<0.1	0	0	---
Calcium	ppm	ASTM D5185m	<0.1	0	0	---
Magnesium	ppm	ASTM D5185m	<0.1	0	0	---
Phosphorus	ppm	ASTM D5185m	<0.1	2	0	---
Zinc	ppm	ASTM D5185m	<0.1	0	0	---





SAMPLE IMAGES

method	limit/base	current	history1	history2
Color			no image	no image
Bottom			no image	no image



FUEL REPORT

GRAPHS

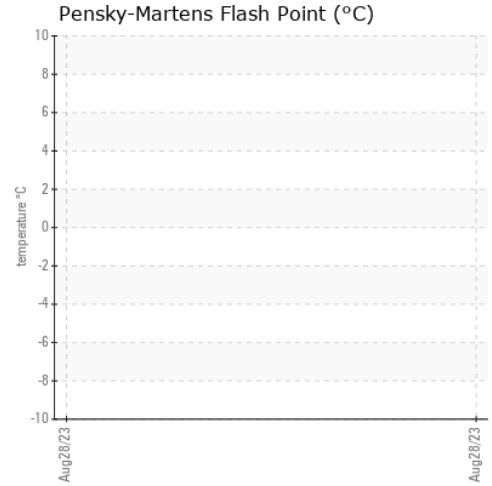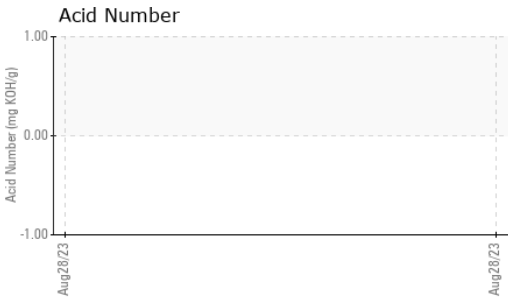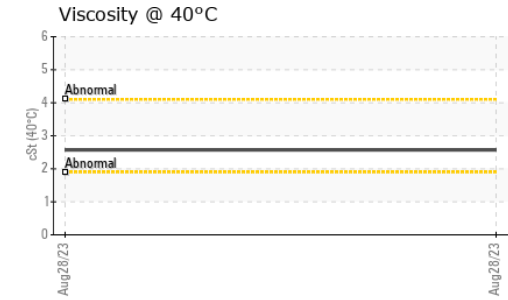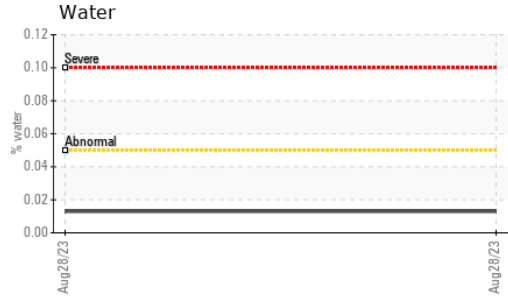

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0715841 **Received** : 29 Aug 2023
Lab Number : **05938033** **Diagnosed** : 05 Sep 2023
Unique Number : 10628645 **Diagnostician** : Doug Bogart
Test Package : MOB 1 (Additional Tests: KF)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

ATS - ATLANTIC TOWER SERVICES
 2544 E LANDSTREET RD, SUITE 600
 ORLANDO, FL
 US 32824
 Contact: BERT HILL
 BHILL@ACCESSATS.COM
 T:
 F: (866)844-3959