


# **PROBLEM SUMMARY**

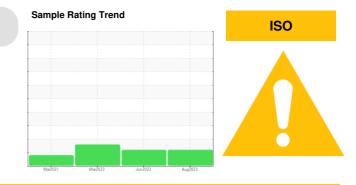


### Machine Id B21613 - 8 (S/N 69700023) Component

Gearbox

JAX MAGNA-PLATE 85W140-FG (--- GAL)

## COMPONENT CONDITION SUMMARY

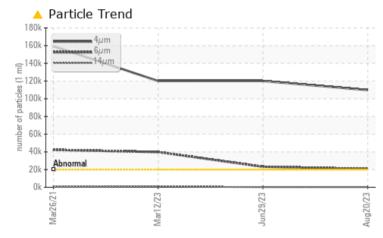

### RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL	ABNORMAL	ABNORMAL				
Particles >4µm	ASTM D7647	>20000	<u> </u>	<b>1</b> 20059	120041				
Particles >6µm	ASTM D7647	>5000	<u> </u>	🔺 23198	<b>A</b> 39803				
Oil Cleanliness	ISO 4406 (c)	>21/19/16	<u> </u>	<u> </u>	<u> </u>				

Customer Id: HORBEL Sample No.: WC0820486 Lab Number: 05938227 Test Package: IND 2



To manage this report scan the QR code

*To discuss the diagnosis or test data:* Don Baldridge +1 <u>don.b505@comcast.net</u>

*To change component or sample information:* Customer Service +1 1-800-237-1369 <u>customerservice@wearcheck.com</u>

### **RECOMMENDED ACTIONS**

There are no recommended actions for this sample.

### HISTORICAL DIAGNOSIS

### 29 Jun 2023 Diag: Doug Bogart



No corrective action is recommended at this time. Resample at the next service interval to monitor.All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



#### 12 Mar 2023 Diag: Don Baldridge

We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. Resample at the next service interval to monitor.All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.






#### 26 Mar 2021 Diag: Angela Borella

Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





# **OIL ANALYSIS REPORT**

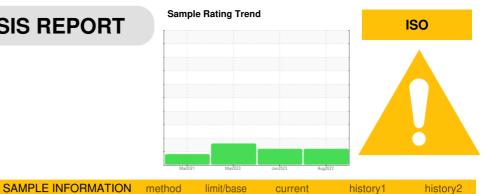

### Machine Id B21613 - 8 (S/N 69700023) Component

Gearbox

Fluid JAX MAGNA-PLATE 85W140-FG (--- GAL)

### DIAGNOSIS

### Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.


### Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sample Number		Client Info		WC0820486	WC0799724	WC0781539
Sample Date		Client Info		20 Aug 2023	29 Jun 2023	12 Mar 2023
Machine Age	yrs	Client Info		0	0	0
Oil Age	yrs	Client Info		0	1	0
Oil Changed		Client Info		N/A	Not Changd	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	2	1	1
Chromium	ppm	ASTM D5185m	>15	0	0	0
Nickel	ppm	ASTM D5185m	>15	<1	0	0
Titanium	ppm	ASTM D5185m		0	<1	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	0	<1	0
Lead	ppm	ASTM D5185m	>100	0	0	0
Copper	ppm	ASTM D5185m	>200	5	8	2
Tin	ppm	ASTM D5185m	>25	0	<1	0
Antimony	ppm	ASTM D5185m	>5			
Vanadium	ppm	ASTM D5185m		0	<1	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	2	<1
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		<1	1	<1
Manganese	ppm	ASTM D5185m		<1	<1	0
Magnesium	ppm	ASTM D5185m		2	<1	<1
Calcium	ppm	ASTM D5185m		0	0	<1
Phosphorus	ppm	ASTM D5185m		491	444	308
Zinc	ppm	ASTM D5185m		0	0	0
Sulfur	ppm	ASTM D5185m		7319	6318	4308
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	<1	<1	1
Sodium	ppm	ASTM D5185m		0	0	0
Potassium	ppm	ASTM D5185m	>20	0	<1	<1
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>20000	🔺 109849	120059	🔺 120041
Particles >6µm		ASTM D7647	>5000	<u> </u>	🔺 23198	▲ 39803
Particles >14µm		ASTM D7647	>640	155	161	<b>A</b> 882
Particles >21µm		ASTM D7647	>160	30	17	119
Particles >38µm		ASTM D7647	>40	1	1	4
Particles >71µm		ASTM D7647	>10	0	0	1
Oil Cleanliness		ISO 4406 (c)	>21/19/16	<b>4</b> 24/22/14	▲ 24/22/15	▲ 24/22/17
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.67	0.72	0.62




# **OIL ANALYSIS REPORT**

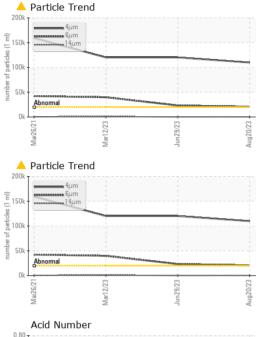

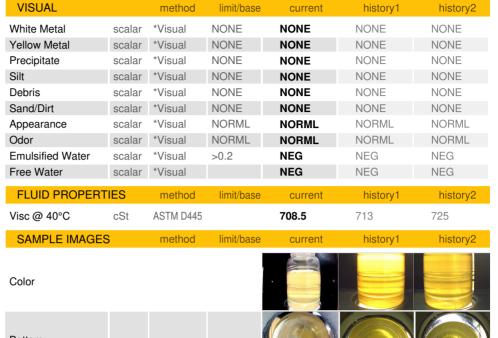

Bottom

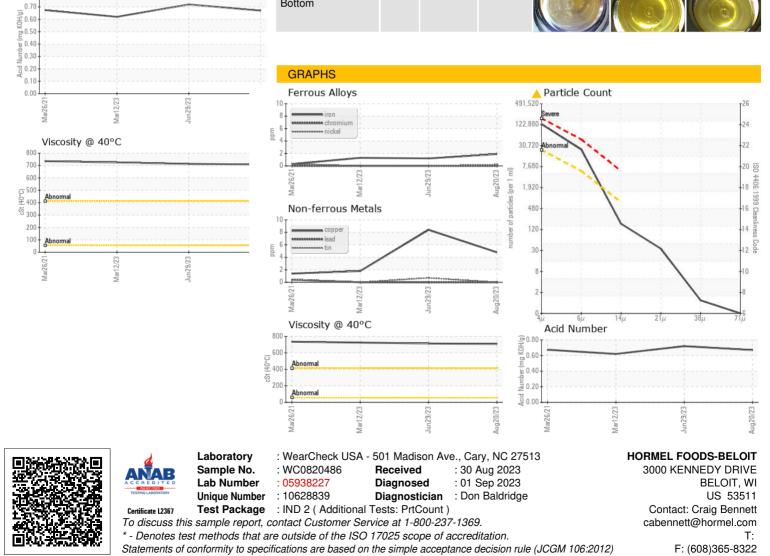

Contact/Location: Craig Bennett - HORBEL