




PROBLEM SUMMARY


Sample Rating Trend

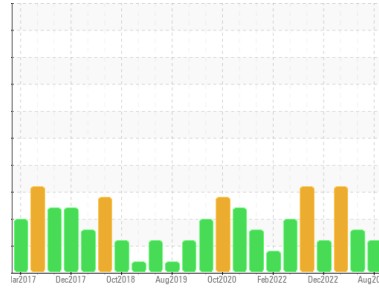

Machine Id
VM-3-VPPB (S/N UO95106661)
 Component
Pump
 Fluid
USPI VAC 100 (--- GAL)

COMPONENT CONDITION SUMMARY

▲ Particle Trend

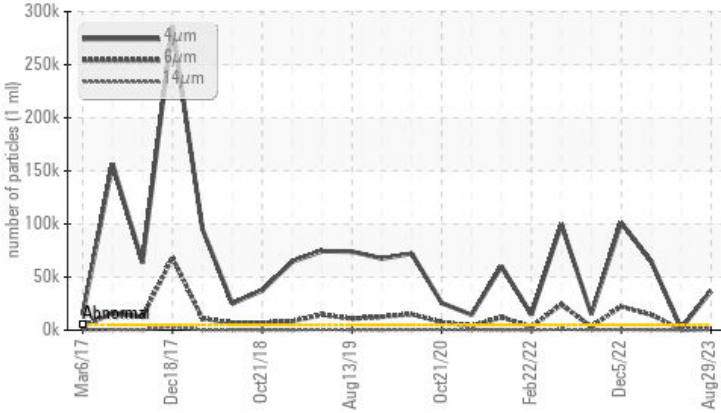

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	ABNORMAL	ABNORMAL
Particles >4µm	ASTM D7647	>5000	▲ 36692	1699	▲ 64900
Particles >6µm	ASTM D7647	>1300	▲ 1619	618	▲ 14503
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 22/18/11	18/16/13	▲ 23/21/15

Customer Id: TYSJOSPRO
 Sample No.: USPM29452
 Lab Number: 05939002
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Doug Bogart +1 (800)237-1369 x4016
dougb@wearcheckusa.com

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

21 May 2023 Diag: Jonathan Hester

WATER



We advise that you check for the source of water entry. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate concentration of water present in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid.

view report



29 Dec 2022 Diag: Doug Bogart

DIRT



We recommend you service the filters on this component. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. Elemental level of silicon (Si) above normal. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



05 Dec 2022 Diag: Doug Bogart

ISO



Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

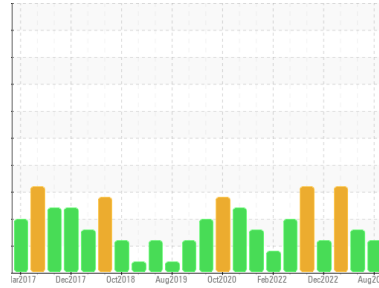

Machine Id
VM-3-VPPB (S/N UO95106661)
 Component
Pump
 Fluid
USPI VAC 100 (--- GAL)

DIAGNOSIS

- Recommendation**
Resample at the next service interval to monitor.
- Wear**
All component wear rates are normal.
- Contamination**
There is a high amount of silt (particulates < 14 microns in size) present in the oil.
- Fluid Condition**
The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	USPM29452	USPM28124	USPM25487
Sample Date	Client Info	29 Aug 2023	21 May 2023	29 Dec 2022
Machine Age	hrs	Client Info	0	0
Oil Age	hrs	Client Info	0	0
Oil Changed	Client Info	N/A	N/A	N/A
Sample Status		ABNORMAL	ABNORMAL	ABNORMAL

WEAR METALS

method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185m >90	4	4	40
Chromium	ppm	ASTM D5185m >5	0	0	0
Nickel	ppm	ASTM D5185m >5	0	0	0
Titanium	ppm	ASTM D5185m >3	0	0	0
Silver	ppm	ASTM D5185m >3	0	0	0
Aluminum	ppm	ASTM D5185m >7	1	0	<1
Lead	ppm	ASTM D5185m >12	<1	0	0
Copper	ppm	ASTM D5185m >30	<1	0	6
Tin	ppm	ASTM D5185m >9	0	0	<1
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185m 0	0	0	0
Barium	ppm	ASTM D5185m 0	2	0	0
Molybdenum	ppm	ASTM D5185m 0	0	0	0
Manganese	ppm	ASTM D5185m	0	0	0
Magnesium	ppm	ASTM D5185m 0	0	0	0
Calcium	ppm	ASTM D5185m 0	0	<1	0
Phosphorus	ppm	ASTM D5185m 1800	719	734	593
Zinc	ppm	ASTM D5185m 0	2	0	2
Sulfur	ppm	ASTM D5185m 0	103	59	562

CONTAMINANTS






method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185m >60	14	13	▲ 68
Sodium	ppm	ASTM D5185m	0	0	6
Potassium	ppm	ASTM D5185m >20	<1	<1	0
Water	%	ASTM D6304	0.097	▲ 0.532	0.023
ppm Water	ppm	ASTM D6304 >.1	976.7	▲ 5324	231.2

FLUID CLEANLINESS

method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647 >5000	▲ 36692	1699	▲ 64900
Particles >6µm	ASTM D7647 >1300	▲ 1619	618	▲ 14503
Particles >14µm	ASTM D7647 >160	17	54	▲ 196
Particles >21µm	ASTM D7647 >40	6	12	22
Particles >38µm	ASTM D7647 >10	0	1	4
Particles >71µm	ASTM D7647 >3	0	1	1
Oil Cleanliness	ISO 4406 (c) >19/17/14	▲ 22/18/11	18/16/13	▲ 23/21/15

FLUID DEGRADATION


method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D8045 0.05	0.09	0.286	0.337

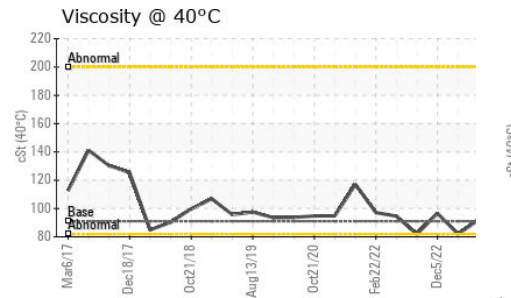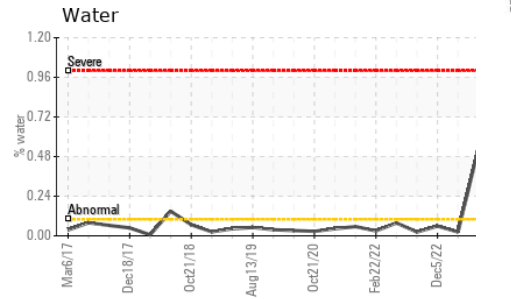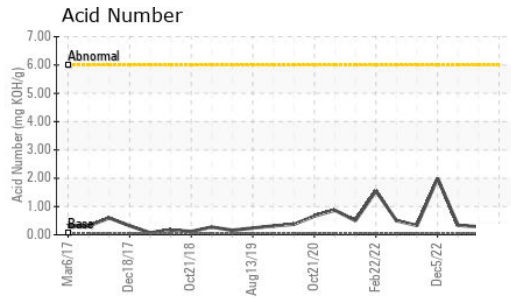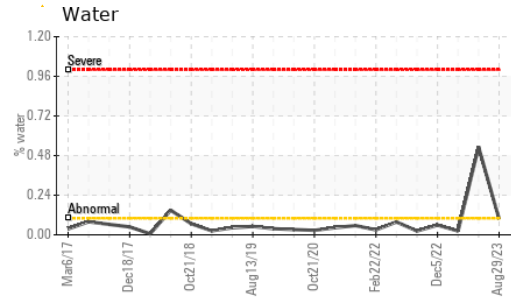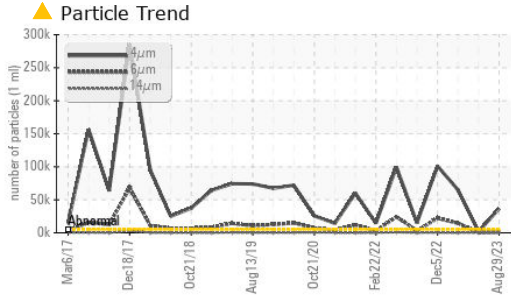






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	VLITE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	VLITE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	NEG	NEG	NEG
Free Water	scalar	*Visual	NEG	NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 91	90.7	92.0	81.9

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

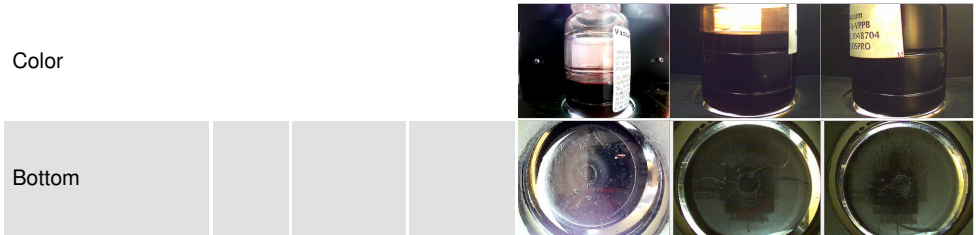

GRAPHS

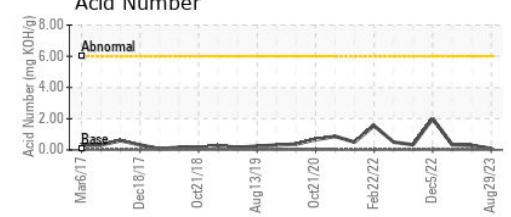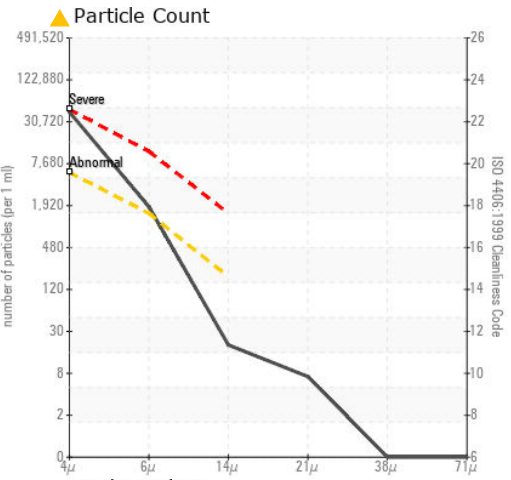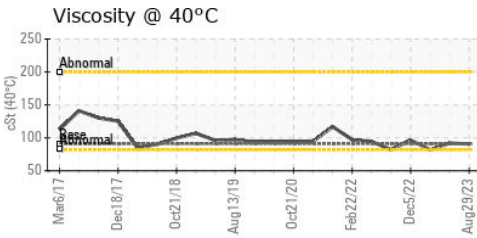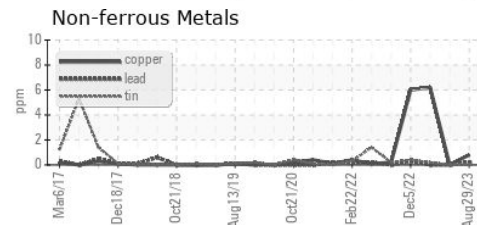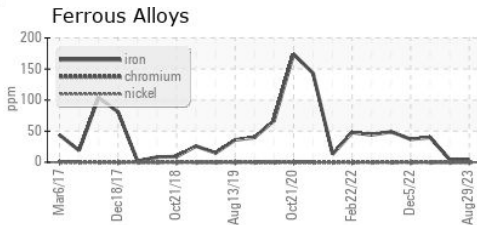

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : USPM29452
Lab Number : 05939002
Unique Number : 10629614
Test Package : IND 2

TYSON - PROCESS/SLAUGHTER - MAIN PLANT
 28424 38TH AVE N
 JOSLIN, IL
 US 61257
 Contact: RICK DUVALL

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
 F: (402)423-6661