


# **OIL ANALYSIS REPORT**

WO 68
Machine Id
HL 1 - BUFFALO WATER

Non-Drive End Bearing

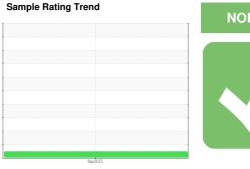

# NORMAL

### DIAGNOSIS

# Recommendation

Resample at the next service interval to monitor.

### Moor

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the oil


# **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Sep2023		
OAMBLE INCOM	4471011					
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH05959918		
Sample Date		Client Info		20 Sep 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	<1		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	2		
Lead	ppm	ASTM D5185m	>20	<1		
Copper	ppm	ASTM D5185m	>20	2		
Tin	ppm	ASTM D5185m	>20	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVEO	1-1-		11 11 11		12.4	1::
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	0		
Barium	ppm	ASTM D5185m	5	0		
Molybdenum	ppm	ASTM D5185m	5	<1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	5	<1		
Calcium	ppm	ASTM D5185m	12	0		
Phosphorus	ppm	ASTM D5185m	400	577		
Zinc	ppm	ASTM D5185m	12	0		
Sulfur	ppm	ASTM D5185m	650	700		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	3		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.50	0.41		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>2	NEG		
Free Water	scalar	*Visual	_	NEG		



# **OIL ANALYSIS REPORT**

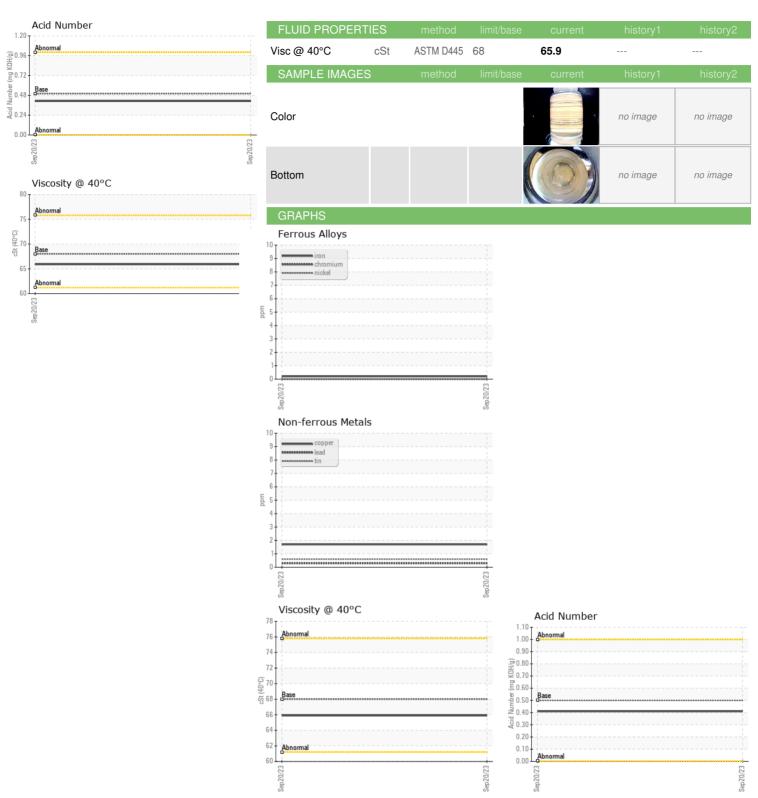





Laboratory Sample No. Lab Number Unique Number : 10661131 Test Package : IND 2

: UCH05959918 : 05959918

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed Diagnostician : Don Baldridge

: 25 Sep 2023 : 26 Sep 2023 **CORROSION PRODUCTS & EQUIPMENT INC** 110 ELMGROVE PARK

ROCHESTER, NY US 14624

Contact: Bill Cox

cox@corrosion-products.com

T: (585)455-7978 F: (585)247-7268

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)