




# PROBLEM SUMMARY

## Sample Rating Trend


ISO

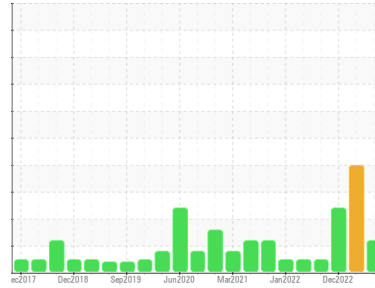

Area  
**RP-101 [10023508715]**  
 Machine Id  
**B57029 - CENTRIFUGE BIRD 24 X 60 SR-235 (S/N LB5509)**  
 Component  
**Gearbox**  
 Fluid  
**PETRO CANADA SYNDURO SHB ISO 68 (--- QTS)**

## COMPONENT CONDITION SUMMARY

### ▲ Particle Trend

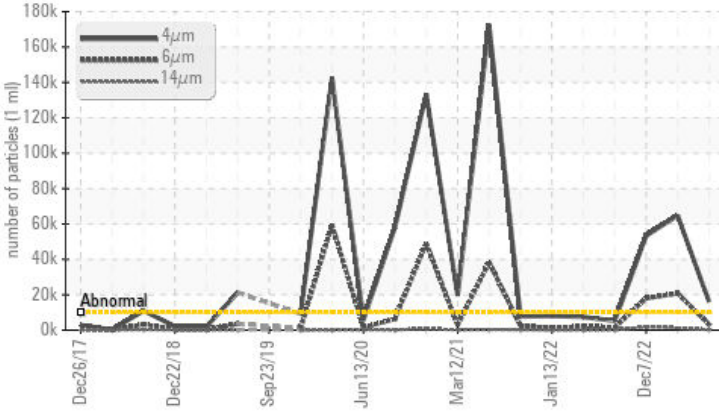

## RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

## PROBLEMATIC TEST RESULTS

Sample Status			ATTENTION	SEVERE	ABNORMAL
Particles >4µm	ASTM D7647	>10000	▲ 16189	▲ 64774	▲ 53337
Particles >6µm	ASTM D7647	>2500	▲ 3217	● 20768	▲ 18067
Oil Cleanliness	ISO 4406 (c)	>20/18/15	▲ 21/19/15	● 23/22/17	▲ 23/21/18

Customer Id: HORAUS  
 Sample No.: WC0842511  
 Lab Number: 05961211  
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:  
 Wes Davis +1 905-569-8600 x223  
[wesd@wearcheck.ca](mailto:wesd@wearcheck.ca)

To change component or sample information:  
 Customer Service +1 1-800-237-1369  
[customerservice@wearcheck.com](mailto:customerservice@wearcheck.com)

## RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Information Required	---	---	?	NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

## HISTORICAL DIAGNOSIS

### 08 Jun 2023 Diag: Wes Davis

ISO



We advise that you check all areas where contaminants can enter the system. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. All component wear rates are normal. There is a high amount of particulates (2 to 100 microns in size) present in the oil. The system cleanliness code is much higher than the acceptable limit for the target ISO 4406 cleanliness code. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

view report



### 07 Dec 2022 Diag: Wes Davis

ISO



We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. All component wear rates are normal. Oil Cleanliness are abnormally high. Particles >14µm are abnormally high. Particles >21µm are abnormally high. Particles >4µm are abnormally high. Particles >38µm are abnormally high. Particles >6µm are abnormally high. The system cleanliness is above the acceptable limit for the target ISO 4406 cleanliness code. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

view report



### 19 Jun 2022 Diag: Wes Davis

NORMAL



Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





# OIL ANALYSIS REPORT

Sample Rating Trend

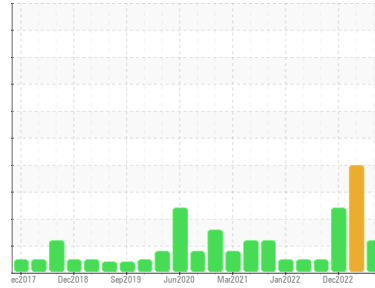

ISO



Area  
**RP-101 [10023508715]**  
 Machine Id  
**B57029 - CENTRIFUGE BIRD 24 X 60 SR-235 (S/N LB5509)**  
 Component  
**Gearbox**  
 Fluid  
**PETRO CANADA SYNDURO SHB ISO 68 (--- QTS)**

## DIAGNOSIS

### Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

### Wear

All component wear rates are normal.

### Contamination

There is a light amount of silt (particulates < 14 microns in size) present in the oil.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>WC0842511</b>	WC0781458	WC0743770
Sample Date	Client Info		<b>25 Sep 2023</b>	08 Jun 2023	07 Dec 2022
Machine Age	hrs	Client Info	<b>0</b>	0	0
Oil Age	hrs	Client Info	<b>0</b>	0	0
Oil Changed	Client Info		<b>N/A</b>	N/A	N/A
Sample Status			<b>ATTENTION</b>	SEVERE	ABNORMAL

## WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >200	<b>4</b>	<1	<1
Chromium	ppm	ASTM D5185m >15	<b>0</b>	0	0
Nickel	ppm	ASTM D5185m >15	<b>0</b>	0	0
Titanium	ppm	ASTM D5185m	<b>0</b>	0	0
Silver	ppm	ASTM D5185m	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m >25	<b>0</b>	0	0
Lead	ppm	ASTM D5185m >100	<b>0</b>	0	0
Copper	ppm	ASTM D5185m >200	<b>&lt;1</b>	1	2
Tin	ppm	ASTM D5185m >25	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185m	<b>&lt;1</b>	0	0
Cadmium	ppm	ASTM D5185m	<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 0	<b>0</b>	0	0
Barium	ppm	ASTM D5185m 5.0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m 0	<b>0</b>	0	0
Manganese	ppm	ASTM D5185m	<b>&lt;1</b>	<1	0
Magnesium	ppm	ASTM D5185m 5.0	<b>0</b>	0	0
Calcium	ppm	ASTM D5185m 5.0	<b>0</b>	0	0
Phosphorus	ppm	ASTM D5185m 100	<b>65</b>	43	47
Zinc	ppm	ASTM D5185m 5.0	<b>0</b>	0	0
Sulfur	ppm	ASTM D5185m 1900	<b>2474</b>	2955	2781

## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >50	<b>0</b>	0	<1
Sodium	ppm	ASTM D5185m	<b>0</b>	<1	0
Potassium	ppm	ASTM D5185m >20	<b>0</b>	0	<1

## FLUID CLEANLINESS





	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>10000	<b>▲ 16189</b>	▲ 64774	▲ 53337
Particles >6µm	ASTM D7647	>2500	<b>▲ 3217</b>	● 20768	▲ 18067
Particles >14µm	ASTM D7647	>320	<b>224</b>	▲ 1223	▲ 1721
Particles >21µm	ASTM D7647	>80	<b>55</b>	▲ 229	▲ 429
Particles >38µm	ASTM D7647	>20	<b>4</b>	2	▲ 53
Particles >71µm	ASTM D7647	>4	<b>0</b>	1	6
Oil Cleanliness	ISO 4406 (c)	>20/18/15	<b>▲ 21/19/15</b>	● 23/22/17	▲ 23/21/18

## FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045 0.3	<b>0.29</b>	0.38	0.34




# OIL ANALYSIS REPORT

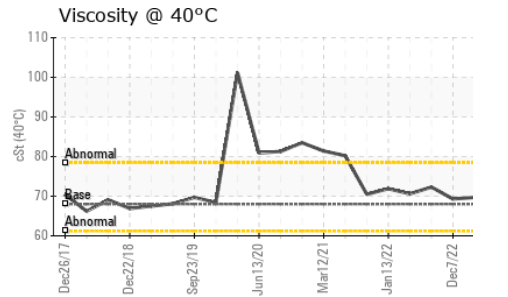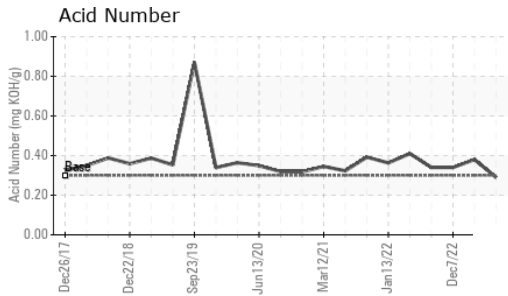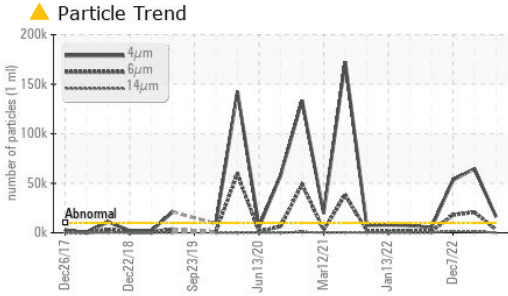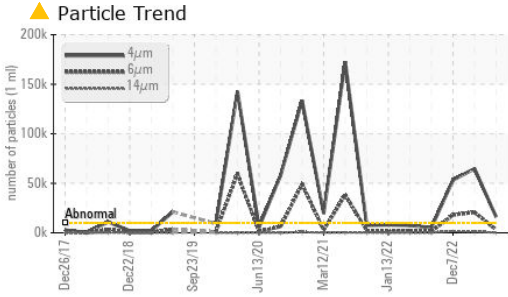






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	68.0	72.8	69.7

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

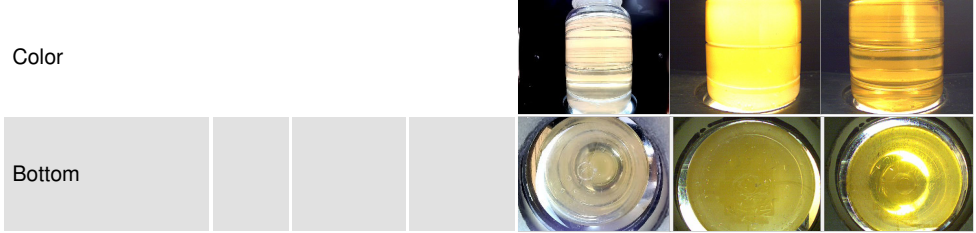

## GRAPHS

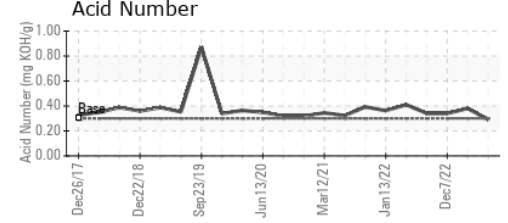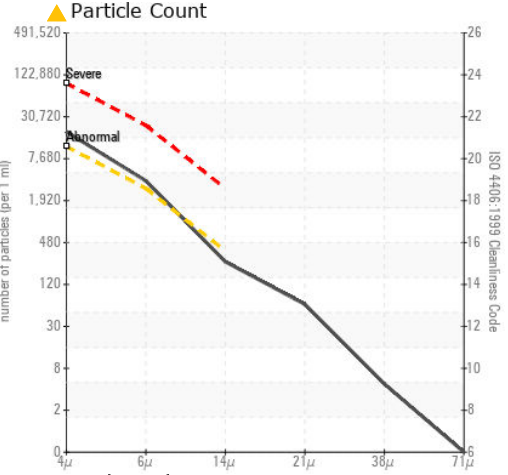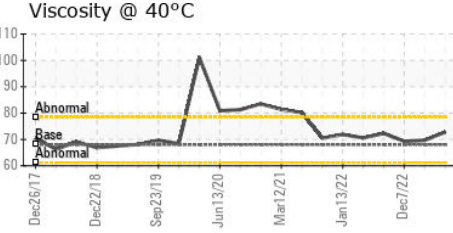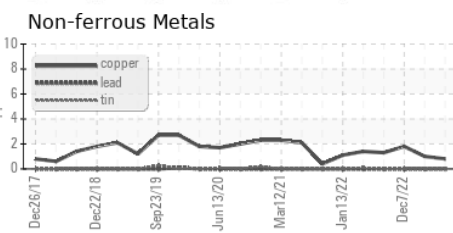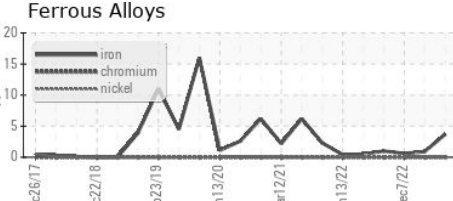

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : WC0842511 **Received** : 26 Sep 2023  
**Lab Number** : 05961211 **Diagnosed** : 27 Sep 2023  
**Unique Number** : 10662424 **Diagnostician** : Wes Davis  
**Test Package** : IND 2 ( Additional Tests: PrtCount )

**HORMEL FOODS - AUSTIN**  
 1101 NORTH MAIN ST  
 AUSTIN, MN  
 US 55912  
 Contact: RYAN LOWE  
 rslowe@hormel.com  
 T: (507)437-5674  
 F: (507)437-9805

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)