

PROBLEM SUMMARY

Sample Rating Trend

VIS DEBRIS


Machine Id

KAESER BSD 50 6981063 (S/N 5259)

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

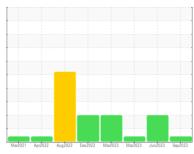



COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS							
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL	
Debris	scalar	*Visual	NONE	▲ MODER	NONE	▲ MODER	

Customer Id: SOUWHIKC Sample No.: KC05961250 Lab Number: 05961250 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

13 Jun 2023 Diag: Doug Bogart





The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



23 Mar 2023 Diag: Jonathan Hester

VIS DEBRIS



The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

20 Mar 2023 Diag: Don Baldridge

WATER



We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. All component wear rates are normal. There is a trace of moisture present in the oil. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend



Machine Id

KAESER BSD 50 6981063 (S/N 5259)

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Mar2021 A	Apr2022 Aug2022 Dec202	22 Mar2023 Mar2023 Jun2023	Sep2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC05961250	KC111268	KC101355
Sample Date		Client Info		07 Sep 2023	13 Jun 2023	23 Mar 2023
Machine Age	hrs	Client Info		12612	10550	9172
Oil Age	hrs	Client Info		0	1378	423
Oil Changed		Client Info		N/A	Not Changd	Not Changd
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	<1	4
Chromium	ppm	ASTM D5185m	>10	0	0	<1
Nickel	ppm	ASTM D5185m	>3	0	<1	<1
Titanium	ppm	ASTM D5185m	>3	0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>10	0	0	<1
Lead	ppm	ASTM D5185m	>10	0	0	0
Copper	ppm	ASTM D5185m	>50	9	10	9
Tin	ppm	ASTM D5185m	>10	0	0	<1
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m	90	0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		<1	0	<1
Magnesium	ppm	ASTM D5185m	90	0	0	0
Calcium	ppm	ASTM D5185m	2	0	0	0
Phosphorus	ppm	ASTM D5185m		2	0	7
Zinc	ppm	ASTM D5185m		0	0	0
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	0	0
Sodium	ppm	ASTM D5185m		<1	0	1
Potassium	ppm	ASTM D5185m	>20	0	<1	2
Water	%	ASTM D6304	>0.05	0.005	0.008	0.012
ppm Water	ppm	ASTM D6304	>500	58.6	80.3	128.1
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647			48471	
Particles >6µm		ASTM D7647	>1300		<u>▲</u> 16225	
Particles >14µm		ASTM D7647	>80		<u>^</u> 755	
Particles >21µm		ASTM D7647	>20		<u>^</u> 232	
Particles >38µm		ASTM D7647	>4		<u> </u>	
Particles >71µm		ASTM D7647	>3		0	
Oil Cleanliness		ISO 4406 (c)	>/17/13		<u>\$\text{\scale}\$ 23/21/17</u>	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

0.37

Acid Number (AN)


mg KOH/g ASTM D8045 0.4


0.38


0.45



OIL ANALYSIS REPORT

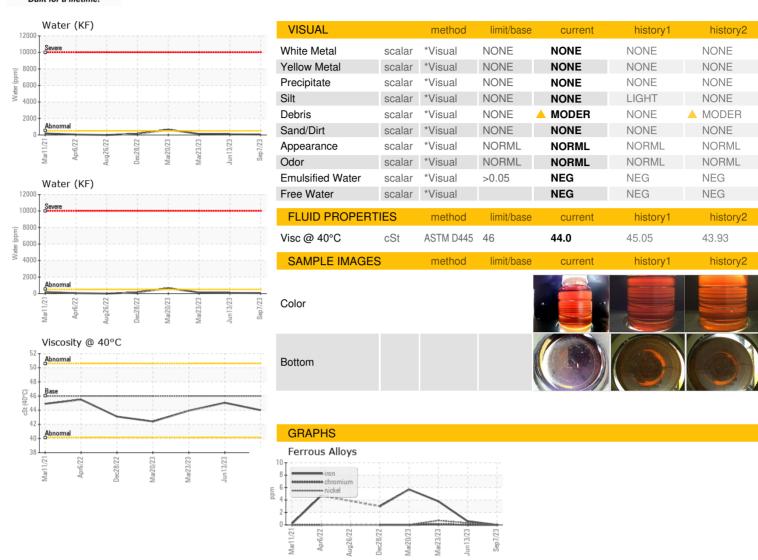

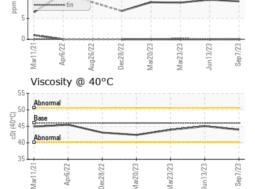

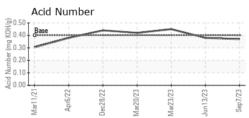





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** Test Package

: IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : KC05961250 Received : 05961250 : 10662463

Non-ferrous Metals

Diagnosed Diagnostician

: 26 Sep 2023 : 27 Sep 2023

: Don Baldridge

SOUTHERN NATURAL GAS 23480 HWY 405

WHITE CASTLE, LA US 70788

Contact:

T: F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)