

# **PROBLEM SUMMARY**

6777764 (S/N 1110)


Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

# Sample Rating Trend ISO Septicial

## **COMPONENT CONDITION SUMMARY**

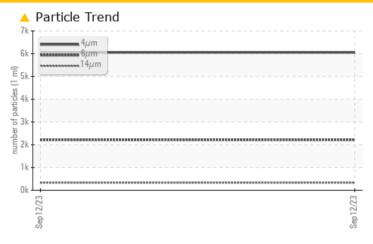

#### RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS										
Sample Status			ABNORMAL							
Particles >6μm	ASTM D7647	>1300	<b>2216</b>							
Particles >14µm	ASTM D7647	>80	<b>▲</b> 333							
Particles >21µm	ASTM D7647	>20	<u> </u>							
Oil Cleanliness	ISO 4406 (c)	>/17/13	<b>20/18/16</b>							

Customer Id: M4DLAK Sample No.: KCPA002336 Lab Number: 05961260 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

# RECOMMENDED ACTIONS

There are no recommended actions for this sample.

# HISTORICAL DIAGNOSIS




**OIL ANALYSIS REPORT** 

Machine Id **6777764 (S/N 1110)** 

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

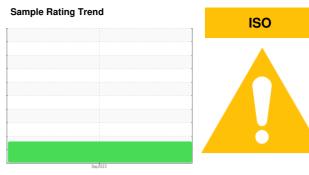

# **DIAGNOSIS**

#### Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

### Contamination

There is a high amount of particulates present in the oil.


#### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Sep2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA002336		
Sample Date		Client Info		12 Sep 2023		
Machine Age	hrs	Client Info		19193		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	5		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	1		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	<1		
Zinc	ppm	ASTM D5185m	0	0		
Sulfur	ppm	ASTM D5185m	23500	20497		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.004		
ppm Water	ppm	ASTM D6304	>500	45.9		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647		6053		
Particles >6µm		ASTM D7647	>1300	<u>^</u> 2216		
Particles >14μm		ASTM D7647	>80	<b>▲</b> 333		
Particles >21µm		ASTM D7647	>20	<u> </u>		
Particles >38μm		ASTM D7647	>4	2		
Particles >71μm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>^</u> 20/18/16		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.36		



# **OIL ANALYSIS REPORT**

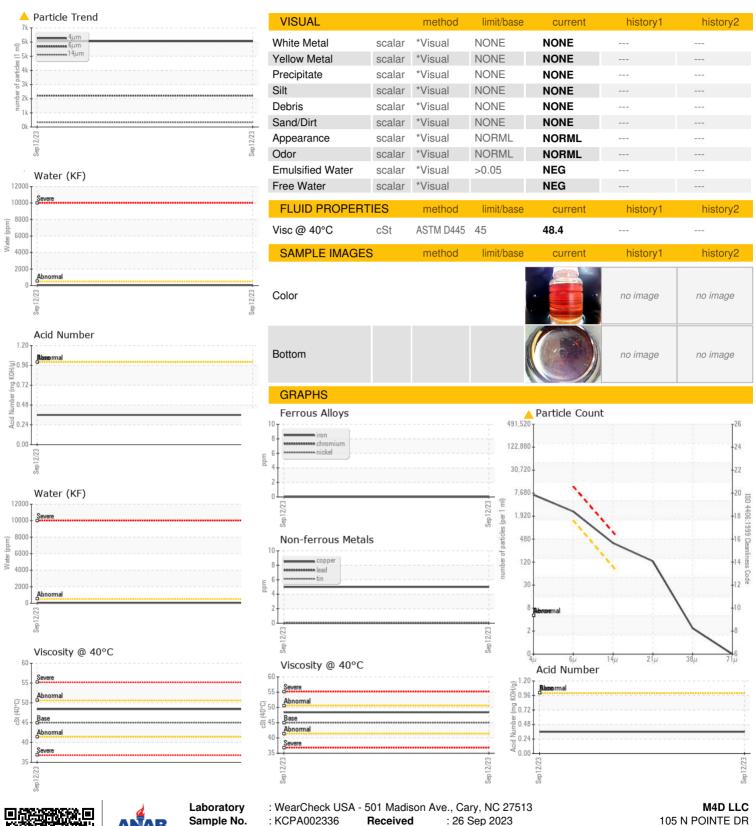



Certificate L2367

Sample No. Lab Number **Unique Number** 

: 05961260

Received : KCPA002336 Diagnosed : 27 Sep 2023 : 10662473 Diagnostician : Doug Bogart

Test Package : IND 2 ( Additional Tests: KF, PrtCount ) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

105 N POINTE DR LAKE FOREST, CA US 92630

Contact: Service Manager

T: F: