

# FUEL REPORT

Sample Rating Trend



#### Area **Store 9 - Marietta** Machine Id **JOHN DEERE 210G 113978 (S/N 1FF210GLLMF529660)** Component **Diesel Fuel**

Fluid NOT GIVEN (--- GAL)

# DIAGNOSIS

## Recommendation

This is a baseline read-out on the submitted sample. No corrective action is recommended at this time.

#### Corrosion

All metal levels are normal indicating no corrosion in the system.

### Contaminants

The water content is negligible. There is no indication of any contamination in the fuel.

### **Fuel Condition**

The condition of the fuel is acceptable for the time in service.







NORMAL


SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		LEC0038966		
Sample Date		Client Info		22 Sep 2023		
Machine Age	hrs	Client Info		1046		
Sample Status				NORMAL		
PHYSICAL PROP	ERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		2.57		
SULFUR CONTER	ΝT	method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m		15		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	0		
Sodium	ppm	ASTM D5185m	<0.1	0		
Potassium	ppm	ASTM D5185m	<0.1	0		
Water	%	ASTM D6304	<0.05	0.002		
ppm Water	ppm	ASTM D6304	<500	23.7		
HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	0		
Nickel	ppm	ASTM D5185m	<0.1	0		
Lead	ppm	ASTM D5185m	<0.1	0		
Vanadium	ppm	ASTM D5185m	<0.1	0		
Iron	ppm	ASTM D5185m	<0.1	0		
Calcium	ppm	ASTM D5185m	<0.1	0		
Magnesium	ppm	ASTM D5185m	<0.1	0		
Phosphorus	ppm	ASTM D5185m	<0.1	1		
Zinc	ppm	ASTM D5185m	<0.1	0		
SAMPLE IMAGES	;	method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image



# **FUEL REPORT**

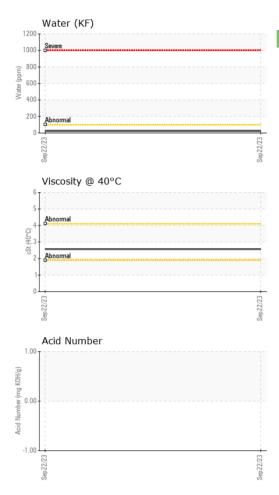

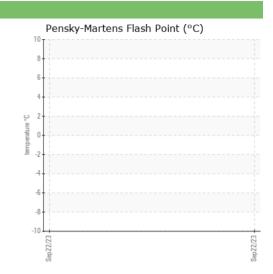

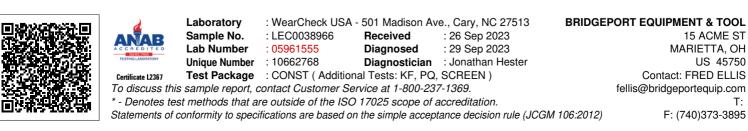

Page 2 of 2

T: