



PROBLEM SUMMARY

Sample Rating Trend



WATER




Machine Id
KAESER 5933439

Component
Compressor

Fluid
KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

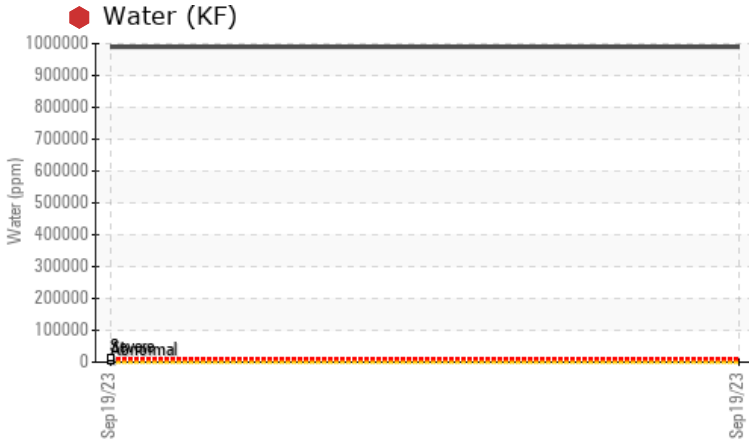

RECOMMENDATION

The filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS

Sample Status				SEVERE	---	---
Barium	ppm	ASTM D5185m	90	▲ 0	---	---
Magnesium	ppm	ASTM D5185m	100	▲ 0	---	---
Water	%	ASTM D6304	>0.05	◆ 99.0	---	---
ppm Water	ppm	ASTM D6304	>500	◆ 990000	---	---
Debris	scalar	*Visual	NONE	▲ MODER	---	---
Appearance	scalar	*Visual	NORML	▲ MILKY	---	---
Emulsified Water	scalar	*Visual	>0.05	◆ 0.2%	---	---
Free Water	scalar	*Visual		▲ >10%	---	---

Customer Id: OLDPOMFL
Sample No.: KCPA000837
Lab Number: 05962907
Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend



WATER



Machine Id
KAESER 5933439

Component
Compressor

Fluid
KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

The filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

Wear

All component wear rates are normal.

Contamination

Appearance is milky. Sample consists almost entirely of free water. There is a high concentration of water present in the oil. Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The oil is no longer serviceable due to the presence of contaminants.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		KCPA000837	---	---
Sample Date	Client Info		19 Sep 2023	---	---
Machine Age	hrs	Client Info	709	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		N/A	---	---
Sample Status			SEVERE	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >50	<1	---	---
Chromium	ppm	ASTM D5185m >10	0	---	---
Nickel	ppm	ASTM D5185m >3	0	---	---
Titanium	ppm	ASTM D5185m >3	<1	---	---
Silver	ppm	ASTM D5185m >2	0	---	---
Aluminum	ppm	ASTM D5185m >10	0	---	---
Lead	ppm	ASTM D5185m >10	0	---	---
Copper	ppm	ASTM D5185m >50	0	---	---
Tin	ppm	ASTM D5185m >10	0	---	---
Vanadium	ppm	ASTM D5185m	<1	---	---
Cadmium	ppm	ASTM D5185m	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 0	0	---	---
Barium	ppm	ASTM D5185m 90	0	---	---
Molybdenum	ppm	ASTM D5185m 0	0	---	---
Manganese	ppm	ASTM D5185m	<1	---	---
Magnesium	ppm	ASTM D5185m 100	0	---	---
Calcium	ppm	ASTM D5185m 0	0	---	---
Phosphorus	ppm	ASTM D5185m 0	1	---	---
Zinc	ppm	ASTM D5185m 0	0	---	---
Sulfur	ppm	ASTM D5185m 23500	0	---	---




CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	0	---	---
Sodium	ppm	ASTM D5185m	0	---	---
Potassium	ppm	ASTM D5185m >20	<1	---	---
Water	%	ASTM D6304 >0.05	99.0	---	---
ppm Water	ppm	ASTM D6304 >500	990000	---	---

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045 1.0	0.28	---	---

OIL ANALYSIS REPORT

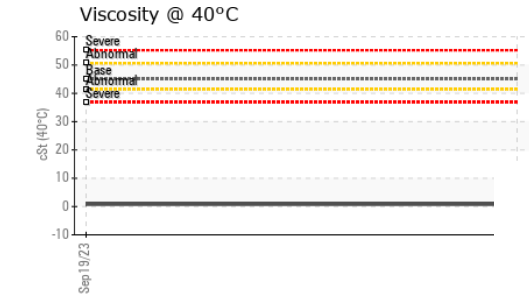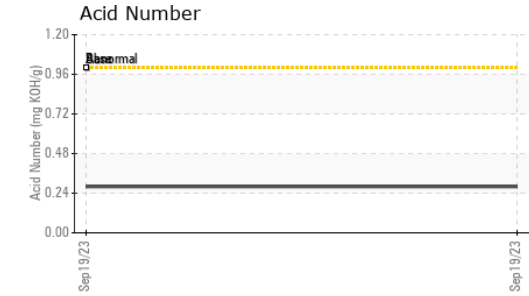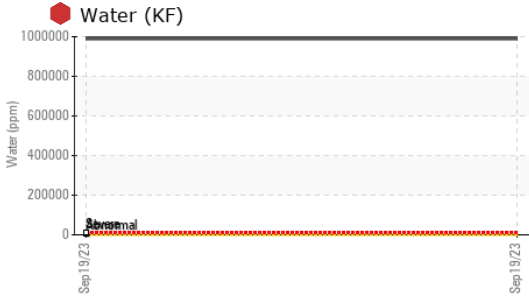





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	▲ MODER	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	▲ MILKY	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.05	● 0.2%	---
Free Water	scalar	*Visual		▲ >10%	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	45	0.8	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color				no image	no image
Bottom				no image	no image

GRAPHS

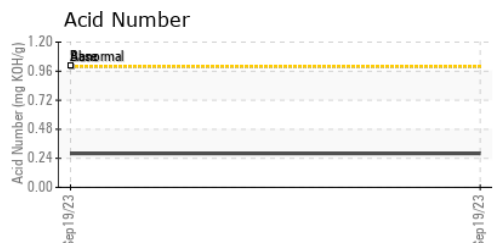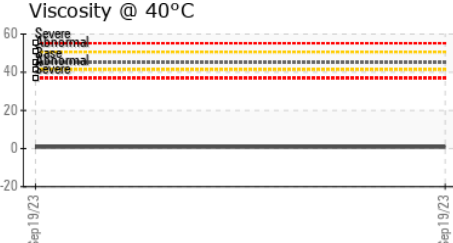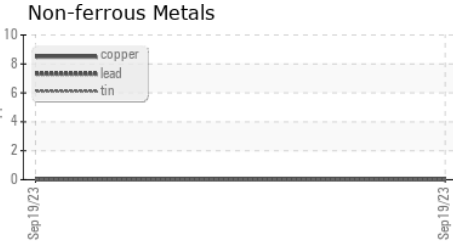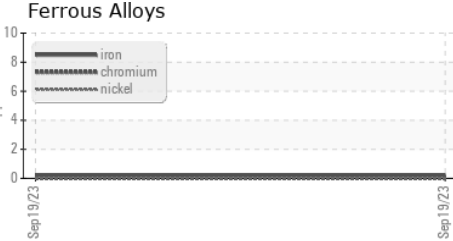

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : KCPA000837 **Received** : 27 Sep 2023
Lab Number : 05962907 **Diagnosed** : 29 Sep 2023
Unique Number : 10669458 **Diagnostician** : Jonathan Hester
Test Package : IND 2 (Additional Tests: KF, PrtCount)

OLD DOMINION FREIGHT LINE
 1601 NW 18TH ST
 POMPANO BEACH, FL
 US 33069
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: