

OIL ANALYSIS REPORT

Area **ELGI** Machine Id **ELGI MRJS041013 - COLUMBUS TECHNICAL COLLEGE** Component

Compressor

Dirical Colore

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear


All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

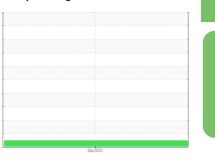

Sample Rating Trend



NORMAL


SAMPLE INFORM	1ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCP05962974		
Sample Date		Client Info		15 Sep 2023		
Machine Age	hrs	Client Info		32195		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
		ino oblo o ol	line it //s a a a		la la tanan d	la i ata muQ
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	<1		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	0		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		<1		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		0		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	<1		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.28		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		

Report Id: UCPATLIT [WUSCAR] 05962974 (Generated: 09/28/2023 22:48:30) Rev: 1

Contact/Location: CHRISSY HARBIN - UCPATLIT



OIL ANALYSIS REPORT

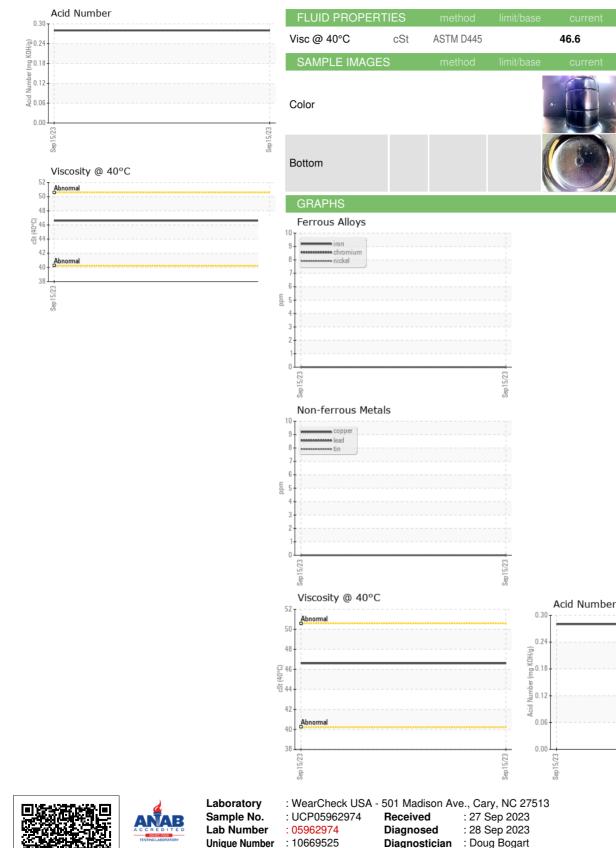

PATTONS INC - LITHONIA 6709 TRIBBLE STREET LITHONIA, GA US 30058 Contact: CHRISSY HARBIN chrissy.harbin@pattonsinc.com T: (770)484-9226 F: (770)482-5522

Test Package : IND 2

Contact/Location: CHRISSY HARBIN - UCPATLIT

no image

no image

no image

no image

Ben