


# **OIL ANALYSIS REPORT**



**Closter MACK 1275** 

Component **Diesel Engine** 

GIBRALTAR 15W/40 SUPER S-3 LX (11)

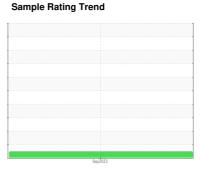



## Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the


## **Fluid Condition**

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

UPER S-3 LX (1	1)			Sep.2023			
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2	
Sample Number		Client Info		WC0830964			
Sample Date		Client Info		18 Sep 2023			
Machine Age	hrs	Client Info		0			
Oil Age	hrs	Client Info		0			
Oil Changed		Client Info		Changed			
Sample Status				NORMAL			
CONTAMINATIO	N	method	limit/base	current	history1	history2	
Fuel		WC Method	>3.0	<1.0			
Glycol		WC Method		NEG			
WEAR METALS		method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185m	>120	4			
Chromium	ppm	ASTM D5185m	>20	0			
Nickel	ppm	ASTM D5185m	>5	0			
Titanium	ppm	ASTM D5185m	>2	0			
Silver	ppm	ASTM D5185m	>2	0			
Aluminum	ppm	ASTM D5185m	>20	2			
Lead	ppm	ASTM D5185m	>40	<1			
Copper	ppm	ASTM D5185m	>330	<1			
Tin	ppm	ASTM D5185m	>15	<1			
Vanadium	ppm	ASTM D5185m		0			
Cadmium	ppm	ASTM D5185m		0			
ADDITIVES		method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185m		4			
Barium	ppm	ASTM D5185m		0			
Molybdenum	ppm	ASTM D5185m	66	62			
Manganese	ppm	ASTM D5185m		0			
Magnesium	ppm	ASTM D5185m	1000	749			
Calcium	ppm	ASTM D5185m	1050	1087			
Phosphorus	ppm	ASTM D5185m	1150	951			
Zinc	ppm	ASTM D5185m	1270	1150			
Sulfur	ppm	ASTM D5185m		3396			
CONTAMINANTS	6	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185m	>25	3			
Sodium	ppm	ASTM D5185m		2			
Potassium	ppm	ASTM D5185m	>20	6			
INFRA-RED		method	limit/base	current	history1	history2	
Soot %	%	*ASTM D7844	>4	0.5			
Nitration	Abs/cm	*ASTM D7624	>20	8.0			
Sulfation	Abs/.1mm	*ASTM D7415	>30	18.5			
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2	
Oxidation	Abs/.1mm	*ASTM D7414	>25	14.0			
Base Number (BN)	mg KOH/g			7.8			
_	mg nong	NOTHI DEGGO					




# **OIL ANALYSIS REPORT**

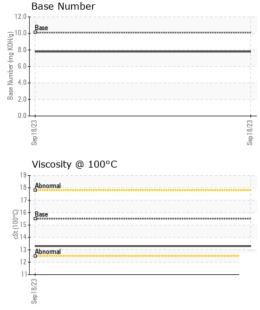



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
<b>Emulsified Water</b>	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	IFS.	method	limit/hase	current	history1	history2

I LOID I NOI LI	IIILO	memou			HISTOLAL	HISTOLYZ
Visc @ 100°C	cSt	ASTM D445	15.5	13.3		

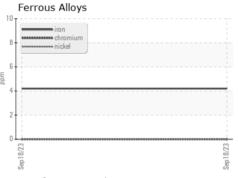

10-	Non-ferrous Metals
8-	copper
6.	
4-	
2-	
0.1	Sep 18/23 -
	Viscosity @ 100°C

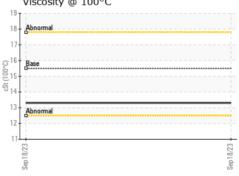

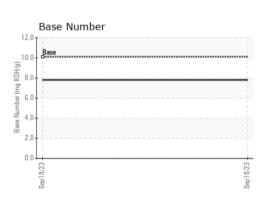





Certificate L2367

Test Package : FLEET

Laboratory Sample No. Lab Number Unique Number : 10670951

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC0830964 : 05964400

Received Diagnosed

: 29 Sep 2023 : 29 Sep 2023

Diagnostician : Wes Davis

77 RAILROAD AVENUE CLOSTER, NJ

Contact: Tony Gagliano tgagliano@interstatewaste.com T:

**INTERSTATE WASTE-CLOSTER** 

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: INTCLO [WUSCAR] 05964400 (Generated: 09/29/2023 16:29:11) Rev: 1

Submitted By: Tony Gagliano

US 07624

F: