

PROBLEM SUMMARY

Sample Rating Trend

WATER


KAESER 6099742

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

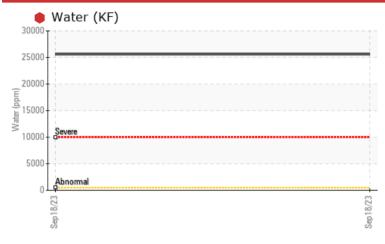

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS									
Sample Status				SEVERE					
Water	%	ASTM D6304	>0.05	2.56					
ppm Water	ppm	ASTM D6304	>500	25600					
Debris	scalar	*Visual	NONE	▲ MODER					
Emulsified Water	scalar	*Visual	>0.05	0.2%					

Customer Id: DANLAG Sample No.: KCP40108D Lab Number: 05964618 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Change Fluid			?	Oil and filter change at the time of sampling has been noted.		
Change Filter			?	Oil and filter change at the time of sampling has been noted.		
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.		

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend



KAESER 6099742

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We recommend an early resample in 500 hours to monitor this condition.

All component wear rates are normal.

Contamination

There is a high concentration of water present in the oil. Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Sep 2023		
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCP40108D		
Sample Date		Client Info		18 Sep 2023		
Machine Age	hrs	Client Info		16602		
Oil Age	hrs	Client Info		1		
Oil Changed		Client Info		Changed		
Sample Status				SEVERE		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	5		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	2		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	100	12		
Calcium	ppm	ASTM D5185m	0	4		
Phosphorus	ppm	ASTM D5185m	0	3		
Zinc	ppm	ASTM D5185m	0	31		
Sulfur	ppm	ASTM D5185m	23500	16215		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>0.05	2.56		
	ppm	ASTM D6304	>500	25600		
ppm Water	ppiii	710 1111 2000 1	7000			


0.14

Acid Number (AN)

mg KOH/g ASTM D8045 1.0



OIL ANALYSIS REPORT

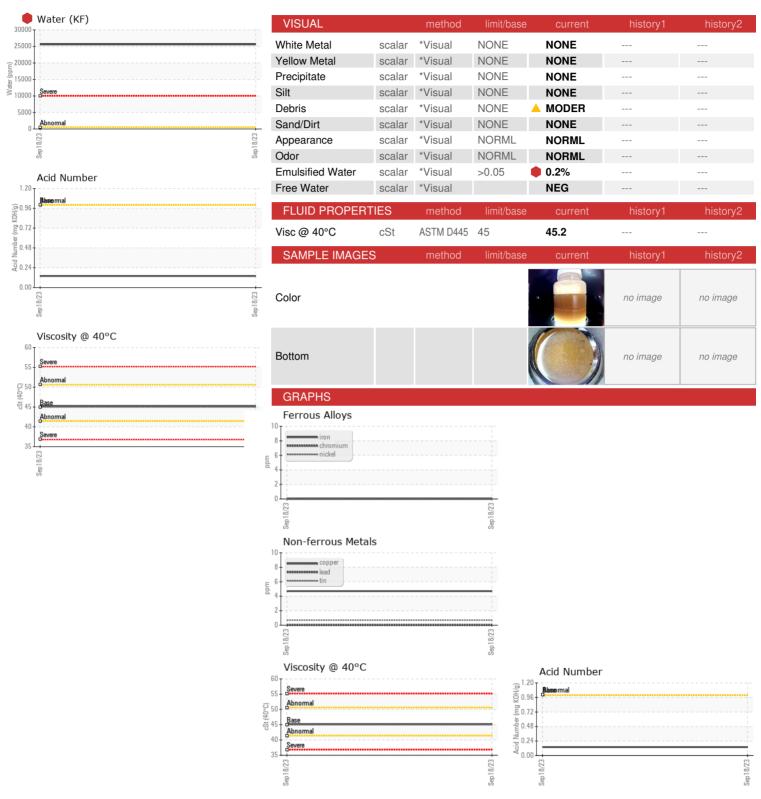





Laboratory Sample No. Lab Number **Unique Number**

: 10671169

: KCP40108D : 05964618

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 06 Oct 2023

Diagnostician : Jonathan Hester

: 29 Sep 2023

Test Package : IND 2 (Additional Tests: KF, PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) **DANA LONG INC**

23400 YERALTA DR, SUITE 1 LAGUNA HILLS, CA

US 92653

Contact: Service Manager

T: F: