

PROBLEM SUMMARY

Sample Rating Trend



KAESER 1056 - SDS MECHANICAL

Component

Compressor

KAESER SIGMA (OEM) S-460 (4 GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS								
Sample Status				MARGINAL	MARGINAL	NORMAL		
Debris	scalar	*Visual	NONE	MODER	▲ MODER	LIGHT		

Customer Id: PALFOU Sample No.: WC0825880 Lab Number: 05964705 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

22 Mar 2023 Diag: Doug Bogart

VIS DEBRIS



No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



09 Nov 2022 Diag: Angela Borella

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

SAMPLE INFORMATION

VIS DEBRIS



history2

KAESER 1056 - SDS MECHANICAL

Compressor

KAESER SIGMA (OEM) S-460 (4 GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Nov2022	Mar2023	Aug2023	

Sample Number		Client Info		WC0825880	WC0795283	WC0730069
Sample Date		Client Info		28 Aug 2023	22 Mar 2023	09 Nov 2022
Machine Age	hrs	Client Info		0	1526	1142
Oil Age	hrs	Client Info		0	711	1473
Oil Changed		Client Info		N/A	Not Changd	Not Changd
Sample Status				MARGINAL	MARGINAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	<1	<1
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m	>3	0	0	0
Titanium	ppm	ASTM D5185m	>3	0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>10	0	<1	0
Lead	ppm	ASTM D5185m	>10	0	<1	<1
Copper	ppm	ASTM D5185m	>50	<1	1	<1
Tin	ppm	ASTM D5185m	>10	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m	90	1	7	41
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m	90	73	72	91
Calcium	ppm	ASTM D5185m	2	4	1	3
Phosphorus	ppm	ASTM D5185m		3	5	26
Zinc	ppm	ASTM D5185m		14	4	0
Sulfur	ppm	ASTM D5185m		18013	16732	22242
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1	3	<1
Sodium	ppm	ASTM D5185m		13	12	11
Potassium	ppm	ASTM D5185m	>20	30	8	5
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.34	0.32	0.35
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	▲ MODER	▲ MODER	LIGHT
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
0.01.04\ Days 1				0	Hom. DADDINI M	ADD DALFOLL



OIL ANALYSIS REPORT

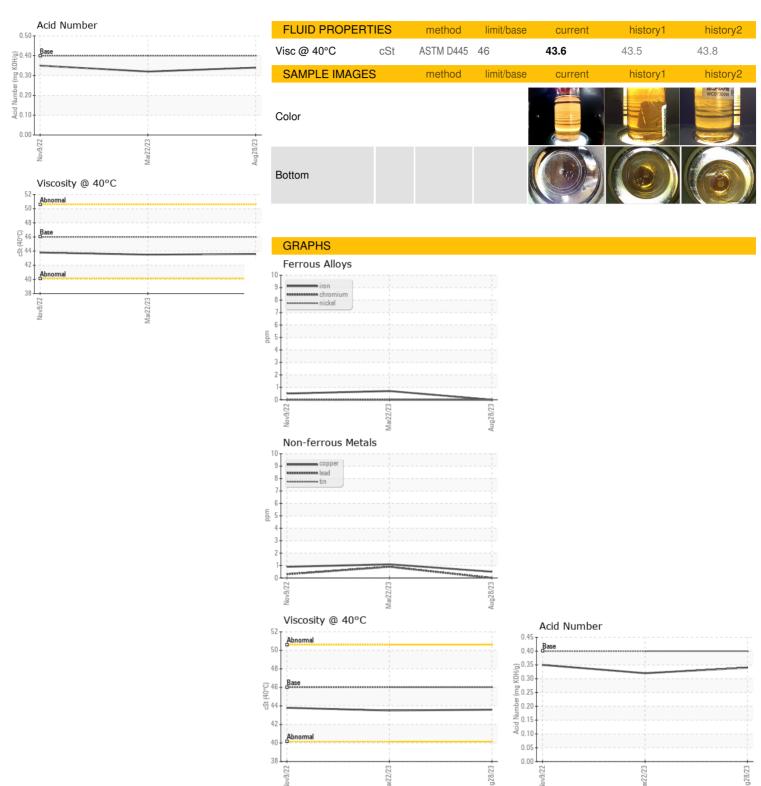





Certificate L2367

Laboratory Sample No. Lab Number

: 05964705 Unique Number : 10671256 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC0825880 Received : 29 Sep 2023

: 02 Oct 2023 Diagnosed Diagnostician : Doug Bogart **ELEVATED INDUSTRIAL SOLUTIONS - EIS** 302 HUGHES ST

FOUNTAIN INN, SC US 29644

Contact: DARRIN WARD dward@elevatedindustrial.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: DARRIN WARD - PALFOU

F: (864)862-7653

T: