


# **OIL ANALYSIS REPORT**

Sample Rating Trend



NORMAL

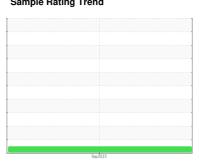

SM239D-COMP

Component **Swing Drive** 

**CHEVRON MEROPA 220 (--- GAL)** 

## Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the


## **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Sep 2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0825786		
Sample Date		Client Info		07 Sep 2023		
Machine Age	yrs	Client Info		0		
Oil Age	yrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>400	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m	710	<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	2		
Lead		ASTM D5185m	>50	0		
	ppm			-		
Copper	ppm	ASTM D5185m	>200	0		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	40	40		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		<1		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		4		
Phosphorus	ppm	ASTM D5185m	270	269		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m	8600	7566		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	<1		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.64	0.68		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual	/U.L	NEG		
-16:20) Rov: 1	Scalai	visual			ion: TONY VAL	LEDY CEALA



# **OIL ANALYSIS REPORT**

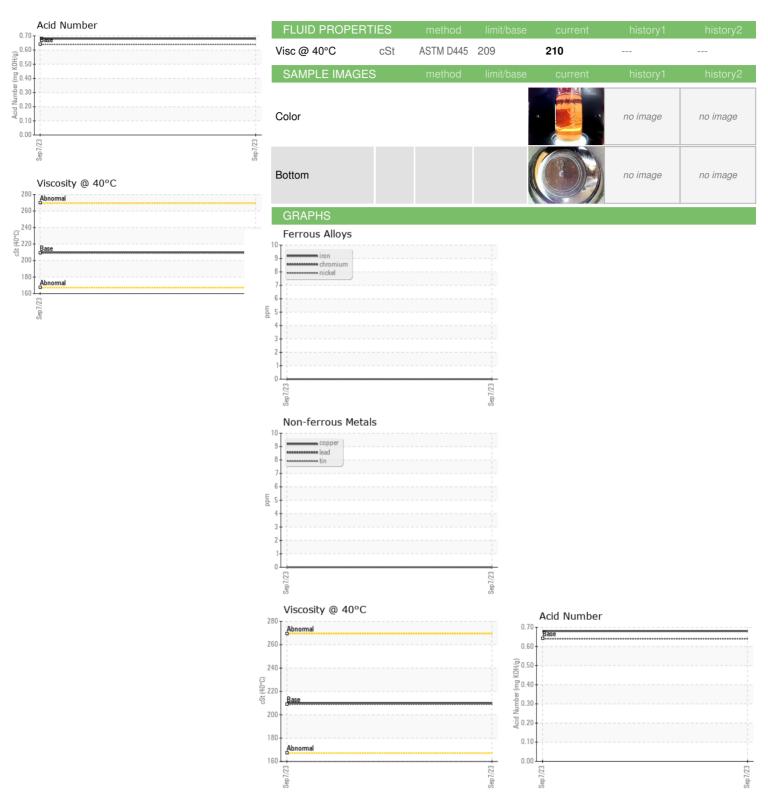





Certificate L2367

Laboratory Sample No. Lab Number

: WC0825786 : 05964752 Unique Number : 10671303 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 29 Sep 2023 : 02 Oct 2023 Diagnosed

Diagnostician : Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**SEATRAX INC** 

308 GALBERT ROAD LAFAYETTE, LA US 70506

Contact: TONY VALLERY

tvallery@seatrax.com T: (337)706-7900

F: (337)706-7901 Contact/Location: TONY VALLERY - SEALAF