


OIL ANALYSIS REPORT

CHEATHAM ANNEX 1AHW CRANE 1A

Component Gearbox

SHELL OMALA S4 WE 220 (--- GAL)

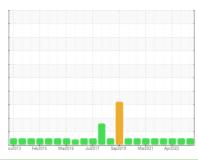

Sample Rating Trend



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		ov2013 Feb	52015 Mar2016 Jul2	017 Sep2019 Mar2021	Apr2022	
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0752684	WC0752674	WC0513641
Sample Date		Client Info		01 Oct 2023	22 Jan 2023	24 Apr 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	1	<1	4
Chromium	ppm	ASTM D5185m	>15	0	<1	<1
Nickel	ppm	ASTM D5185m	>15	<1	2	2
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		<1	<1	0
Aluminum	ppm	ASTM D5185m	>25	1	<1	2
Lead	ppm	ASTM D5185m	>100	0	0	0
Copper	ppm	ASTM D5185m	>200	0	0	0
Tin	ppm	ASTM D5185m	>25	1	<1	<1
Antimony	ppm	ASTM D5185m				
Vanadium	ppm	ASTM D5185m		0	<1	<1
Cadmium	ppm	ASTM D5185m		0	0	<1
ADDITIVES	ppiii		lippit/le e	-		
		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		<1	0	2
Barium	ppm	ASTM D5185m		0	<1	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m		5	<1	0
Calcium	ppm	ASTM D5185m		3	<1	1
Phosphorus	ppm	ASTM D5185m		439	352	424
Zinc	ppm	ASTM D5185m		0	<1	0
Sulfur	ppm	ASTM D5185m		127	101	60
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	4	2	7
Sodium	ppm	ASTM D5185m		0	2	<1
Potassium	ppm	ASTM D5185m	>20	3	<1	2
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.43	0.42	0.48
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
					0.1	


NEG SNUE Gitted By: TARMO MAGI




OIL ANALYSIS REPORT

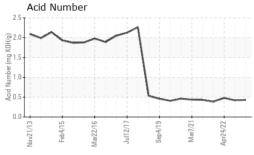





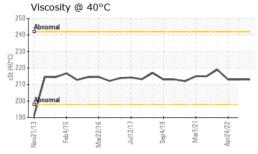

GRAPHS Ferrous Alloys

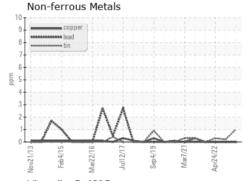

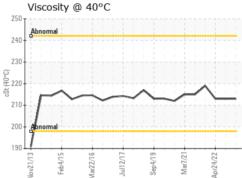

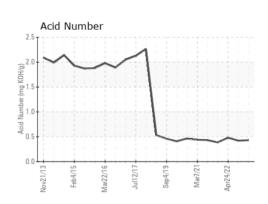





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC0752684 : 05965479 : 10672030

Received : 29 Sep 2023 : 02 Oct 2023 Diagnosed Diagnostician : Don Baldridge **CARGOTEC MARINE - MACGREGOR**

525 BYRON ST, SUITE B CHESAPEAKE, VA US 23320

Contact: TARMO MAGI

tarmo.magi@macgregor.com

T: (757)558-4584 F: (757)558-4581

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: CARPORMAC [WUSCAR] 05965479 (Generated: 10/02/2023 18:01:14) Rev: 1