


OIL ANALYSIS REPORT

CHEATHAM ANNEX 1A 1ALL CRANE 1A (S/N 62510224)

Component Gearbox

MOBIL MOBILGEAR 600 XP 220 (--- GAL)

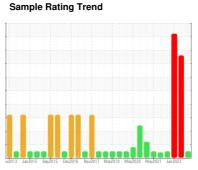



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


		w2013 Jan201		2017 Mar2019 May2020 May2021		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0752652	WC0752688	WC0752676
Sample Date		Client Info		01 Oct 2023	22 Apr 2023	22 Jan 2023
Machine Age	mths	Client Info		0	0	0
Oil Age	mths	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	SEVERE	SEVERE
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	3	22	15
Chromium	ppm	ASTM D5185m	>15	0	0	<1
Nickel	ppm	ASTM D5185m	>15	0	0	<1
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	<1
Aluminum	ppm	ASTM D5185m	>25	1	<1	<1
Lead	ppm	ASTM D5185m	>100	0	0	0
Copper	ppm	ASTM D5185m	>200	0	<1	<1
Tin	ppm	ASTM D5185m	>25	0	0	<1
Vanadium	ppm	ASTM D5185m		0	0	<1
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		5	0	<1
Barium	ppm	ASTM D5185m		0	0	3
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m		3	20	<1
Calcium	ppm	ASTM D5185m		3	2	3
Phosphorus	ppm	ASTM D5185m		342	281	241
Zinc	ppm	ASTM D5185m		19	76	65
Sulfur	ppm	ASTM D5185m		15314	20189	12340
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	<1	1	2
Sodium	ppm	ASTM D5185m		<1	<1	<1
Potassium	ppm	ASTM D5185m	>20	1	0	<1
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.70	0.51	0.39
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	MODER
Debris	scalar	*Visual	NONE	NONE	▲ MODER	▲ MODER
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	▲ HAZY	▲ HAZY
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	△ 0.2%	0.2%
Free Water	scalar	*Visual		NEG	1.0	1.0
10.00.40\ D4					O. J	TARIAG MAGI




OIL ANALYSIS REPORT

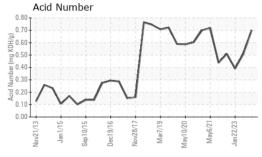





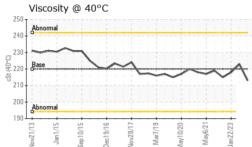


GRAPHS

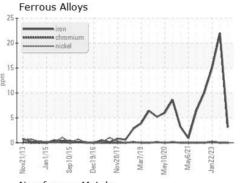

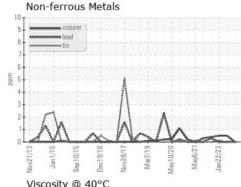

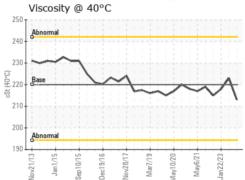

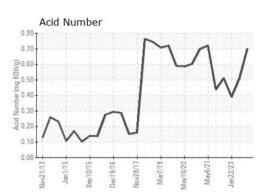





Certificate L2367

Laboratory Sample No. Lab Number Unique Number Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC0752652 : 05965482 : 10672033

Received Diagnosed

: 29 Sep 2023 : 02 Oct 2023 Diagnostician : Don Baldridge **CARGOTEC MARINE - MACGREGOR** 525 BYRON ST, SUITE B

CHESAPEAKE, VA US 23320

Contact: TARMO MAGI tarmo.magi@macgregor.com

T: (757)558-4584 F: (757)558-4581

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)