



PROBLEM SUMMARY

Sample Rating Trend



FUEL



Machine Id
2007 PETERBILT 9628H
Component
Diesel Engine
Fluid
NOT GIVEN (--- GAL)



COMPONENT CONDITION SUMMARY

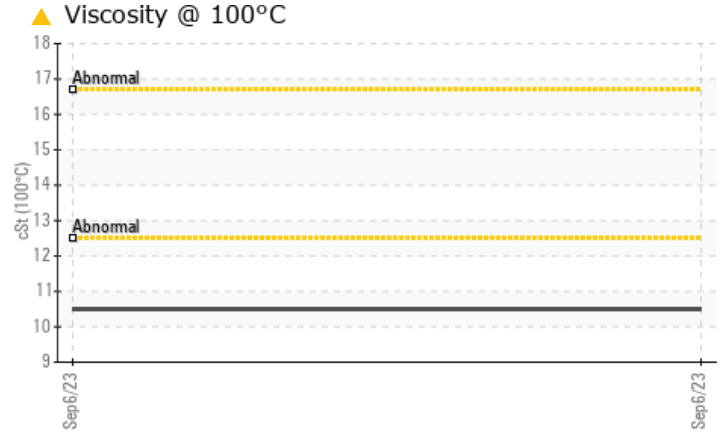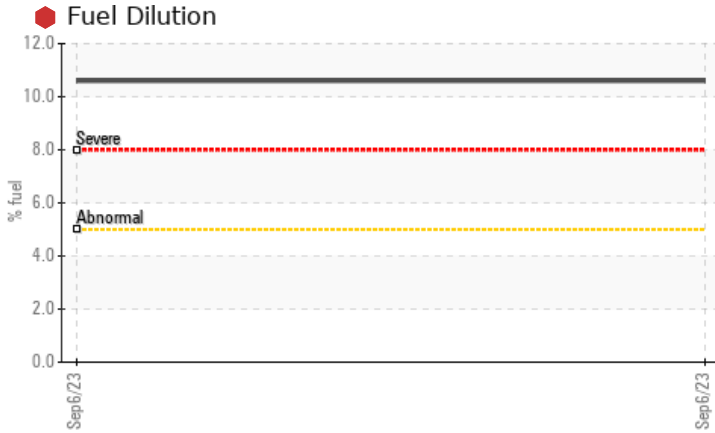

RECOMMENDATION

We advise that you check the fuel injection system. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition. Please specify the brand, type, and viscosity of the oil on your next sample.

PROBLEMATIC TEST RESULTS

Sample Status				SEVERE	---	---
Fuel	%	ASTM D3524	>5	10.6	---	---
Visc @ 100°C	cSt	ASTM D445		10.5	---	---

Customer Id: RUIRUI
Sample No.: KL0011648
Lab Number: 05966132
Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data:
Wes Davis +1 905-569-8600 x223
wesd@wearcheck.ca

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS


Action	Status	Date	Done By	Description
Change Fluid	---	---	?	We recommend that you drain the oil from the component if this has not already been done.
Resample	---	---	?	We recommend an early resample to monitor this condition.
Information Required	---	---	?	Please specify the brand, type, and viscosity of the oil on your next sample.
Check Fuel/injector System	---	---	?	We advise that you check the fuel injection system.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

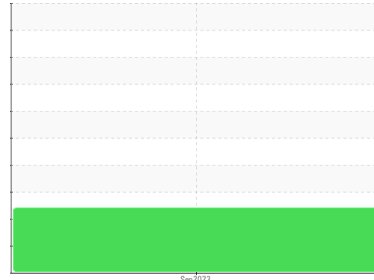

FUEL

Machine Id
2007 PETERBILT 9628H
 Component
Diesel Engine
 Fluid
NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

We advise that you check the fuel injection system. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

Metal levels are typical for a new component breaking in.

Contamination

There is a high amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		KL0011648	---	---
Sample Date	Client Info		06 Sep 2023	---	---
Machine Age	mls	Client Info	12733	---	---
Oil Age	mls	Client Info	0	---	---
Oil Changed	Client Info		N/A	---	---
Sample Status			SEVERE	---	---

CONTAMINATION

	method	limit/base	current	history1	history2
Glycol	WC Method		NEG	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >110	8	---	---
Chromium	ppm	ASTM D5185m >4	<1	---	---
Nickel	ppm	ASTM D5185m >2	0	---	---
Titanium	ppm	ASTM D5185m	0	---	---
Silver	ppm	ASTM D5185m >2	0	---	---
Aluminum	ppm	ASTM D5185m >25	2	---	---
Lead	ppm	ASTM D5185m >45	2	---	---
Copper	ppm	ASTM D5185m >85	7	---	---
Tin	ppm	ASTM D5185m >4	1	---	---
Vanadium	ppm	ASTM D5185m	0	---	---
Cadmium	ppm	ASTM D5185m	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	10	---	---
Barium	ppm	ASTM D5185m	0	---	---
Molybdenum	ppm	ASTM D5185m	73	---	---
Manganese	ppm	ASTM D5185m	1	---	---
Magnesium	ppm	ASTM D5185m	1039	---	---
Calcium	ppm	ASTM D5185m	1155	---	---
Phosphorus	ppm	ASTM D5185m	1147	---	---
Zinc	ppm	ASTM D5185m	1373	---	---
Sulfur	ppm	ASTM D5185m	3456	---	---

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >30	6	---	---
Sodium	ppm	ASTM D5185m	4	---	---
Potassium	ppm	ASTM D5185m >20	4	---	---
Fuel	%	ASTM D3524 >5	10.6	---	---

INFRA-RED




	method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844 >3	0.2	---	---
Nitration	Abs/cm	*ASTM D7624 >20	6.8	---	---
Sulfation	Abs/.1mm	*ASTM D7415 >30	20.3	---	---

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414 >25	18.7	---	---
Base Number (BN)	mg KOH/g	ASTM D2896	8.2	---	---







OIL ANALYSIS REPORT

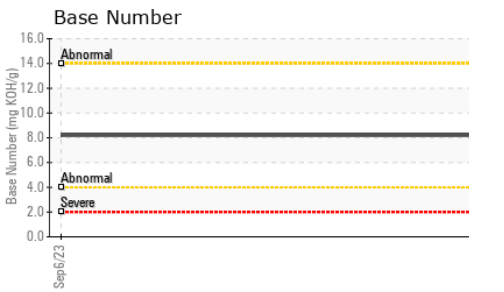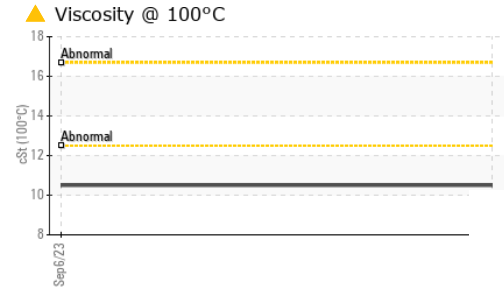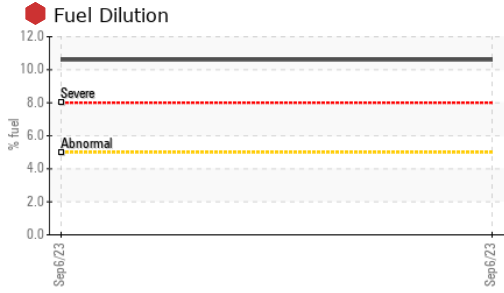

VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---
Precipitate	scalar	*Visual	NONE	NONE	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---
Free Water	scalar	*Visual		NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	▲ 10.5	---	---

GRAPHS

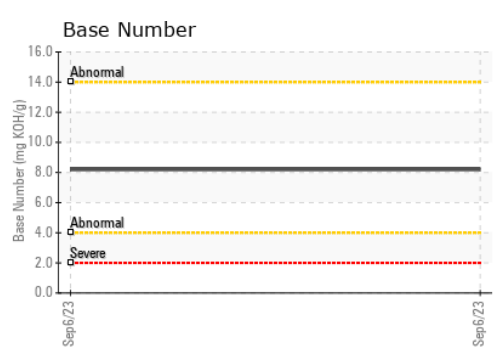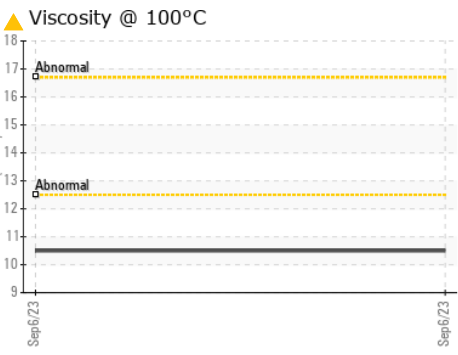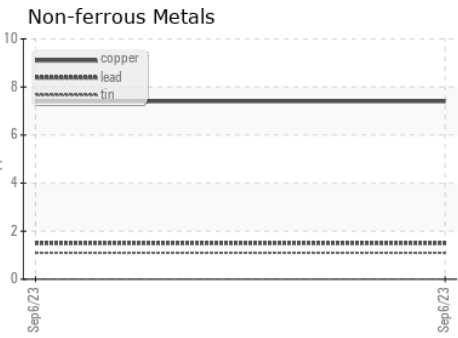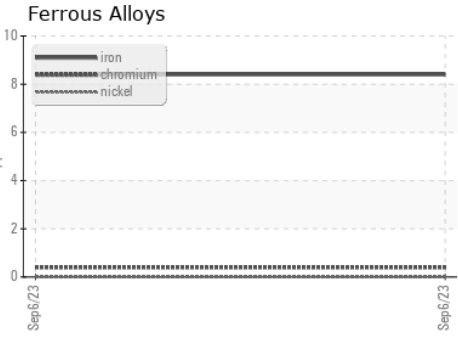

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : KL0011648 **Received** : 02 Oct 2023
Lab Number : 05966132 **Diagnosed** : 04 Oct 2023
Unique Number : 10672683 **Diagnostician** : Wes Davis
Test Package : FLEET (Additional Tests: FuelDilution, PercentFuel)

VILLAGE OF RUIDOSO
 313 CREE MEADOWS DR
 RUIDOSO, NM
 US 88355
 Contact: JERRY PARSONS
 jerryparsons@ruidoso-nm.gov
 T: (575)257-1702
 F: x:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)