




PROBLEM SUMMARY


Sample Rating Trend

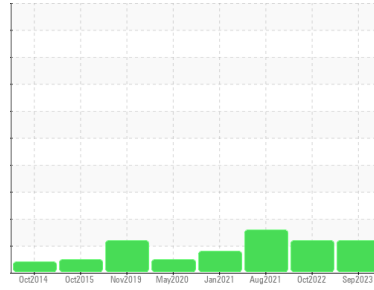

Machine Id
KAESER ASD 30 4741663 (S/N 1270)
 Component
Compressor
 Fluid
KAESER SIGMA (OEM) S-460 (--- GAL)

COMPONENT CONDITION SUMMARY

▲ Particle Trend

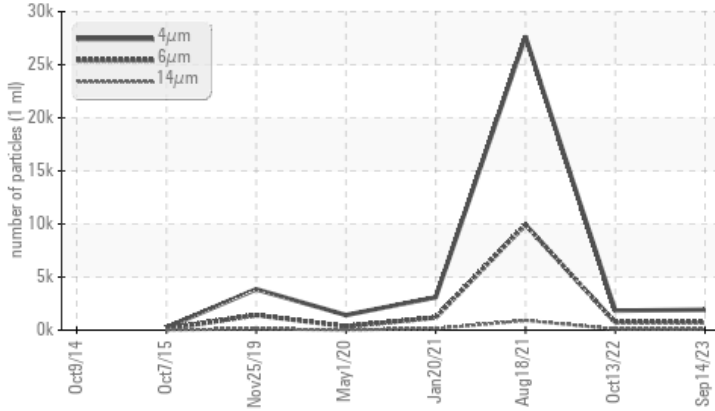

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status			ATTENTION	ATTENTION	ABNORMAL
Particles >14µm	ASTM D7647	>80	▲ 85	▲ 105	▲ 909
Particles >21µm	ASTM D7647	>20	▲ 25	▲ 30	▲ 212
Oil Cleanliness	ISO 4406 (c)	>--/17/13	▲ 18/17/14	▲ 18/17/14	▲ 20/17

Customer Id: AVIPAR
 Sample No.: KC05966352
 Lab Number: 05966352
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

13 Oct 2022 Diag: Jonathan Hester

ISO



No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



18 Aug 2021 Diag: Don Baldrige

ISO



No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



20 Jan 2021 Diag: Jonathan Hester

ISO




No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



Machine Id
KAESER ASD 30 4741663 (S/N 1270)

Component
Compressor
Fluid
KAESER SIGMA (OEM) S-460 (--- GAL)

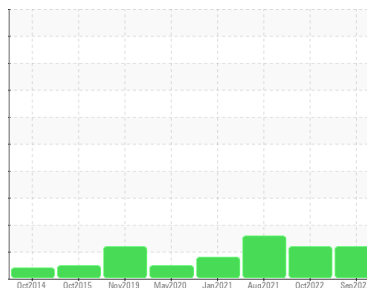

DIAGNOSIS

▲ Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

▲ Contamination

There is a moderate amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			KC05966352	KC106000	KC92289
Sample Date	Client Info			14 Sep 2023	13 Oct 2022	18 Aug 2021
Machine Age	hrs	Client Info		16846	14927	12846
Oil Age	hrs	Client Info		0	3054	973
Oil Changed	Client Info			N/A	Changed	Not Changed
Sample Status				ATTENTION	ATTENTION	ABNORMAL

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1	0	<1
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m	>3	0	0	0
Titanium	ppm	ASTM D5185m	>3	0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>10	0	<1	0
Lead	ppm	ASTM D5185m	>10	0	0	<1
Copper	ppm	ASTM D5185m	>50	2	3	1
Tin	ppm	ASTM D5185m	>10	0	0	0
Antimony	ppm	ASTM D5185m		---	---	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0






ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	<1
Barium	ppm	ASTM D5185m	90	2	0	2
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	<1
Magnesium	ppm	ASTM D5185m	90	63	49	73
Calcium	ppm	ASTM D5185m	2	0	0	1
Phosphorus	ppm	ASTM D5185m		4	4	9
Zinc	ppm	ASTM D5185m		29	45	0

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1	<1	<1
Sodium	ppm	ASTM D5185m		18	17	16
Potassium	ppm	ASTM D5185m	>20	6	3	4
Water	%	ASTM D6304	>0.05	0.027	0.019	0.026
ppm Water	ppm	ASTM D6304	>500	271.1	194.9	265.8

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		1915	1836	27650
Particles >6µm		ASTM D7647	>1300	717	722	▲ 9929
Particles >14µm		ASTM D7647	>80	▲ 85	▲ 105	▲ 909
Particles >21µm		ASTM D7647	>20	▲ 25	▲ 30	▲ 212
Particles >38µm		ASTM D7647	>4	1	3	▲ 7
Particles >71µm		ASTM D7647	>3	0	0	0
Oil Cleanliness		ISO 4406 (c)	>--/17/13	▲ 18/17/14	▲ 18/17/14	▲ 20/17

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.36	0.37	0.310

OIL ANALYSIS REPORT

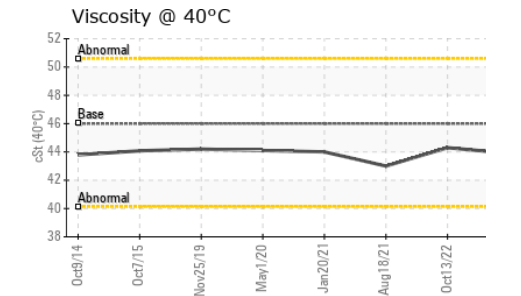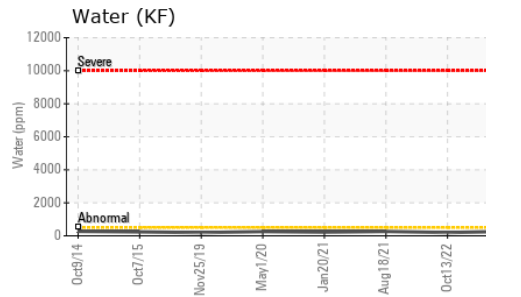
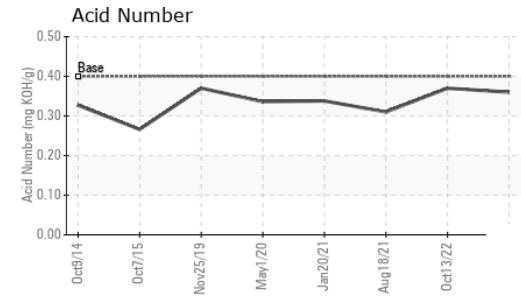
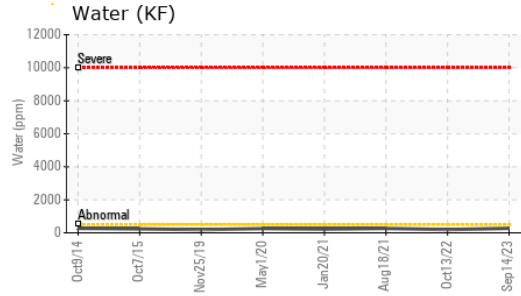
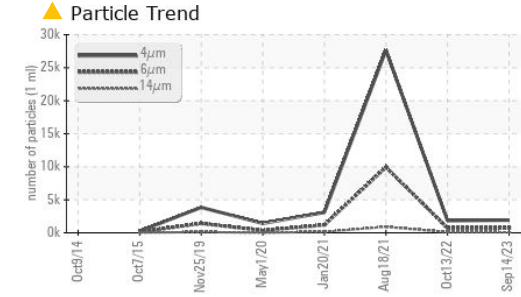


VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 46	43.9	44.3	43.0

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					
Bottom					

GRAPHS

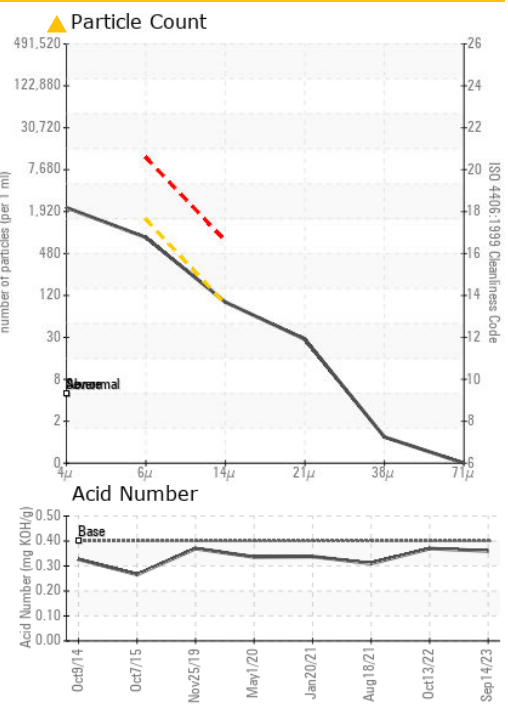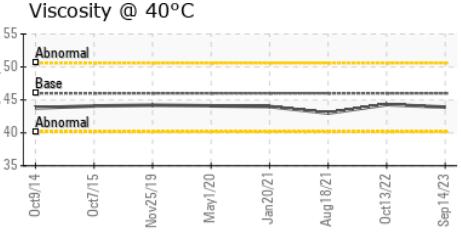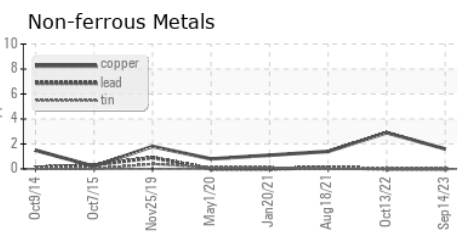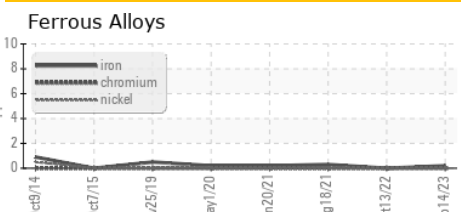

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : KC05966352
Lab Number : 05966352
Unique Number : 10672903
Test Package : IND 2

AVIALL - BOEING DISTRIBUTION INC
 2 CRANBERRY RD
 PARSIPPANY, NJ
 US 07054
 Contact: SERVICE MANAGER

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: