





# PROBLEM SUMMARY

Sample Rating Trend

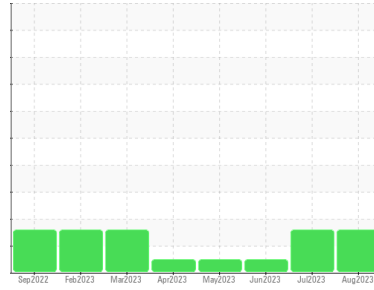

Machine Id  
**COMP 201 (S/N 3022)**  
 Component  
**Compressor**  
 Fluid  
**CPI ENG. 6005-32 (--- GAL)**

## COMPONENT CONDITION SUMMARY

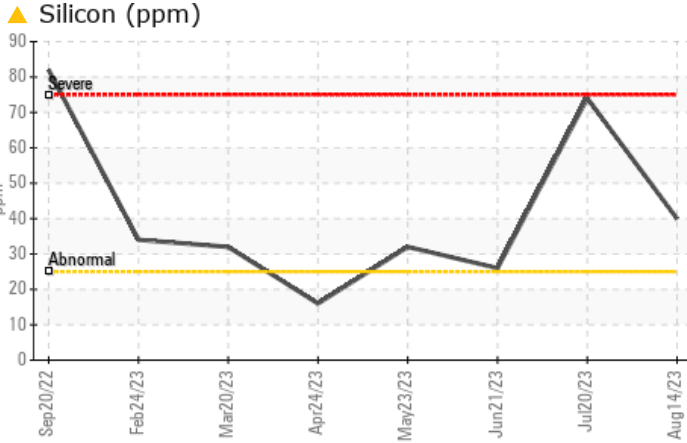

## RECOMMENDATION

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

## PROBLEMATIC TEST RESULTS

Sample Status				<b>ABNORMAL</b>	ABNORMAL	NORMAL
Silicon	ppm	ASTM D5185m	>25	▲ 40	▲ 74	26

Customer Id: KININDIN  
 Sample No.: WC0803958  
 Lab Number: 05966401  
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:  
 Don Baldrige +1  
[don.b505@comcast.net](mailto:don.b505@comcast.net)

To change component or sample information:  
 Customer Service +1 1-800-237-1369  
[customerservice@wearcheck.com](mailto:customerservice@wearcheck.com)

## RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Fluid	---	---	?	Oil and filter change at the time of sampling has been noted.
Change Filter	---	---	?	Oil and filter change at the time of sampling has been noted.

## HISTORICAL DIAGNOSIS

### 20 Jul 2023 Diag: Don Baldrige

DIRT



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. Elemental level of silicon (Si) above normal. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

[view report](#)



### 21 Jun 2023 Diag: Doug Bogart

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

[view report](#)



### 23 May 2023 Diag: Doug Bogart

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


[view report](#)





# OIL ANALYSIS REPORT

Sample Rating Trend

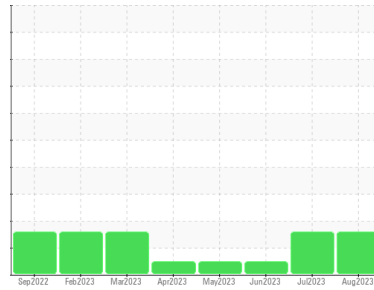

**DIRT**



Machine Id  
**COMP 201 (S/N 3022)**

Component  
**Compressor**  
Fluid  
**CPI ENG. 6005-32 (--- GAL)**

## DIAGNOSIS

### ▲ Recommendation

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### ▲ Contamination

Elemental level of silicon (Si) above normal. The amount and size of particulates present in the system are acceptable.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>WC0803958</b>	WC0803950	WC0803942
Sample Date	Client Info		<b>14 Aug 2023</b>	20 Jul 2023	21 Jun 2023
Machine Age	hrs	Client Info	<b>27969</b>	27440	26723
Oil Age	hrs	Client Info	<b>10600</b>	9695	8928
Oil Changed	Client Info		<b>Changed</b>	N/A	Changed
Sample Status			<b>ABNORMAL</b>	ABNORMAL	NORMAL

## WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185m	>50	<b>0</b>	0	0
Chromium	ppm	ASTM D5185m	>10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185m		<b>0</b>	0	<1
Titanium	ppm	ASTM D5185m		<b>0</b>	0	0
Silver	ppm	ASTM D5185m		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>25	<b>&lt;1</b>	<1	0
Lead	ppm	ASTM D5185m	>25	<b>0</b>	0	0
Copper	ppm	ASTM D5185m	>50	<b>0</b>	0	0
Tin	ppm	ASTM D5185m	>15	<b>0</b>	<1	<1
Vanadium	ppm	ASTM D5185m		<b>0</b>	<1	0
Cadmium	ppm	ASTM D5185m		<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185m		<b>0</b>	0	0
Barium	ppm	ASTM D5185m		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m		<b>0</b>	0	0
Manganese	ppm	ASTM D5185m		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185m		<b>0</b>	0	0
Calcium	ppm	ASTM D5185m		<b>0</b>	0	0
Phosphorus	ppm	ASTM D5185m		<b>2</b>	0	0
Zinc	ppm	ASTM D5185m		<b>0</b>	0	0
Sulfur	ppm	ASTM D5185m		<b>103</b>	192	62

## CONTAMINANTS

	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185m	>25	<b>▲ 40</b>	▲ 74	26
Sodium	ppm	ASTM D5185m		<b>0</b>	<1	0
Potassium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	0	<1
Water	%	ASTM D6304	>0.1	<b>0.002</b>	---	0.002
ppm Water	ppm	ASTM D6304	>1000	<b>20.7</b>	---	23.7

## FLUID CLEANLINESS






	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>10000	<b>3910</b>	3446	3546
Particles >6µm	ASTM D7647	>2500	<b>1147</b>	1084	950
Particles >14µm	ASTM D7647	>320	<b>56</b>	91	51
Particles >21µm	ASTM D7647	>80	<b>10</b>	23	9
Particles >38µm	ASTM D7647	>20	<b>1</b>	1	1
Particles >71µm	ASTM D7647	>4	<b>0</b>	0	0
Oil Cleanliness	ISO 4406 (c)	>20/18/15	<b>19/17/13</b>	19/17/14	19/17/13

## FLUID DEGRADATION

	method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D8045		<b>0.061</b>	0.34	0.108




# OIL ANALYSIS REPORT

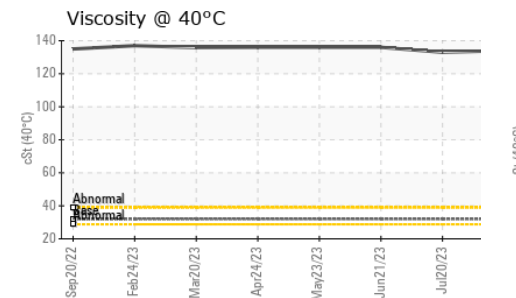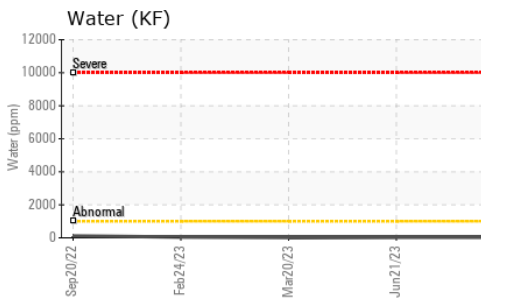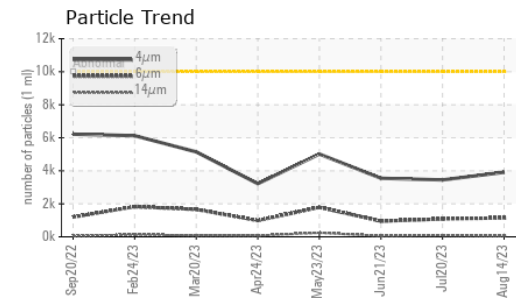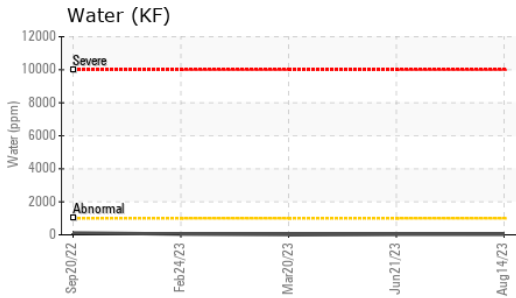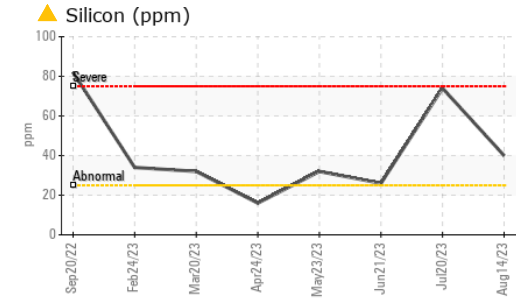






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	32	134	133

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

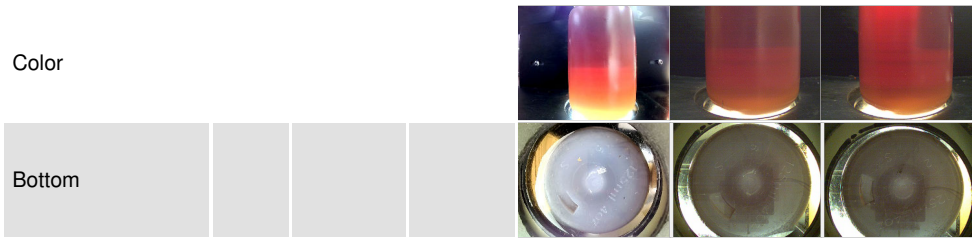

## GRAPHS

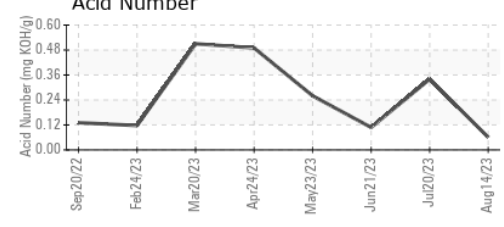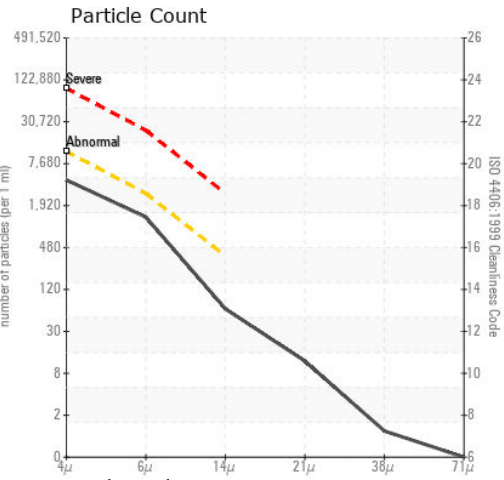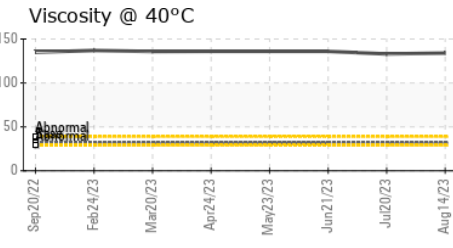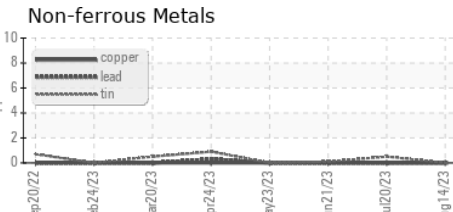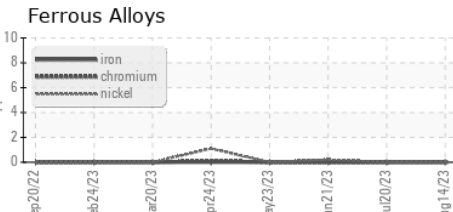

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : WC0803958  
**Lab Number** : 05966401  
**Unique Number** : 10672952  
**Test Package** : IND 2 ( Additional Tests: KF, PrtCount )

**EDL NA Recips-Indy High BTU RNG Plant**  
 2319 KENTUCKY AVE  
 INDIANAPOLIS, IN  
 US 46221  
 Contact: William Prestin  
 william.prestin@edlenergy.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
F: