


# **OIL ANALYSIS REPORT**

# Area SULLUBE 32

201208170059 - FOX VALLEY WOOD

Component

Compressor

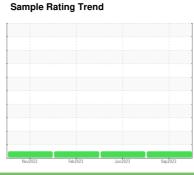



### DIAGNOSIS

## Recommendation

Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the oil


# **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Nev2022 Feb2023 Jun2023 Sep2023				
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCZ05968374	UCZ05882166	UCZ05789839
Sample Date		Client Info		22 Sep 2023	09 Jun 2023	24 Feb 2023
Machine Age	hrs	Client Info		33720	32929	32172
Oil Age	hrs	Client Info		4760	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	3	1	<1
Chromium	ppm	ASTM D5185m	>5	<1	0	0
Nickel	ppm	ASTM D5185m		<1	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	<1
Aluminum	ppm	ASTM D5185m	>15	<1	0	<1
Lead	ppm	ASTM D5185m	>65	<1	0	0
Copper	ppm	ASTM D5185m	>65	<1	<1	<1
Tin	ppm	ASTM D5185m	>10	<1	0	<1
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		<1	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m	745	609	611	565
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m		1	<1	2
Calcium	ppm	ASTM D5185m	1	1	<1	2
Phosphorus	ppm	ASTM D5185m	3	11	7	9
Zinc	ppm	ASTM D5185m		<1	<1	3
Sulfur	ppm	ASTM D5185m		488	401	459
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	4	5	2
Sodium	ppm	ASTM D5185m		37	34	39
Potassium	ppm	ASTM D5185m	>20	3	3	3
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.06	0.238	0.20	0.18
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG



# **OIL ANALYSIS REPORT**

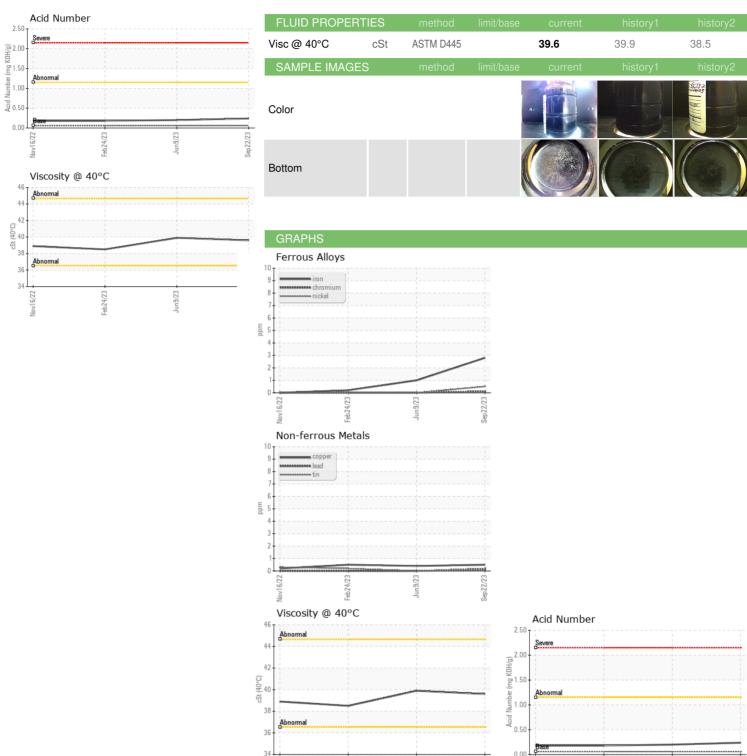





Certificate L2367

Laboratory Sample No. Lab Number

: 05968374 Unique Number : 10674925 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCZ05968374 Received : 03 Oct 2023

Diagnosed : 04 Oct 2023 Diagnostician : Doug Bogart

**ZORN COMP & EQUIPMENT CO (GB)** 

Contact/Location: DEAN SCHAD - UCZORGRE

733 POTTS AVE GREEN BAY, WI US 54304 Contact: DEAN SCHAD

dean.schad@zornair.com

T: (920)391-8121 F: (920)499-1168

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)