





PROBLEM SUMMARY

Sample Rating Trend



Area
TULSA [19097]
 Machine Id
40-238
 Component
Left Final Drive
 Fluid
CONOCO PHILLIPS GUARDOL ECT 15W40 (--- GAL)

COMPONENT CONDITION SUMMARY

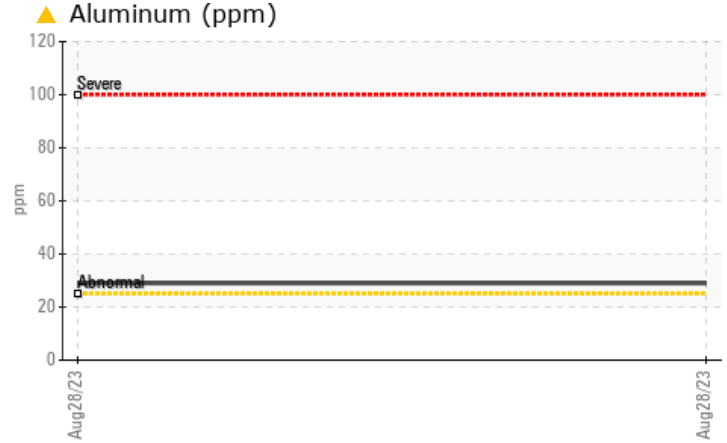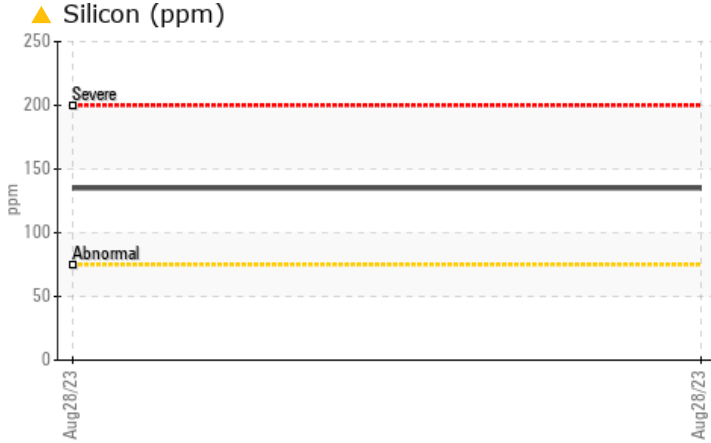

RECOMMENDATION

We advise that you check all areas where dirt can enter the system. The oil change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status	ABNORMAL		---	---		
Aluminum	ppm	ASTM D5185m	>25	▲ 29	---	---
Silicon	ppm	ASTM D5185m	>75	▲ 135	---	---

Customer Id: MANTUL
 Sample No.: WC0818619
 Lab Number: 05968472
 Test Package: CONST



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Doug Bogart +1 (800)237-1369 x4016
dougb@wearcheckusa.com

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS


Action	Status	Date	Done By	Description
Check Dirt Access	---	---	?	We advise that you check all areas where dirt can enter the system.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

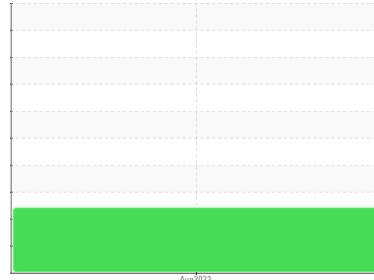

Area
TULSA [19097]
 Machine Id
40-238
 Component
Left Final Drive
 Fluid
CONOCO PHILLIPS GUARDOL ECT 15W40 (--- GAL)

DIAGNOSIS

Recommendation
 We advise that you check all areas where dirt can enter the system. The oil change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear
 All component wear rates are normal.

Contamination
 Elemental levels of silicon (Si) and aluminum (Al) indicate alumina-silicate (coarse dirt) ingress.

Fluid Condition
 The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	WC0818619	---	---
Sample Date	Client Info	28 Aug 2023	---	---
Machine Age	hrs Client Info	3145	---	---
Oil Age	hrs Client Info	3145	---	---
Oil Changed	Client Info	Changed	---	---
Sample Status		ABNORMAL	---	---

WEAR METALS

method	limit/base	current	history1	history2
Iron ppm ASTM D5185m	>500	206	---	---
Chromium ppm ASTM D5185m	>10	6	---	---
Nickel ppm ASTM D5185m	>10	1	---	---
Titanium ppm ASTM D5185m		2	---	---
Silver ppm ASTM D5185m		0	---	---
Aluminum ppm ASTM D5185m	>25	▲ 29	---	---
Lead ppm ASTM D5185m	>25	<1	---	---
Copper ppm ASTM D5185m	>50	9	---	---
Tin ppm ASTM D5185m	>10	0	---	---
Vanadium ppm ASTM D5185m		<1	---	---
Cadmium ppm ASTM D5185m		0	---	---

ADDITIVES

method	limit/base	current	history1	history2
Boron ppm ASTM D5185m	85	6	---	---
Barium ppm ASTM D5185m		0	---	---
Molybdenum ppm ASTM D5185m		4	---	---
Manganese ppm ASTM D5185m		3	---	---
Magnesium ppm ASTM D5185m	350	24	---	---
Calcium ppm ASTM D5185m	1800	4185	---	---
Phosphorus ppm ASTM D5185m	1000	924	---	---
Zinc ppm ASTM D5185m	1100	1121	---	---
Sulfur ppm ASTM D5185m	3500	6767	---	---

CONTAMINANTS

method	limit/base	current	history1	history2
Silicon ppm ASTM D5185m	>75	▲ 135	---	---
Sodium ppm ASTM D5185m		0	---	---
Potassium ppm ASTM D5185m	>20	4	---	---

VISUAL




method	limit/base	current	history1	history2
White Metal scalar *Visual	NONE	NONE	---	---
Yellow Metal scalar *Visual	NONE	NONE	---	---
Precipitate scalar *Visual	NONE	NONE	---	---
Silt scalar *Visual	NONE	LIGHT	---	---
Debris scalar *Visual	NONE	NONE	---	---
Sand/Dirt scalar *Visual	NONE	NONE	---	---
Appearance scalar *Visual	NORML	NORML	---	---
Odor scalar *Visual	NORML	NORML	---	---
Emulsified Water scalar *Visual	>0.2	NEG	---	---
Free Water scalar *Visual		NEG	---	---

FLUID PROPERTIES

method	limit/base	current	history1	history2
Visc @ 40°C cSt ASTM D445	115	96.1	---	---






OIL ANALYSIS REPORT

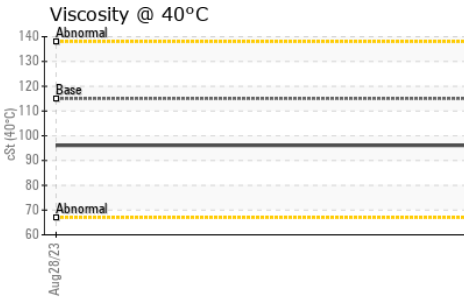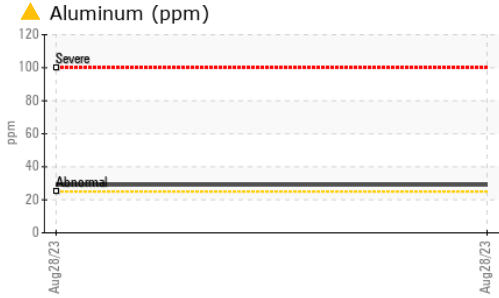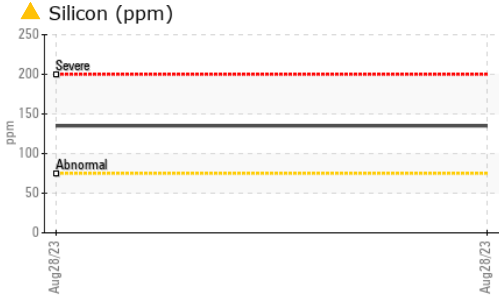

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

GRAPHS

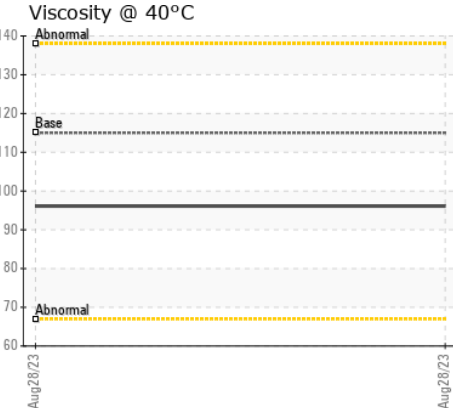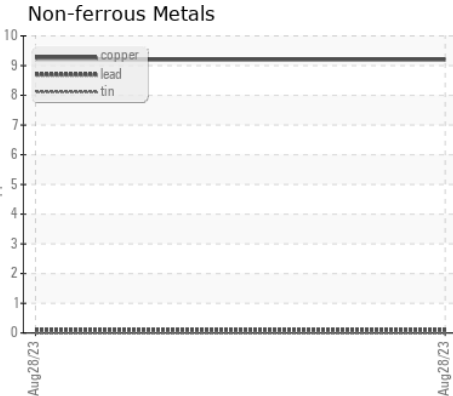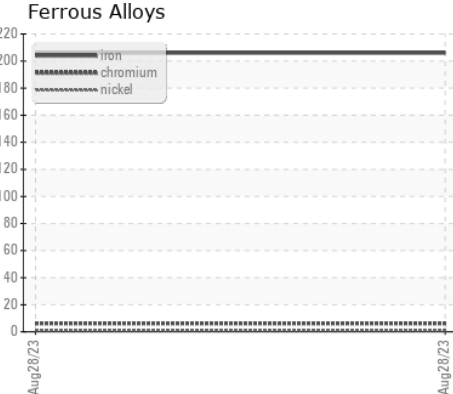

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0818619 **Received** : 03 Oct 2023
Lab Number : 05968472 **Diagnosed** : 04 Oct 2023
Unique Number : 10675023 **Diagnostician** : Doug Bogart
Test Package : CONST

MANHATTAN ROAD AND BRIDGE
 5601 S 122ND E AVE
 TULSA, OK
 US 74146
 Contact: JAMES STEELMON
 james.steelmon@manhattanrb.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: