



OIL ANALYSIS REPORT

Sample Rating Trend



DIRT



Machine Id
C0111 - TROLLEY

Component
Gearbox

Fluid
NOT GIVEN (--- GAL)

DIAGNOSIS

▲ Recommendation

We advise that you check all areas where dirt can enter the system. Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

All component wear rates are normal.

▲ Contamination

Elemental level of silicon (Si) above normal indicating ingress of dirt/seal material.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		DC0030966	---	---
Sample Date	Client Info		09 Sep 2023	---	---
Machine Age	hrs	Client Info	0	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		Not Changed	---	---
Sample Status			ABNORMAL	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >200	22	---	---
Chromium	ppm	ASTM D5185m >10	<1	---	---
Nickel	ppm	ASTM D5185m >10	<1	---	---
Titanium	ppm	ASTM D5185m	0	---	---
Silver	ppm	ASTM D5185m	0	---	---
Aluminum	ppm	ASTM D5185m >25	3	---	---
Lead	ppm	ASTM D5185m >50	<1	---	---
Copper	ppm	ASTM D5185m >200	11	---	---
Tin	ppm	ASTM D5185m >10	1	---	---
Vanadium	ppm	ASTM D5185m	0	---	---
Cadmium	ppm	ASTM D5185m	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	3	---	---
Barium	ppm	ASTM D5185m	0	---	---
Molybdenum	ppm	ASTM D5185m	<1	---	---
Manganese	ppm	ASTM D5185m	<1	---	---
Magnesium	ppm	ASTM D5185m	11	---	---
Calcium	ppm	ASTM D5185m	14	---	---
Phosphorus	ppm	ASTM D5185m	629	---	---
Zinc	ppm	ASTM D5185m	45	---	---
Sulfur	ppm	ASTM D5185m	925	---	---

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >50	▲ 51	---	---
Sodium	ppm	ASTM D5185m	9	---	---
Potassium	ppm	ASTM D5185m >20	<1	---	---

VISUAL


	method	limit/base	current	history1	history2
White Metal	scalar	*Visual NONE	NONE	---	---
Yellow Metal	scalar	*Visual NONE	NONE	---	---
Precipitate	scalar	*Visual NONE	NONE	---	---
Silt	scalar	*Visual NONE	NONE	---	---
Debris	scalar	*Visual NONE	NONE	---	---
Sand/Dirt	scalar	*Visual NONE	NONE	---	---
Appearance	scalar	*Visual NORML	NORML	---	---
Odor	scalar	*Visual NORML	NORML	---	---
Emulsified Water	scalar	*Visual >0.2	NEG	---	---
Free Water	scalar	*Visual	NEG	---	---

FLUID PROPERTIES


	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	371	---	---











OIL ANALYSIS REPORT

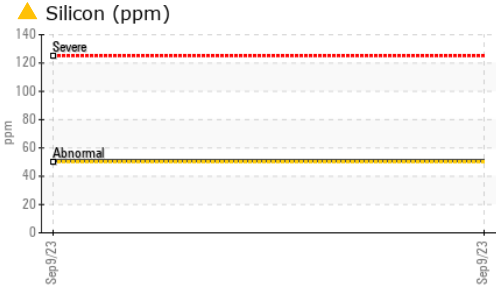

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

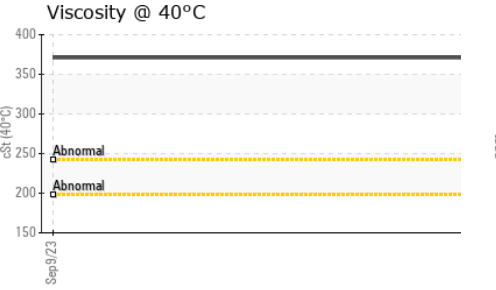

GRAPHS

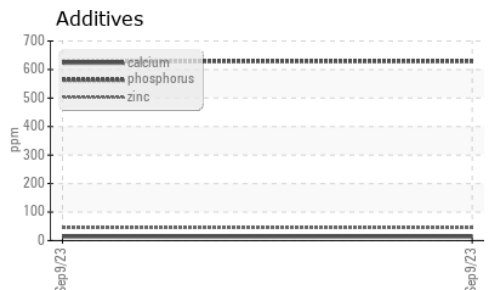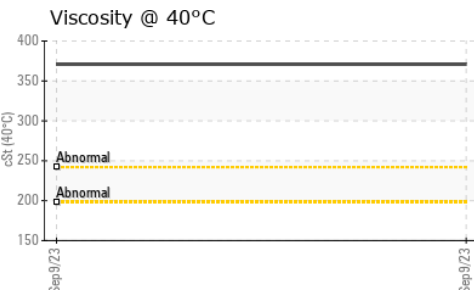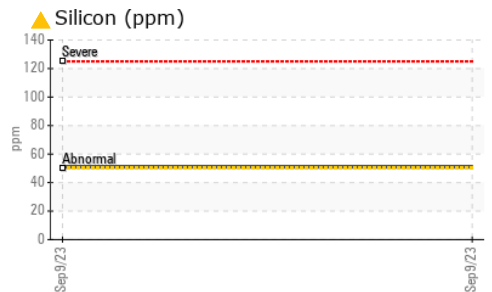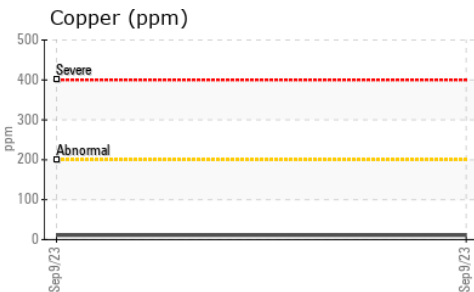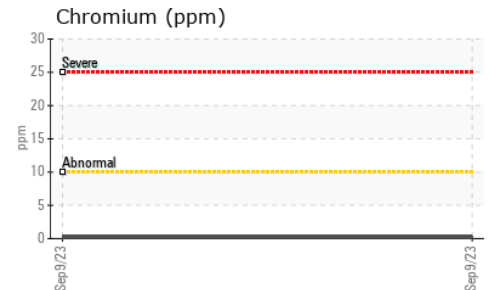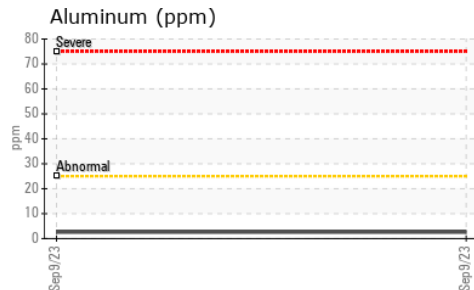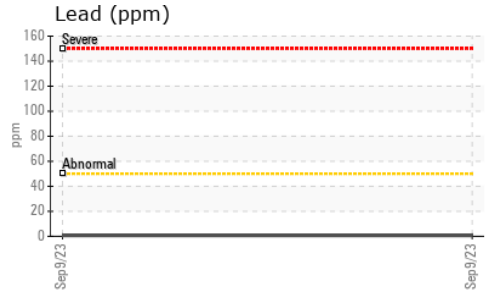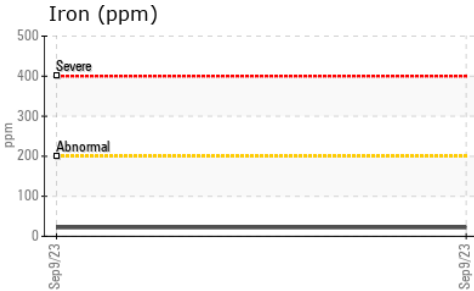

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : DC0030966 **Received** : 03 Oct 2023
Lab Number : 05968485 **Diagnosed** : 04 Oct 2023
Unique Number : 10675036 **Diagnostician** : Doug Bogart
Test Package : MOB 1

CRANWORKS INC - MID-ATLANTIC
 11089 LEADBETTER ROAD
 ASHLAND, VA
 US 23005
 Contact: JASON WILDE
 jcwilde@vacranetworks.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: