

PROBLEM SUMMARY

Sample Rating Trend




ISO



Machine Id
WIRTGEN W210FI 23200362
Component
Hydraulic System
Fluid
AW HYDRAULIC OIL ISO 46 (--- GAL)

COMPONENT CONDITION SUMMARY

▲ Particle Trend

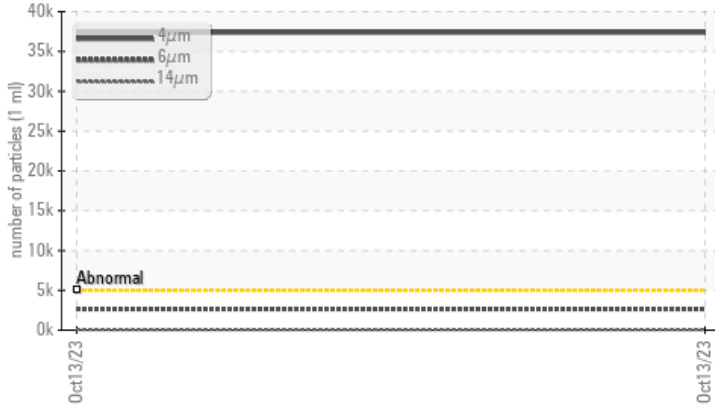

RECOMMENDATION

We recommend you service the filters on this component. We recommend an early resample to monitor this condition. Please specify the brand, type, and viscosity of the oil on your next sample.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	---	---
Particles >4µm	ASTM D7647	>5000	▲ 37383	---	---
Particles >6µm	ASTM D7647	>1300	▲ 2656	---	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 22/19/13	---	---

Customer Id: JAMASH
Sample No.: JR0179173
Lab Number: 05979522
Test Package: CONST



To manage this report scan the QR code

To discuss the diagnosis or test data:
Wes Davis +1 905-569-8600 x223
wesd@wearcheck.ca

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com


RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Resample	---	---	?	We recommend an early resample to monitor this condition.
Information Required	---	---	?	Please specify the brand, type, and viscosity of the oil on your next sample.

HISTORICAL DIAGNOSIS


 Machine Id
WIRTGEN W210FI 23200362

 Component
Hydraulic System

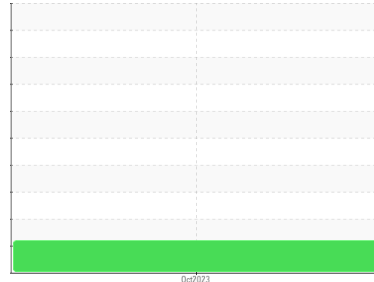 Fluid
AW HYDRAULIC OIL ISO 46 (--- GAL)

DIAGNOSIS
▲ Recommendation

We recommend you service the filters on this component. We recommend an early resample to monitor this condition. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

All component wear rates are normal.

▲ Contamination

There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		JR0179173	---	---
Sample Date	Client Info		13 Oct 2023	---	---
Machine Age	hrs	Client Info	2281	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		Not Changed	---	---
Sample Status			ABNORMAL	---	---

WEAR METALS

	method	limit/base	current	history1	history2
PQ	ASTM D8184		12	---	---
Iron	ppm	ASTM D5185m >20	10	---	---
Chromium	ppm	ASTM D5185m >10	1	---	---
Nickel	ppm	ASTM D5185m >10	0	---	---
Titanium	ppm	ASTM D5185m	<1	---	---
Silver	ppm	ASTM D5185m	0	---	---
Aluminum	ppm	ASTM D5185m >10	<1	---	---
Lead	ppm	ASTM D5185m >10	0	---	---
Copper	ppm	ASTM D5185m >75	3	---	---
Tin	ppm	ASTM D5185m >10	0	---	---
Vanadium	ppm	ASTM D5185m	<1	---	---
Cadmium	ppm	ASTM D5185m	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 5	9	---	---
Barium	ppm	ASTM D5185m 5	0	---	---
Molybdenum	ppm	ASTM D5185m 5	<1	---	---
Manganese	ppm	ASTM D5185m	<1	---	---
Magnesium	ppm	ASTM D5185m 25	27	---	---
Calcium	ppm	ASTM D5185m 200	351	---	---
Phosphorus	ppm	ASTM D5185m 300	351	---	---
Zinc	ppm	ASTM D5185m 370	429	---	---
Sulfur	ppm	ASTM D5185m 2500	1591	---	---

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >20	2	---	---
Sodium	ppm	ASTM D5185m	2	---	---
Potassium	ppm	ASTM D5185m >20	0	---	---






FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	▲ 37383	---	---
Particles >6µm	ASTM D7647	>1300	▲ 2656	---	---
Particles >14µm	ASTM D7647	>160	67	---	---
Particles >21µm	ASTM D7647	>40	16	---	---
Particles >38µm	ASTM D7647	>10	1	---	---
Particles >71µm	ASTM D7647	>3	0	---	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 22/19/13	---	---

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045 0.57	0.36	---	---

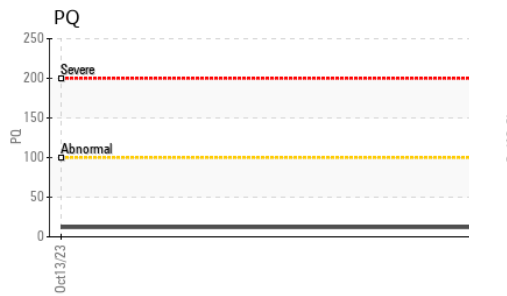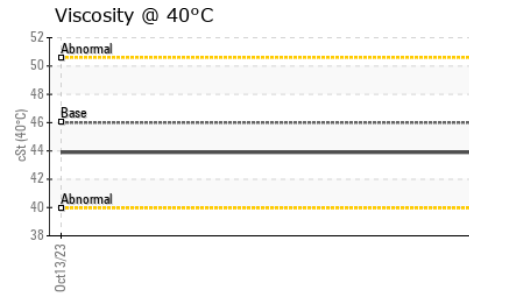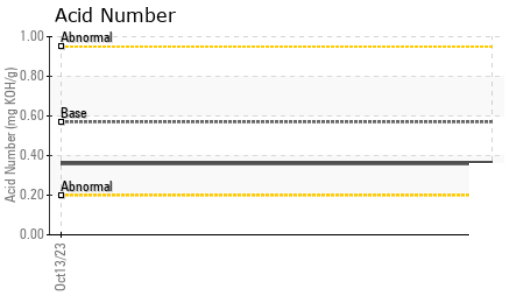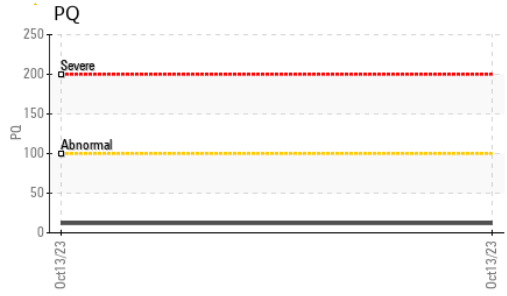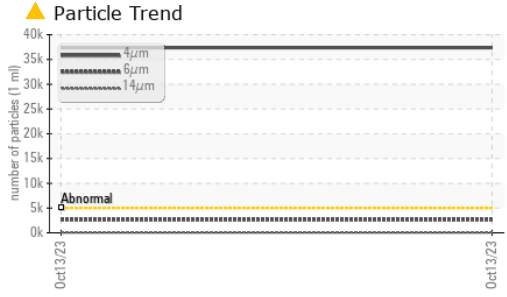

OIL ANALYSIS REPORT







VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.1	NEG	---
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46	43.9	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color		no image	no image
Bottom		no image	no image

GRAPHS

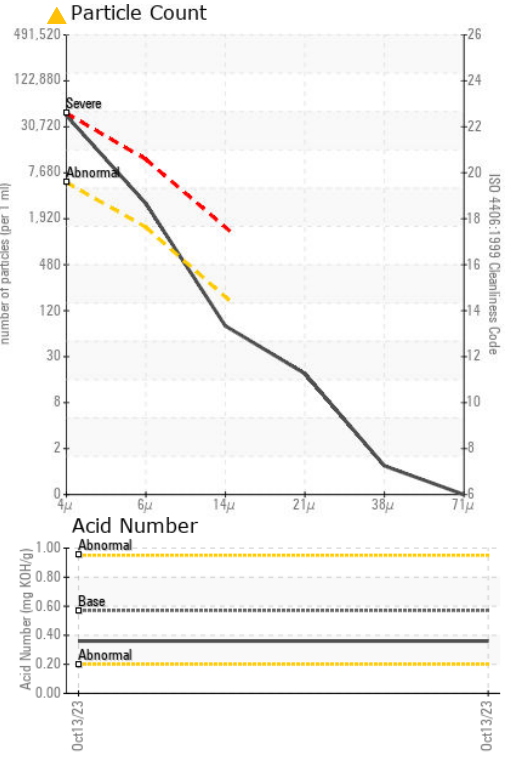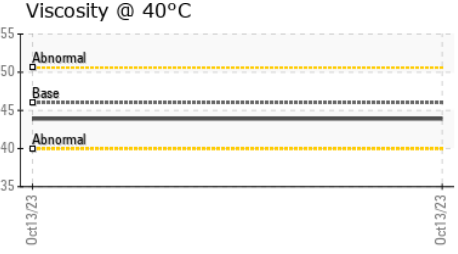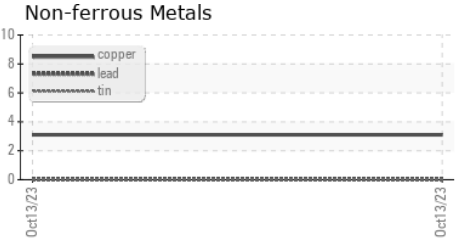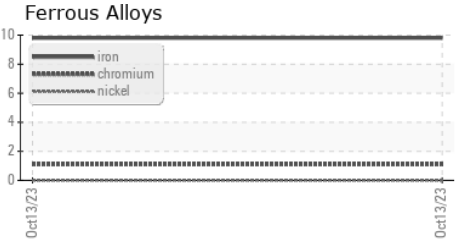

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : JR0179173 **Received** : 16 Oct 2023
Lab Number : 05979522 **Diagnosed** : 17 Oct 2023
Unique Number : 10696817 **Diagnostician** : Wes Davis
Test Package : CONST (Additional Tests: PQ)

JRE - ASHLAND
 11047 LEADBETTER RD
 ASHLAND, VA
 US 23005
 Contact: DAVID ZIEG
 dzieg@jamesriverequipment.com
 T: (804)798-6001
 F: (804)798-0292

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)