

PROBLEM SUMMARY


KEN G CONSTRUCTION Machine Id KAESER SK 26 1079

Component Compressor

ACI 467R (--- GAL)

Sample Rating Trend ISO Judges

COMPONENT CONDITION SUMMARY

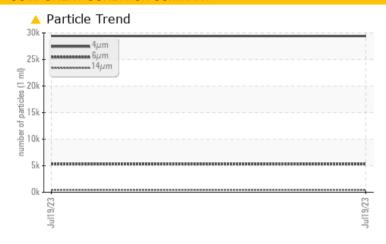

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6µm	ASTM D7647	>1300	△ 5296						
Particles >14µm	ASTM D7647	>80	425						
Particles >21µm	ASTM D7647	>20	133						
Particles >38µm	ASTM D7647	>4	<u> </u>						
Oil Cleanliness	ISO 4406 (c)	>/17/13	<u>22/20/16</u>						

Customer Id: AIRMAD Sample No.: KC05979639 Lab Number: 05979639 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Fluid			?	Oil and filter change at the time of sampling has been noted.			
Change Filter			?	Oil and filter change at the time of sampling has been noted.			

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT



KEN G CONSTRUCTION KAESER SK 26 1079

Component

Compressor

ACI 467R (--- GAL)

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Jul2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC05979639		
Sample Date		Client Info		19 Jul 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		36657		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	6		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	7		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m	210	0		
Cadmium	ppm	ASTM D5185m		0		
	la la con					
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		434		
Zinc	ppm	ASTM D5185m		35		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.012		
ppm Water	ppm	ASTM D6304	>500	121.7		
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		29414		
Particles >6µm		ASTM D7647	>1300	5296		
Particles >14µm		ASTM D7647	>80	425		
Particles >21µm		ASTM D7647	>20	<u> </u>		
Particles >38µm		ASTM D7647	>4	<u> </u>		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>22/20/16</u>		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
A : 151	1/011/	ACTM DODAE			5013	


Acid Number (AN)

mg KOH/g ASTM D8045

0.22



OIL ANALYSIS REPORT

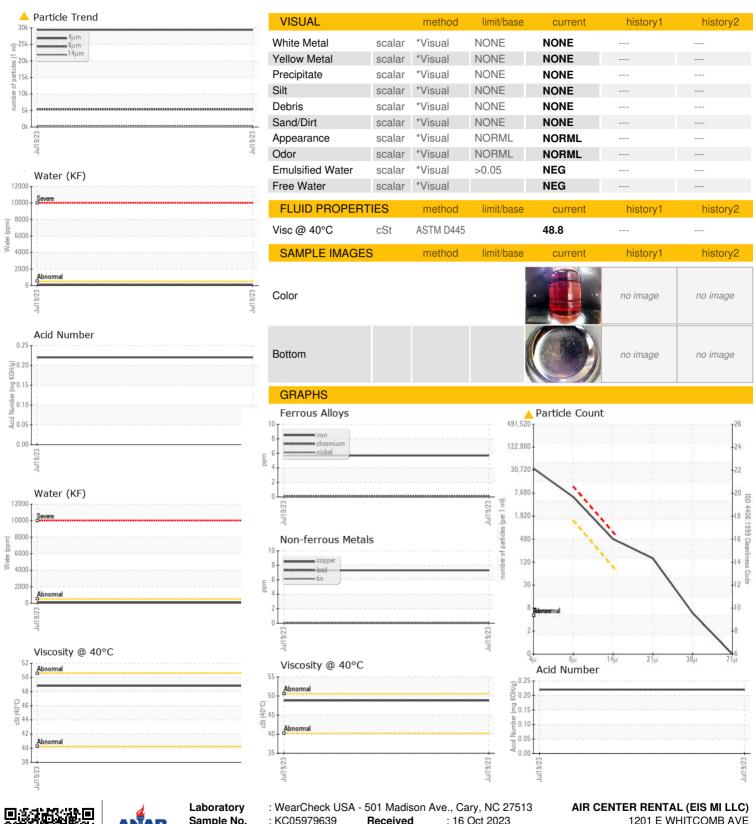



Certificate L2367

Sample No. Lab Number **Unique Number**

Test Package

: KC05979639 : 05979639 : 10696934

: 16 Oct 2023 Received Diagnosed Diagnostician

: 18 Oct 2023 : Jonathan Hester

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

: IND 2

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

1201 E WHITCOMB AVE MADISON HEIGHTS, MI US 48071

Contact: Service Manager LAV@TEAMAIRCENTER.COM

T:

F: