

OIL ANALYSIS REPORT

DAKOTA RANGE III [200006928] **WEA89831**

Component Wind Turbine Gearbox

FUCHS RENOLIN CLP ISO 320 (--- LTR)

Sample Rating Trend



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				0ct2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		NX05981211		
Sample Date		Client Info		02 Oct 2023		
Machine Age	hrs	Client Info		12191		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184	>80	17		
Iron	ppm	ASTM D5185m	>150	16		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m	>10	0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>20	3		
		ASTM D5185m	>50	<1		
Copper	ppm			0		
Tin	ppm	ASTM D5185m	>10	•		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		5		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		15		
Phosphorus	ppm	ASTM D5185m		196		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		4823		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	5		
Sodium	ppm	ASTM D5185m	>20	4		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.008		
ppm Water	ppm	ASTM D6304	>500	86.8		
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		2115		
Particles >6µm		ASTM D7647	>2500	421		
Particles >14μm		ASTM D7647	>320	18		
Particles >21µm		ASTM D7647	>80	4		
Particles >38µm		ASTM D7647	>20	1		
Particles >71µm		ASTM D7647	>4	0		
Oil Cleanliness		ISO 4406 (c)	>/18/15	18/16/11		

Acid Number (AN)


mg KOH/g ASTM D8045

Report Id: NORDEX [WUSCAR] 05981211 (Generated: 10/23/2023 03:14:30) Rev: 1

Contact/Location: DEVIN LINEHAN - NORDEX



OIL ANALYSIS REPORT

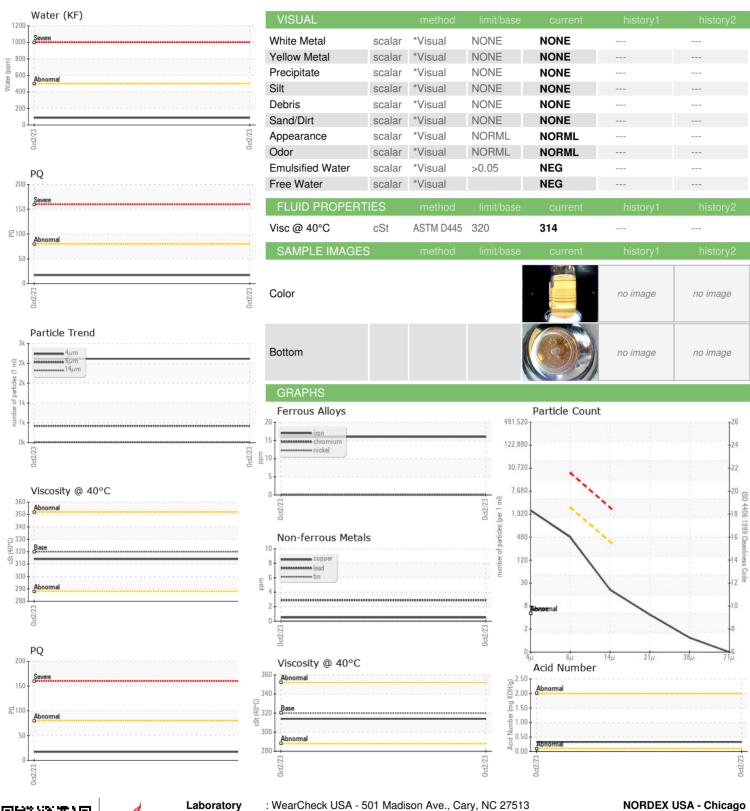



Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: NX05981211 : 05981211

Received : 10698506

Diagnosed : 21 Oct 2023 Diagnostician : Don Baldridge **Test Package**: IND 2 (Additional Tests: KF, PQ, PrtCount)

NORDEX USA - Chicago 300 SOUTH WACKER DRIVE, SUITE 1500 CHICAGO, IL

US 60606 Contact: DEVIN LINEHAN

DLinehan@nordex-online.com T: (312)386-4124

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

: 17 Oct 2023

Report Id: NORDEX [WUSCAR] 05981211 (Generated: 10/23/2023 03:14:30) Rev: 1

Contact/Location: DEVIN LINEHAN - NORDEX

F: (312)386-7102