

OIL ANALYSIS REPORT

Sample Rating Trend







Machine Id Component Hydraulic System Fluid KLUBER (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PTK0004248		
Sample Date		Client Info		12 Oct 2023		
Machine Age	hrs	Client Info		137		
Oil Age	hrs	Client Info		137		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	0		
Lead	ppm	ASTM D5185m	>20	0		
Copper	ppm	ASTM D5185m	>20	0		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		4		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		5		
Phosphorus	ppm	ASTM D5185m		131		
Zinc	ppm	ASTM D5185m		11		
Sulfur	ppm	ASTM D5185m		79		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	2		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	1		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	161		
Particles >6µm		ASTM D7647	>1300	45		
Particles >14µm		ASTM D7647	>160	5		
Particles >21µm		ASTM D7647	>40	1		
Particles >38µm		ASTM D7647	>10	0		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	15/13/10		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.39		


Report Id: NIALAN [WUSCAR] 05981889 (Generated: 10/18/2023 14:53:14) Rev: 1




OIL ANALYSIS REPORT

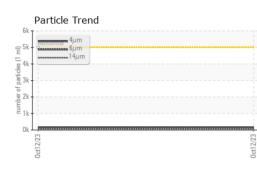

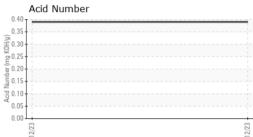

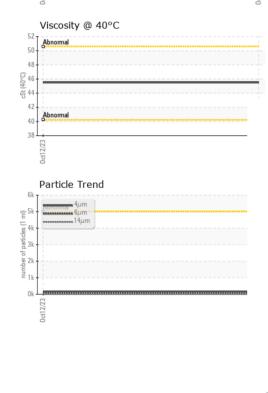

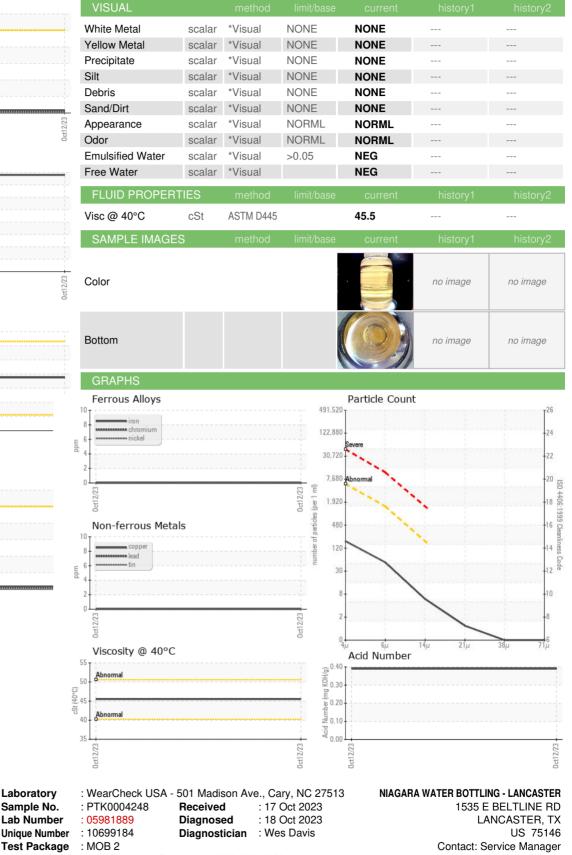

To discuss this sample report, contact Customer Service at 1-800-237-1369.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Certificate L2367

回除

Laboratory

Sample No.

Lab Number

Unique Number

Contact/Location: Service Manager - NIALAN Page 2 of 2

^{* -} Denotes test methods that are outside of the ISO 17025 scope of accreditation.